

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China









CERTI-CRIMP* Hand Crimping Tools

PROPER USE GUIDELINES

Cumulative Trauma Disorders can result from the prolonged use of manually powered hand tools. Hand tools are intended for occasional use and low volume applications. A wide selection of powered application equipment for extended-use, production operations is available.

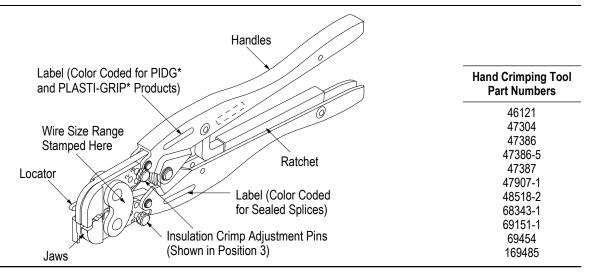


Figure 1

1. INTRODUCTION

CERTI-CRIMP hand crimping tools listed in Figure 1 are used to crimp the products onto the wire listed in Figure 2.



IOTE

Dimensions in this instruction sheet are in millimeters [with inches in brackets]. Figures and illustrations are for reference only and are not drawn to scale.

Reasons for reissue of this instruction sheet are provided in Section 7, REVISION SUMMARY.

2. **DESCRIPTION** (Figure 1)

The handles and label (if applicable) of each tool are color-coded to match the color coding of the product to be crimped. The tools may show more than one color code.

PRODUCT	COPPER WIRE			
PRODUCT	TYPE	SIZE RANGE (AWG)		
PIDG Terminals and Splices	Solid or Stranded	30-14		
PIDG Radiation Resistant Terminals and Splices	Stranded	27-14		
PLASTI-GRIP Butt Splices	Solid or Stranded	26-22		
PIDG Insulation Restricting Nylon Terminals	Stranded	26-14		
PIDG FASTON* Receptacles 641321-1 (.187 Series) and 641324-1 (.110 Series)	Stranded	26-24		
PLASTI-GRIP Terminals	Solid or Stranded	22-14		
Spare Wire Cap	Stranded	22-14		

Figure 2

These tools are members of the CERTI-CRIMP hand crimping tool family. The ratchet ensures full crimping of the product. Once engaged, the ratchet will not release until the handles have been FULLY closed.



CAUTION

The crimping jaws bottom before the ratchet releases. This design feature ensures maximum tensile performance of the crimp. DO NOT re-adjust the ratchet.



3. CRIMPING PROCEDURE

Refer to Figure 3 to ensure that the correct tool and product combination is being used. Figure 3 also lists the number of dots (or dots and rib) that appear embossed on a crimped product when it is crimped using the correct tooling.

3.1. PIDG and PLASTI-GRIP Terminal and Splice and PIDG FASTON Receptacle

1. Strip the wire to the dimension provided in Figure 3 being careful to avoid nicking or cutting the conductor(s).



CAUTION

DO NOT use wire with nicked or missing conductor(s).

2. Open the tool jaws by closing the tool handles until the ratchet releases, then allow the handles to open fully.

TOOL			PRODUC	Т	WIRE			
PART	COLOR	DOT	DESCRIPTION	INSUL COLOR	SIZE RANGE	INSUL DIA	STRIP I	ENGTH
NO.	CODE	CODE	DESCRIPTION	INSUL COLOR	(AWG)	RANGE	TERMINAL	SPLICE
46121	Red and	1	PIDG Terminals and Splices					
169485	Yellow	'	PLASTI-GRIP Butt Splices	Yellow	26-22		4.0-4.8 [5/32-3/16]	4.4-5.2 [11/64-13/64]
47304●	Yellow		PIDG Terminals				, ,	
			PIDG Terminals and Splices	Natural Translucent			4.8-6.6	5.6-6.4 [7/32-1/4]
47907-1	White	2	PIDG Radiation Resistant Terminals and Splices	Natural Translucent with White Stripe	24-20		[3/16-7/32]	
47386	Pod and		PIDG Terminals MS 25036-143 through -147	Yellow			5.2-6.0	
47386-5		1	PIDG Radiation Resistant Terminals MS 7928/4-143 through -147	Natural with Yellow Stripe	26-24		[13/64-15/64]	
			PIDG Terminals and Splices	5.			5.2-6.0 [13/64-15/64]	6.4-7.1 [1/4-9/32]
47386	47386 Red and Yellow		PLASTI-GRIP Terminals	- Red	22-16			
47386-5			PIDG Radiation Resistant Terminals and Splices	Natural Translucent with White Stripe	22 10			
		Red	PIDG Terminals and Splices	Red	22-16		5.2-6.0 [13/64-15/64]	6.4-7.1 [1/4-9/32]
69151-1●	Red		PLASTI-GRIP Terminals	Reu				
			PIDG Radiation Resistant Terminals and Splices	Natural Translucent with White Stripe				
			PIDG Terminals and Splices	Red			5.2-6.0	6.4-7.1
69454	Red	1 Dot	PLASTI-GRIP Terminals	Neu	22-18			
	PIDG Radiation Resist	PIDG Radiation Resistant Terminals and Splices	Natural Translucent with White Stripe			[13/64-15/64]	[1/4-9/32]	
		PLASTI-GRIP Termina	PIDG Terminals and Splices	Blue	16-14	1.04-2.62 [.041103]	5.2-6.0 6.4-7.	
47387	Blue and Green		PLASTI-GRIP Terminals	Green	20-16 HD	0.41-1.65 [.016065]		6.4-7.1 [1/4-9/32]
	Gieen		DIDC Dadiation Decistant Natural Treadment	16-14		[13/64-15/64]	[1/4-5/32]	
			PIDG Radiation Resistant Terminals and Splices Natural Translucent with Blue Stripe	20-16 HD				

[•]Use Tight Insulation Support for Wires with Thin Wall Insulation

Figure 3 (cont'd)

Rev V 2 of 10



TOOL			PRODUC	WIRE							
PART	COLOR	DOT		DESCRIPTION	INSUL COLOR	SIZE RANGE	INSUL DIA	STRIP I	ENGTH		
NO.	CODE	CODE	DESCRIPTION	INSUL COLOR	(AWG)	(AWG)	RANGE	TERMINAL	SPLICE		
46121 169485		Red and		PIDG Insulation Restricting	Yellow with 3 Black Stripes	26	0.66-1.40 [.026055]	4.8-5.6			
47304 ●	Yellow	'	Nylon Terminals	Yellow with 3 Blue Stripes	24	0.79-1.40 [.031055]	[3/16-7/32]				
47386	Red and	1	PIDG Insulation Restricting Nylon	Yellow with 3 Black Stripes	26	0.66-1.40 [.026055]	6.4-7.1				
47386-5	Yellow		24	0.79-1.40 [.031055]	[1/4-9/32]						
	Red and Yellow			Red with 3 Green Stripes	22	0.97-1.40 [.038055]					
47386 47386-5 69151-1●	Tool 1 69151-1 Mod F Red Only	PIDG Insulation Restricting Nylon Terminals	Red with 3 Red Stripes	20	1.17-2.79 [.046110]	6.4-7.1 [1/4-9/32]					
Mod F								Red with 3 White Stripes	18	1.42-2.79 [.056110]	
47387	Blue and Green	2	PIDG Insulation Restricting Nylon Terminals	Blue with 3 Blue Stripes	16	1.60-3.30 [.063130]	6.4-7.1 [1/4-9/32]				
47386 47386-5	Red and Yellow	1	Spare Wire Cap 328307	Red	22-18		8.0-8.7				
47387	Blue and Green	2	Spare Wire Cap 328308	Blue	16-14		[5/16-	11/32]			
48518-2			PIDG FASTON Receptacles 641321-1 (.187 Series) and 641324-1 (.110 Series)	Yellow■	26-24		4.8-5.6 [3/16-7/32]				
68343-1 6.35 [.250] Exp.	Blue	2	PLASTI-GRIP Terminals	Blue	16-14	3.81-6.35 [.150250]	5.2-6.0 [13/64-15/64]				

- •Use Tight Insulation Support for Wires with Thin Wall Insulation
- For Reference Only (Check Product-to-Tool Match Using Part Numbers)

Figure 3 (end)

- 3. Place the product in the jaws as shown in Figure 4 or Figure 5.
- 4. Close the tool handles until the product is held firmly in place. DO NOT deform the wire barrel.
- 5. Insert properly stripped wire(s) into the wire barrel as shown in Figure 4 or Figure 5.



CAUTION

DO NOT allow wire insulation to enter the wire barrel.

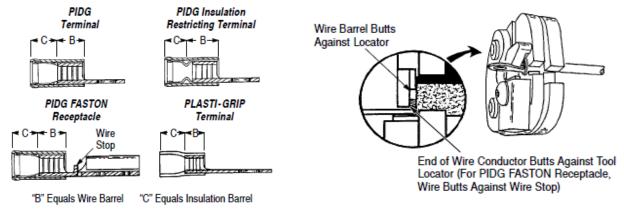


Figure 4

Rev V 3 of 10



- 6. Complete the crimp by closing the tool handles until the ratchet releases.
- 7. Release the tool handles, allow the handles to open fully, and remove the crimped product.
- 8. To crimp the other wire barrel of a splice, re-position the uncrimped wire barrel in the tool as shown in Figure 5, and repeat Steps 2 through 7.
- Inspect the crimped product according to Figure 7. Product not meeting these conditions should NOT be used. If the wire insulation grip is not satisfactory, refer to Section 4 to adjust the grip using the insulation crimp adjustment pins.

3.2. Spare Wire Cap

1. Strip the wire to the dimension provided in Figure 3, being careful to avoid nicking or cutting the conductor(s).



CAUTION

DO NOT use wire with nicked or missing conductor(s).

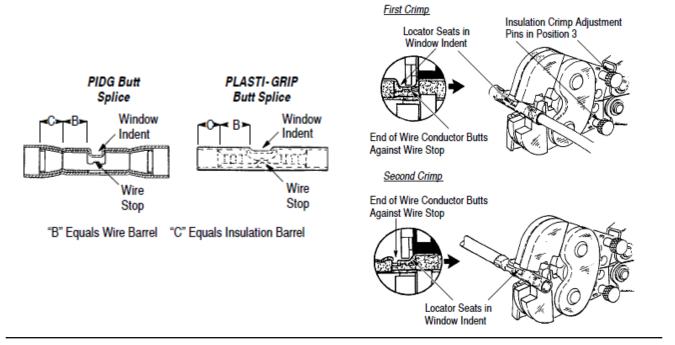


Figure 5

- 2. Place the tool insulation crimp adjustment pins in Position 3.
- 3. Close the tool handles until the jaws partially close, but leave enough space for the spare wire cap to be inserted between the jaws.
- 4. Raise the locator so that the end of the cap rests against the recessed surface of the locator as shown in Figure 6.

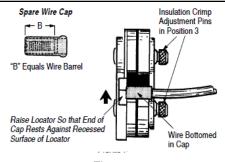


Figure 6

Rev V 4 of 10



- 5. Close the tool handles until the spare wire cap is held firmly in place. DO NOT deform the wire barrel.
- 6. Insert a properly stripped wire into the wire barrel until the wire bottoms.
- 7. Hold the wire in position, and complete the crimp by closing the tool handles until the ratchet releases.
- 8. Release the tool handles, allow the handles to open fully, and remove the crimped spare wire cap.
- Inspect crimped product according to Figure 7. Product not meeting these conditions should NOT be used.

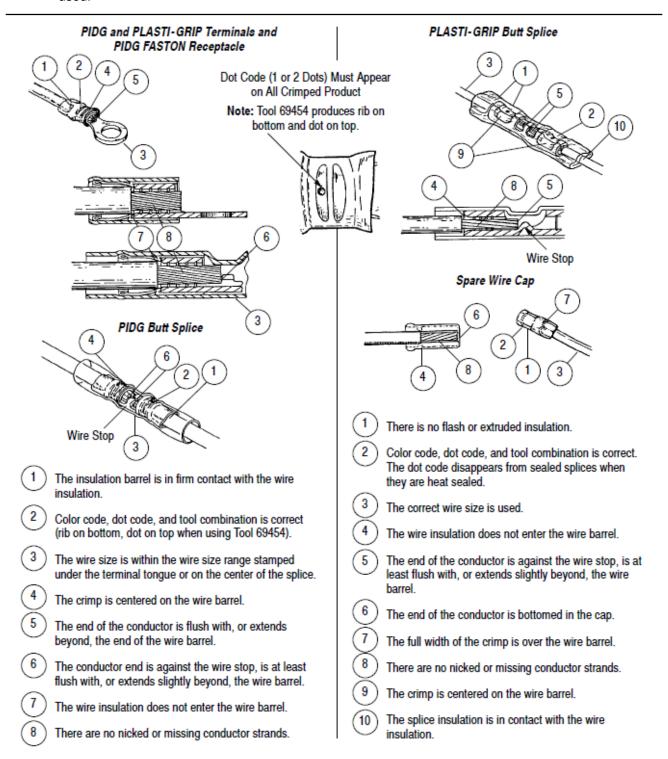


Figure 7

Rev V 5 of 10



4. INSULATION CRIMP ADJUSTMENT

The insulation crimp section of the hand tool has three positions: 1 (tight), 2 (medium), and 3 (loose) to adjust the wire insulation crimp grip. To adjust the insulation grip, proceed as follows:

4.1. PIDG Terminals and Splices and PIDG FASTON Receptacles



NOTE

PIDG terminals and splices feature a wire insulation "grip".

1. Insert the insulation crimp adjustment pins into Position 3. Refer to Figure 1.



CALITION

Make sure that both insulation crimp adjustment pins are in the same position.

- 2. Place a terminal or splice into the tool jaws as shown in Figure 4 or Figure 5.
- 3. Insert UNSTRIPPED wire into ONLY the insulation barrel of the terminal or splice.
- 4. Close the tool handles to complete the crimp.
- 5. Remove the crimped terminal or splice and check the insulation crimp by bending the wire back and forth once. The terminal or splice should retain its grip on the wire insulation. If the wire pulls out, set BOTH insulation crimp adjustment pins to the next higher position (2).
- 6. Perform another crimp, and repeat the adjustment as necessary until the correct insulation grip is attained. DO NOT use a tighter setting than required.

4.2. PLASTI-GRIP Terminals and Splices



NOTE

PLASTI-GRIP terminals and splices feature a wire insulation "support". The terminal or splice insulation should ideally be in contact with the wire insulation.

Set the insulation crimp adjustment pins into position according to the following:

- 3 for wire having a large insulation diameter
- 2 for wire having a medium insulation diameter
- 1 for wire having a small insulation diameter



CAUTION

Make sure that both insulation crimp adjustment pins are in the same position.

5. MAINTENANCE AND INSPECTION

Hand crimping tools are inspected before shipment. The tool received should be inspected immediately upon arrival to ensure that the tool has not been damaged during shipment, and that it performs according to the criteria described in this sheet. If a tool is damaged upon arrival, retain the shipping container, file a claim with the carrier, and notify TE immediately.

5.1. Daily Maintenance

- 1. Remove dust, moisture, and other contaminants from the tool with a clean brush or a soft, lint-free cloth. DO NOT use objects that could damage the tool.
- 2. Make sure that the proper retaining pins are in place and are secured with the proper retaining rings.
- 3. Make certain that all pins, pivot points, and bearing surfaces are protected with a THIN coat of any good SAE 20 motor oil. DO NOT oil excessively.
- 4. When the tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping areas and store the tool in a clean, dry area.

5.2. Periodic Inspection

Regular inspections should be performed by quality control personnel. A record of scheduled inspections should remain with the tool or be supplied to supervisory personnel responsible for the tool. Though

Rev V 6 of 10



recommendations call for at least one inspection per month, the inspection frequency should be based on the amount of use, working conditions, operator training and skill, and established company standards. These inspections should be performed in the following sequence:

A. Visual Inspection

- 1. Remove all lubrication and accumulated film by immersing the tool (handles partially closed) in a suitable commercial degreaser that will not affect paint or plastic material.
- 2. Make certain that all retaining pins are in place and are secured with retaining rings. If replacements are necessary, refer to the parts list in Figure 10.
- 3. Inspect crimping areas for pitted or chipped surfaces.
- Close the tool handles until the ratchet releases, then allow handles to open freely. If they do not open quickly and fully, the spring is defective and must be replaced. Refer to Section 6, REPLACEMENT AND REPAIR.

B. Gaging Crimping Chamber

This inspection requires the use of plug gages conforming to the dimensions listed in Figure 8. To gage the crimping chamber, proceed as follows:

- 1. Close the jaws by squeezing the tool handles together until the jaws have bottomed, and then HOLD the handles in this position. DO NOT force the jaws beyond initial contact.
- 2. Align the GO element of the gage with the wire barrel crimp section of the crimping chamber. Refer to Figure 9. Push the element straight into the crimping chamber without using force. The GO element must pass completely through the crimping chamber.
- Align the NO-GO element of the gage with the same crimp section, and try to insert the element. The NO-GO element may start entry, but it must not pass completely through the crimping chamber. Refer to Figure 9.
- 4. Repeat the gage inspection for the insulation crimp section of the crimping chamber, making sure to use the correct plug gage.

If the crimping chamber conforms to the gage inspection, the tool is considered dimensionally correct. If the crimping chamber does not conform to the inspection, the tool must be repaired. Refer to Section 6, REPLACEMENT AND REPAIR.

For additional information concerning the use of the plug gage, refer to Instruction Sheet 408-7424.

C. Ratchet Inspection

Obtain a .025-mm [.001-in.] shim that is suitable for checking the clearance between the bottoming surfaces of the jaws. To inspect the ratchet control, proceed as follows:

- 1. Refer to Figure 3, and select a product and maximum size wire.
- 2. Position the product in the crimping chamber according to Paragraph 3.1, Steps 1 through 5 or Paragraph 3.2, Steps 1 through 6.
- 3. While holding the wire in place, squeeze the tool handles together until the ratchet releases. Holding the tool in this position, maintain just enough pressure to keep the jaws closed.
- 4. Check the clearance between the bottoming surfaces of the jaws. If the clearance is .025 mm [.001 in.] or less, the ratchet is satisfactory. If clearance exceeds .025 mm [.001 in.], the ratchet is out of adjustment and must be repaired. Refer to Section 6, REPLACEMENT AND REPAIR. If the tool conforms to this inspection procedure, lubricate it with a THIN coat of any good SAE 20 motor oil, and return it to service.

6. REPLACEMENT AND REPAIR

Customer-replaceable parts are listed in Figure 10. Parts other than those listed should be replaced by TE to ensure quality and reliability. For customer repair service or to order replacement parts, call 1-800-522-6752, or fax your purchase order to 717-986-7605, or write to: Customer Service (038-035), TE Connectivity Corporation, PO Box 3608, Harrisburg, PA 17105-3608.


Rev V 7 of 10



7. REVISION SUMMARY

◆ Figure 3: changed color code of PN 47907-1 from [Blue and White] to [White]

Suggested Plug Gage Design — Wire Barrel Crimp Section

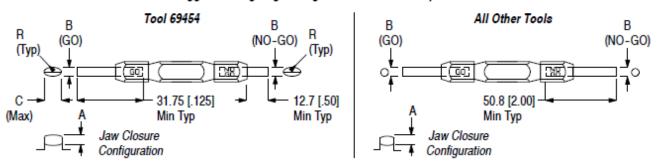

TOOL	JAW CLOSURE+ DIAMETER A		GAGE ELEMENT♦♦ DIAMETER B		DIMENSION	
TOOL	GO	NO-GO	GO	NO-GO	C (WIDTH)	R (RADIUS)
46121 169485	1.600 [.0630]	1.753 [.0690]	1.600-1.608 [.06300633]	1.750-1.753 [.06890690]		
47304	1.600 [.0630]	1.753 [.0690]	1.600-1.608 [.06300633]	1.750-1.753 [.06890690]		
47386 47386-5	2.768 [.1090]	2.921 [.1150]	2.768-2.776 [.10901093]	2.918-2.921 [.11491150]		
47387 68343-1	3.022 [.1190]	3.175 [.1250]	3.022-3.030 [.11901193]	3.172-3.175 [.12491250]		
47907-1	2.260 [.0890]	2.413 [.0950]	2.260-2.268 [.08900893]	2.410-2.413 [.09490950]		
48518-2	1.600 [.0630]	1.753 [.0690]	1.600-1.608 [.06300633]	1.750-1.753 [.06890690]		
69151-1	2.768 [.1090]	2.921 [.1150]	2.768-2.776 [.10901093]	2.918-2.921 [.11491150]		
69454	2.616 [.1030]	2.718 [.1070]	2.616-2.624 [.10301033]	2.715-2.718 [.10691070]	3.962 [.156]	3.454 [.136]

[◆]Jaw closure dimensions apply when wire barrel jaws are bottomed, but not under pressure. ◆◆Material: Tool Steel

Figure 8 (cont'd)

Rev V 8 of 10




Suggested Plug Gage Design — Insulation Barrel Crimp Section F G (GO) G (NO-GO) Jaw Closure Configuration 6.35 [.250] Typ W ±0.13 [±.005]

TOOL	JAW CLOSURE♦ DIMENSION F		GAGE ELEMENT	DIMENSION W	
TOOL	GO	NO-GO	GO	NO-GO	(WIDTH)
46121 169485	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
47304	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
47386 47386-5	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
47387	1.016 [.0400]	1.524 [.0600]	1.016-1.024 [.04000403]	1.521-1.524 [.05990600]	4.75 [.187]
47907-1	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	2.36 [.093]
48518-2	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
69151-1	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
69454	0.762 [.0300]	1.27 [.0500]	0.762-0.77 [.03000303]	1.267-1.27 [.04990500]	3.05 [.120]
68343-1	1.828 [.0720]	2.337 [.0920]	1.828-1.836 [.07200723]	2.334-2.337 [.09190920]	4.75 [.187]

[◆]Jaw closure dimensions apply when wire barrel jaws are bottomed, but not under pressure. ◆◆Material: Tool Steel

Figure 8 (end)

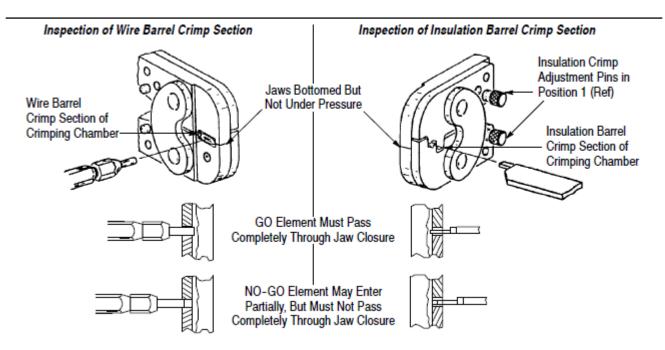


NOTE: Most insulation barrel gages are designed to check one side of the crimp nest at a time.

Figure 9

Rev V 9 of 10



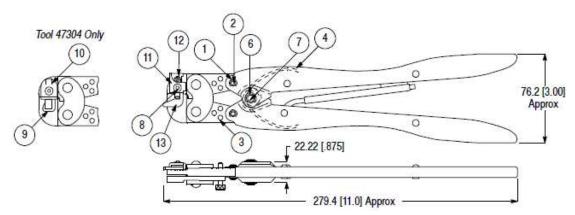

	DESCRIPTION	PART NUMBER FOR TOOL					
ITEM		46121	47304	47386	47386-5	47387 & 68343-1	
1	RING, Retaining	21045-3	21045-3	21045-3	21045-3	21045-3	
2	PIN, Retaining	1-23619-6	1-23619-6	1-23619-6	1-23619-6	1-23619-6	
3	PIN, Adjustment	39207	39207	39207	39207	39207	
4	SPRING	39364	39364	39364	39364	39364	
6	RING, Retaining	21045-6	21045-6	21045-6	21045-6	21045-6	
7	PIN, Retaining	2-23620-9	2-23620-9	2-23620-9	2-23620-9	2-23620-9	
8	SCREW	3-306105-9	3-21016-4	9-305927-1	9-305927-1	9-305927-1	
9	SUPPORT		39193				
10	STOP		302765				
11	LOCATOR, Housing	302994		302994	302994	302994	
12	SPRING	301201		301201	301201	301201	
13	LOCATOR	3-304052-6		302993	302993	45965-6	

ITEM	DESCRIPTION	PART NUMBER FOR TOOL					
I I CIVI	DESCRIPTION	47907-1	169485	48518-2	69151-1	69454	
1	RING, Retaining	21045-3	21045-3	21045-3	21045-3	21045-3	
2	PIN, Retaining	1-23619-6	1-23619-6	1-23619-6	1-23619-6	1-23619-6	
3	PIN, Adjustment	39207	39207	39207	39207	39207	
4	SPRING	39364	39364	39364	39364	39364	
6	RING, Retaining	21045-6	21045-6	21045-6	21045-6	21045-6	
7	PIN, Retaining	2-23620-9	2-23620-9	2-23620-9	2-23620-9	2-23620-9	
8	SCREW	3-306105-9	3-21016-4	9-305927-1	9-305927-1	9-305927-1	
9	SUPPORT						
10	STOP						
11	LOCATOR, Housing	302994	302994	302994	302994	302994-1	
12	SPRING	301201	301201	301201	301201	2-304668-6	
13	LOCATOR	303542	575960-4	125644-7	302993	4-304052-6	

Figure 10

Rev V 10 of 10