

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



### Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832


Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China







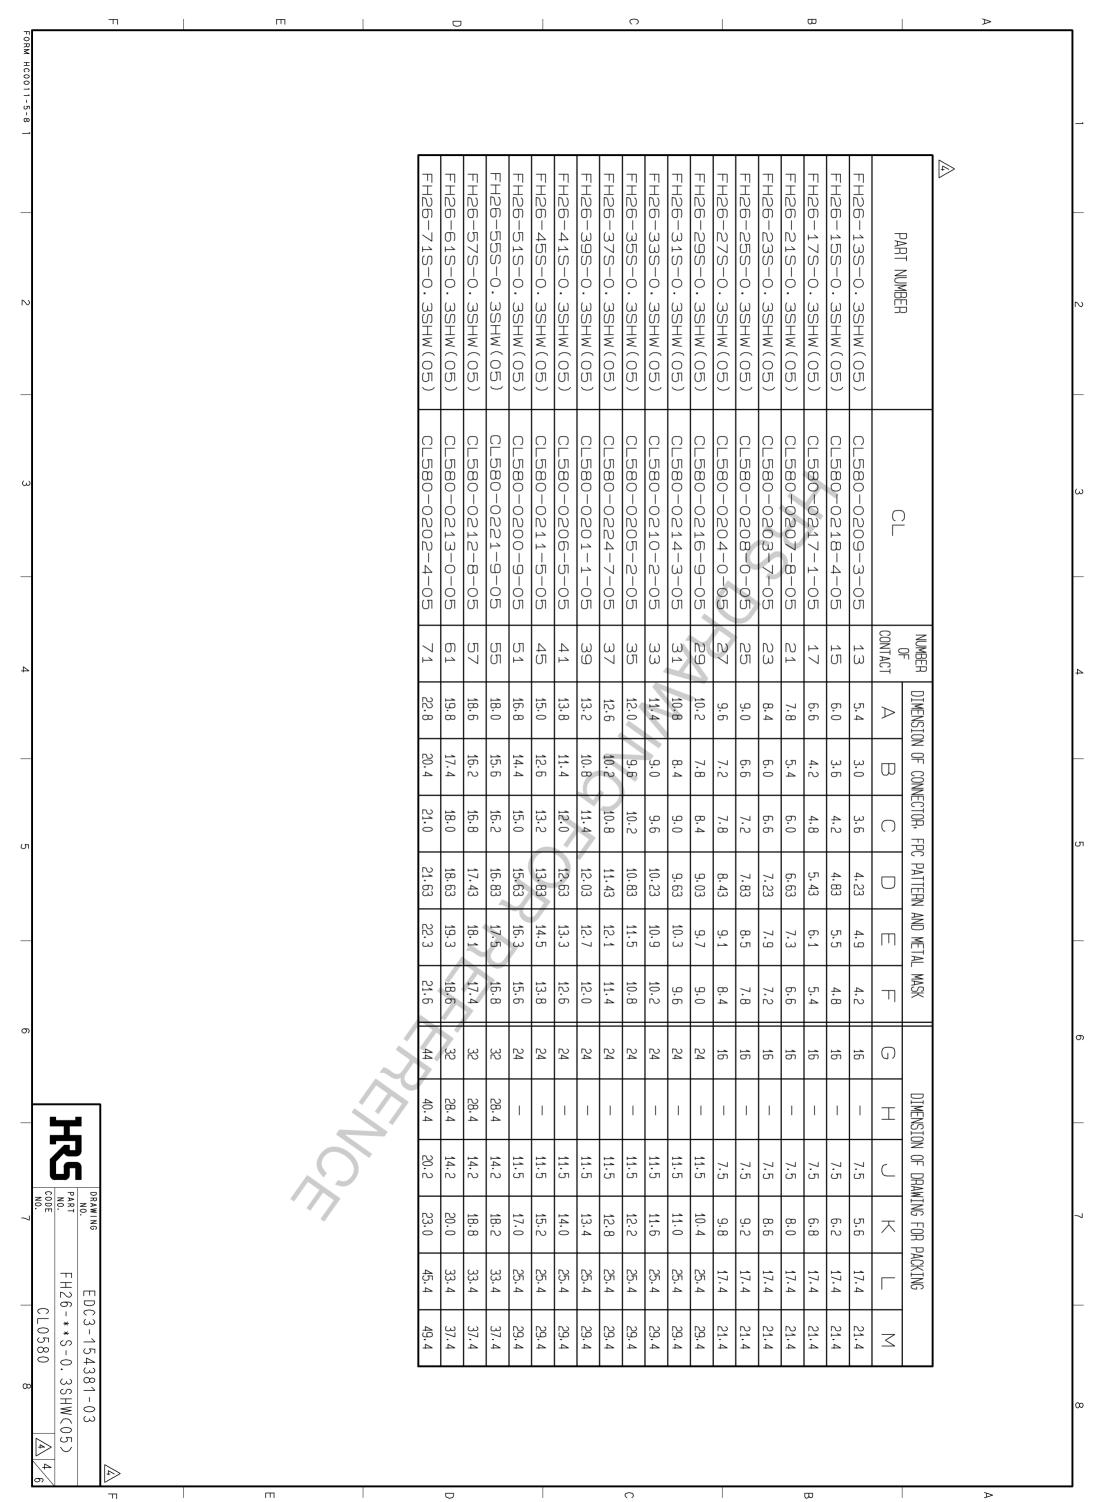

0.5MAX

100

EDC3-154381-03 FH26-\*\*S-0.3SHW(05)

П

П

D

 $\circ$ 


 $\varpi$ 

 $\triangleright$ 

CL0580

4 5

Move the lock lever at approximately the center. Do not pinch or pick the lock lever to lift it as shown below. Otherwise, it may break. (Do not carry out any operation other than rotating the lever as shown in 2 above.)

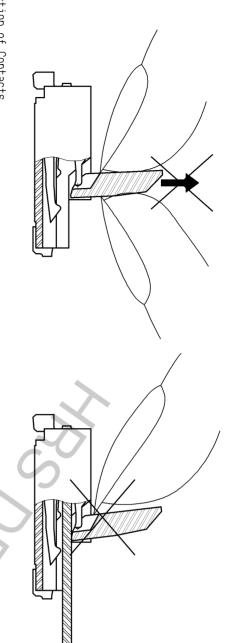

### ♦Direction of Contacts

This connector has contacts on the bottom. Thus, insert the FPC with the exposed conductors face down


### ♦Inserting the FPC

- Insert the FPC horizontally along the surface and at a right angle to the connector. Insert it properly to the very end
- If the FPC is inserted at a slant (incorrectly).
- the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminals resulting in deformation of the terminals.
- This connector has a ZIF structure, and its effective engagement length is 0.35 mm (when the recommended FPC nominal is used).
- the lock lever carefully to prevent the FPC from dislocating after inserting it
- $\dot{\wp}$ Do not insert the FPC diagonally from above. If the FPC is inserted at a slant (incorrectly) as shown below in the FPC insertion process the FPC may bend and patterns may break or the FPC may not insert completely. resulting in improper conduction.

\*Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion.

Besides, it is not difficult to insert FPC correctly all the way to the end. Design the proper layout of parts.

\*Make adjustments with the FPC manufacturer for FPC bending perfomance and wire breakage

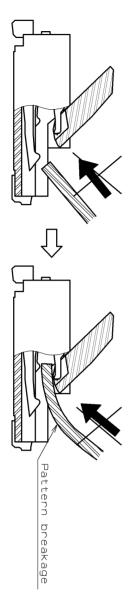

П

## ◆Checking the Locking Condition

In the locked condition, make sure that the lock lever is horizontal on the board surface. Do not apply excessive force to it near the 0° position of the lever. Otherwise, the terminals may be deformed. (Allowable force: 1 N or less)


# INSTRUCTIONS ON FPC LAYOUT AFTER CONNECTION

 $\triangleright$ 

### Otherwise,

◆Load to FPC


Fix the FPC. in particular, when loads are applied to it continuously. Be very careful not to apply any force to the Design the FPC layout with care not to bend it sharply near the insertion opening. reful not to apply any force to the FPC after inserting it. the connector may become unlocked or the FPC may break.



 $\varpi$ 

## INSTRUCTIONS ON REMOVING FPC

♦Release the lock lever to remove the FPC.

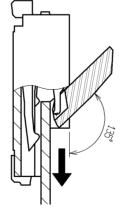

 $\circ$ 

### OTHER INSTRUCTIONS

## ♦Instructions on Manual Soldering

Follow the instructions shown below when solder ing the connector manually during repair work, etcodering with the FPC inserted into the connector.

 $\Box$ 

- Do not perform reflow soldering or manual sol
- 2. Do not heat the connector excessively. any parts other than connector leads. Otherwise, the connector may be deformed or melt. Be very careful not to let the soldering iron contact
- Do not use excessive solder (or flux).

  If excessive solder (or flux) is used on the of the lock lever. or rotating parts of the lock lever, resulting terminals, solder or flux may adhere to the contacts in poor contact or a rotation failure

ယ

Supplying excessive solder to the reinforcing resulting in breakage of the connector. bracket may hinder lock lever rotation

П

>				
		<b>H</b> 5		
7	CODE NO.	PART NO.	DRAWING NO.	
0	CL0580	FH26-**S-0.3SHW<05	EDC3-154381-03	
	66	5)		<u>/4\</u>