Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from,Europe,America and south Asia,supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts,Customers Priority,Honest Operation,and Considerate Service",our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip,ALPS,ROHM,Xilinx,Pulse,ON,Everlight and Freescale. Main products comprise IC,Modules,Potentiometer,IC Socket,Relay,Connector.Our parts cover such applications as commercial,industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!

Contact us

Vibration Sensor with Linear Output or Manual Setting
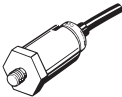# D7F

Detects Changes in Machine Vibration

- ON/OFF output can be set and checked quickly and easily from the vibration level meter.
- Vibration waveforms can be checked using the AC monitor output.
- The IP67 rating enables use in harsh environments.
- Selectable acceleration and speed available. (Linear Output Models)
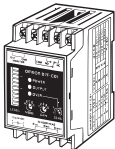- Five operating modes ensure highly accurate error detection. (Manual Setting Models)

⚠ **Refer to *Safety Precautions* on page 5.**

Ordering Information

Sensors

Appearance	Type	Cable length	Model
	Manual setting	5 m	**D7F-S01-05**
		10 m	**D7F-S01-10**
	Linear output	5 m	**D7F-S03-05**

Controllers

Appearance	Type	Model
	Manual setting	**D7F-C01**
	Linear output	**D7F-C03**

Ratings and Specifications

Sensors

Type Item	Manual Setting Models D7F-S01-05/D7F-S01-10	Linear Output Model D7F-S03-05
Sensitivity *	5.1 mV/(m/s^2) (typical)	5.1 mV/(m/s^2) ±20% (at 100 Hz)
Detection frequency	20 Hz to 2 kHz (±3 dB)	10 Hz to 2 kHz (±3 dB)
Resonance frequency	Approx. 5 kHz	(Approx. 20 kHz)
Max. acceleration	784 m/s^2	98 m/s^2
Vibration resistance (destruction)	10 Hz to 2 kHz, 2-mm single amplitude or 392 m/s^2	10 to 150 Hz, 0.35-mm single amplitude or 50 m/s^2
Shock resistance (destruction)	294 m/s^2 3 times each in X, Y, and Z directions	150 m/s^2
Connectable vibration sensor Controller	D7F-C01	D7F-C03
Degree of protection	IP67 (IEC 60529)	
Insulation resistance	20 MΩ min. at 100 VDC between the case and all terminals	100 MΩ min. at 100 VDC between the case and all terminals
Dielectric strength	1,000 VAC between the case and all terminals at 50/60 Hz for 1 min	
Ambient operating temperature range	−25 to 70°C (with no icing or condensation)	
Ambient operating humidity range	25% to 95% (with no icing or condensation)	
Storage temperature	−40 to 80°C (with no icing or condensation)	
Weight	Approx. 40 g (excluding the cable)	

*Sensor characteristic

## Controllers

Type Item	Manual Setting Model D7F-C01	Linear Output Model D7F-C03		
Power supply voltage range	12 to 24 VDC±10% (10.8 to 26.4 VDC)			
Current consumption	200 mA max.	100 mA max.		
Ambient operating temperature range	−20 to 60°C (with no icing or condensation)	−10 to 55°C (with no icing or condensation)		
Ambient operating humidity range	25% to 95% (with no icing or condensation)	25% to 85% (with no icing or condensation)		
Storage temperature	−35 to 70°C (with no icing or condensation)	−25 to 65°C (with no icing or condensation)		
Vibration resistance (destruction)	10 to 150 Hz, 0.75-mm single amplitude, maximum acceleration of 98 m/s^2	10 to 150 Hz, 0.35-mm single amplitude or 50 m/s^2		
Shock resistance (destruction)	294 m/s^2	150 m/s^2		
Connectable Vibration Sensor	D7F-S01-☐☐	D7F-S03-05		
Output	**Relay output**	SPDT (30 VDC, 3 A or 250 VAC, 3 A resistive load) ON delay: 0.1 s min. in Continuous Vibration Detection Mode 5 ms in Intermittent Vibration Detection Mode OFF delay: 1s	**Analog DC**	Output range	4 to 20 mA
				Allowable load resistance	300 Ω max.
			Transistor	Output configuration	NPN open collector
				Residual voltage	1.5 V max.
				Leakage current	0.1 mA max.
				Max. load voltage	26.4 VDC
				Max. sink current	100 mA max.
				Min. output time	50 ms min.
	AC monitor *1 *2	±4 VAC (output impedance: 10 kΩ) The output voltages for each range are shown below. ×1 range, 5.1 mV (m/s^2) (typical) ×3 ranges, 15.3 mV (m/s^2) (typical) ×10 ranges, 51 mV (m/s^2) (typical) ×30 ranges, 153 mV (m/s^2) (typical) ×100 ranges, 510 mV (m/s^2) (typical)	**AC monitor** *1 *2	ACC (reference values)	×1 range, 5.1 mV/(m/s^2) (typical) ×5 ranges, 25.5 mV/(m/s^2) (typical) ×10 ranges, 51 mV/(m/s^2) (typical)
				VEL (reference values)	×1 range, 25.4 mV/(mm/s) (typical) ×5 ranges, 127 mV/(mm/s) (typical) ×10 ranges, 254 mV/(mm/s) (typical)
				Impedance	10 kΩ
Vibration level indicator	10-level meter			
Additional functions	Relay output for a sensor cable disconnection and a flashing level meter	ALM indication for sensor cable disconnections		
Weight	Approx. 120 g			

*1. The AC monitor output is used to check simple waveforms.
Do not use it for precision measurements or waveform analysis.
The following diagram shows the monitor output voltage.

*2. These values correspond to an acceleration of 1 m/s^2.

		ACC (acceleration)	VEL (velocity)
Range (rms)	×1	0 to 98 m/s^2	0 to 20 mm/s
	×5	0 to 19.6 m/s^2	0 to 4 mm/s
	×10	0 to 9.8 m/s^2	0 to 2 mm/s
Frequency range		20 to 2,000 Hz	10 to 1,000 Hz
Linearity		±5% FS (at 100 Hz)*3	
Gain error		±5% FS (at 100 Hz)*3	
Zero point offset		4±0.2 mA (at 20°C)*3	

*3. Controller characteristic

Nomenclature

Manual Setting Model

D7F-C01 Vibration Sensor Controller

Vibration Sensor Controllers process signals from Vibration Sensors, detect errors, and produce an external output.

Monitor output ±4 VAC (Impedance: 10 W)

Relay output

(4) (1) (2) (5) (6) (7) (3)
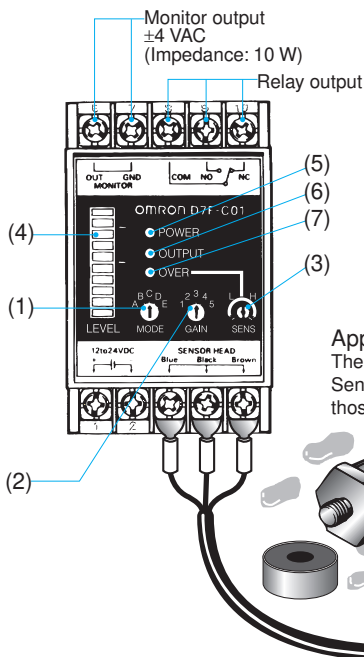
Applicable in Wet Environments

The IP67 (dust-proof and immersion-proof) rating for Vibration Sensors enables application in harsh environments, including those exposed to water.

A quick-mounting magnet is provided to help locate the detection position

• D7F-S01-□□ Vibration Sensor

Vibration Sensors use piezoelectric ceramic devices to convert vibration to electric signals.

Operations

(1) MODE Selector

Selects the waveform processing mode.

MODE	Waveform		Application example
A	Continuous vibration detection	20 Hz to 20 kHz	General purpose, monitoring, etc.
B		20 Hz to 200 Hz	Imbalance, deviation, etc.
C		200 Hz to 2 kHz	High-speed rotating object error, etc.
D		2 kHz to 20 kHz	Bearing damage, etc.
E	Intermittent vibration detection		Contact, shock, etc.

(2) GAIN Selector (1 to 100 x)

The GAIN Selector is used to change the signal strength.
Example: Increasing signal strength

Threshold
Vibration

(3) Sensitivity Adjuster

The sensitivity adjuster is used to change the threshold setting.

Threshold
Vibration
L side
H side

Indicators

(4) LEVEL METER (10 levels)

The Level Meter indicator clearly shows the vibration level.

(5) POWER

The POWER indicator is lit when the power is ON.

(6) OUTPUT

The OUTPUT indicator is lit when the output relay is operating.

(7) OVER

The OVER indicator is lit when vibration is detected.

Sensor Frequency Characteristics

Output
0dB
20 Hz   2 kHz   5 kHz (Resonance point)
Frequency
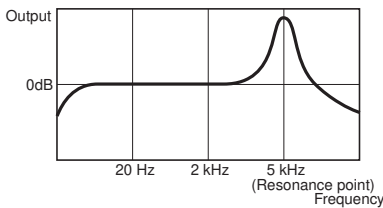
Terminology

The following diagram shows ON and OFF delay times.

Vibration input   Yes / No
Relay output   ON / OFF
ON delay   OFF delay

Linear Output Model

D7F-C03

(5) (6) (7) (8) (1) (3) (2) (4)
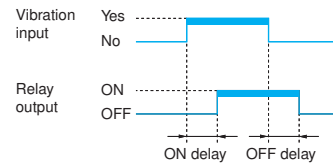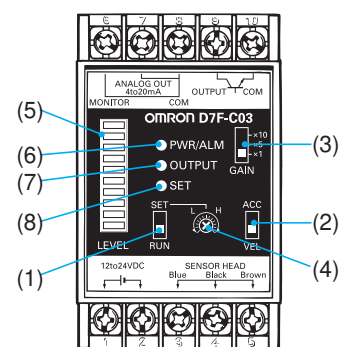
Operations

(1) RUN/SET Selector

The RUN/SET Selector sets the Level Meter indication to RUN or SET.

(2) ACC/VEL Selector

The ACC/VEL Selector sets the operating mode to acceleration or velocity.

(3) GAIN Selector

The GAIN Selector changes the signal strength.

(4) Threshold Adjuster

The Threshold Adjuster sets the threshold value.

Indicators

(5) Level (10 levels)

RUN: Indicates vibration magnitude.
SET: Indicates threshold settings.

Level Meter levels	Vibration level and threshold settings
10	95% or higher FS
9	85% to 95% FS
8	75% to 85% FS
7	65% to 75% FS
6	55% to 65% FS
5	45% to 55% FS
4	35% to 45% FS
3	25% to 35% FS
2	15% to 25% FS
1	5% to 15% FS

Note: Use the Level Meter indicator strictly as a guideline.

(6) PWR/ALM Indicator

Power ON: Green light
Sensor error: Red light

(7) OUTPUT Indicator

The output transformer operates and the OUTPUT indicator lights at vibration levels exceeding the threshold setting.
The output and indications are the same whether RUN or SET is selected.

(8) SET Indicator

The SET Indicator is lit when SET is selected from the RUN/SET selector.

Safety Precautions

Precautions for Safe Use

Do not perform wiring work or touch any terminals with power supplied. Doing so may result in electric shock.

Precautions for Correct Use

Do not use this product in atmospheres or environments that exceed product ratings.

Sensor Installation

- Wipe the mounting surface to remove all dirt and use a No. 17 wrench to secure the D7F in place.
  Optimum tightening torque: 4.4 to 5.4 N·m
  Mounting hole dimensions: M6 holes, Depth: 7 mm min.
- The D7F may not operate correctly if it is not secured with the proper torque or the mounting surface is not cleaned properly prior to installation.
- The quick-mounting magnet is provided to help locate the proper detection position. Make sure the D7F is secured with screws for long-term applications.
- The quick-mounting magnet will not hold the D7F if the magnet is installed vertically or backwards.

Quick-mounting Magnet Dimensions

Sensor Mounting Direction

Mount the D7F as indicated by the circle in the diagram below.
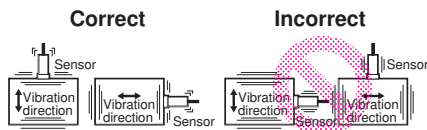
Handling the Sensor

- The Sensor Cable can be cut to any length, but it cannot be extended.
- Do not disassemble the D7F. Otherwise, it may not operate properly.
- Make sure all wiring is correct and be careful not to short wires while wiring.
- Do not install the D7F in locations subject to oil. Otherwise, the rubber seal will deteriorate, allowing liquids such as oil or water to enter the D7F, which may cause it to fail.
- The D7F should be connected only to a specified Controller, such as the D7F-C01 or D7F-C03.

Handling the Controller

- The Controller should be connected only to a specified Sensor, such as the D7F-S01-☐☐ or D7F-S03-☐☐.
- Do not attempt to disassemble the Controller. Otherwise, it may not operate properly.
- Do not install the Controller in a dusty location or one subject to water or oil.
- Do not mount the Controller directly to any source of vibration.

Removing the D7F from a DIN Track

Remove the D7F from a DIN Track as shown in the diagram on the right.

Flat-blade screwdriver (Blade width: 4 mm max.)
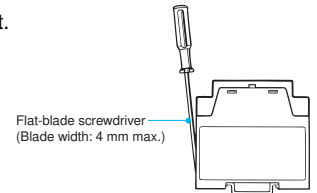
When Using the Product in an Environment in Which Noise Is Present

Use the Electromagnetic Shielding Sleeve DS-10 made by Sumitomo 3M.
Using any other shielded wire may cause the D7F-C01 to vibrate.

Dimensions

Sensors

D7F-S01-05
D7F-S01-10

Mounting screw (M6)

5,000 ±100*

(55)

17 0 -0.25

17 0 -0.25

5 | 23 | 6

1.5 | 1

6.5 ±0.4

16 dia.

Cable (4 dia.)
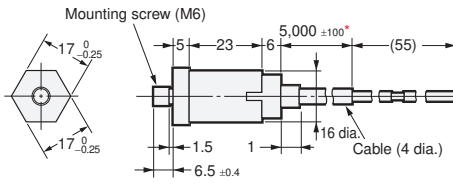
*10,000 ±100 for a cable 10 m long.

D7F-S03-05

Mounting screw (M6)

16 dia. 13 dia.

6 dia. 4 dia.

Heat shrinkable tubing

17 0 -0.25

17 0 -0.25

1.5

6.5 ±0.4 | 5 | 23 | 6

6

5,000 ±100

35 ±5

Controllers

D7F-C01

Mounting Hole Dimensions

72.4

4.3

45

75

4.8 dia.

Two, M3.5

4

35.2

67

67 +1 0

4.8

Ten, M3.5

7

D7F-C03

Mounting Hole Dimensions

(0.5)

72.4

4.3

45

75

4.8 dia.

Two, M3.5

4

35.2

67

67 +1 0

4.8

Ten, M3.5

7
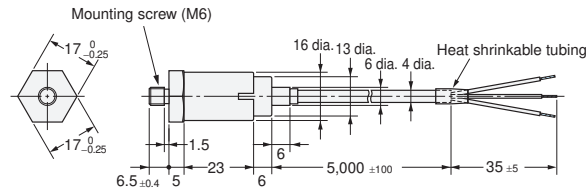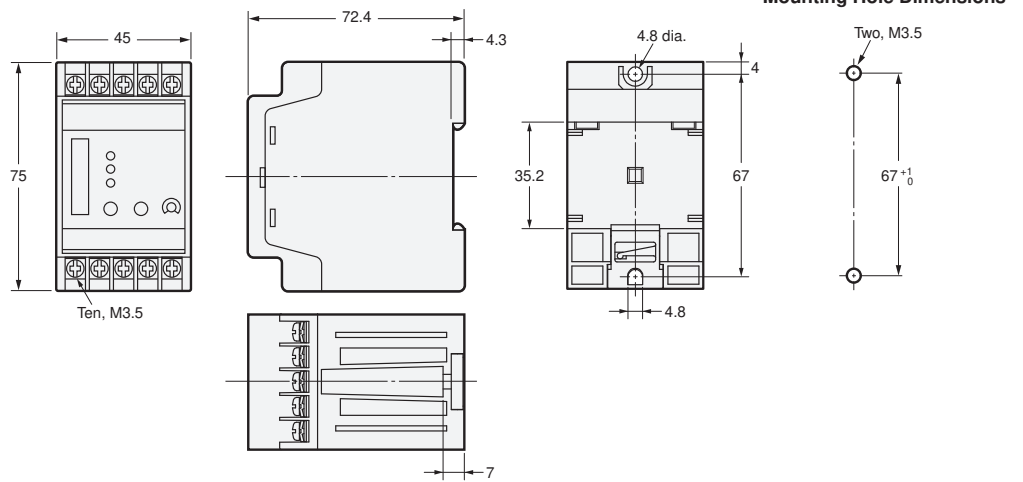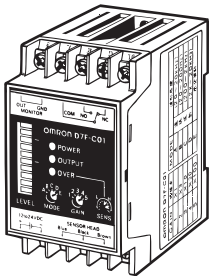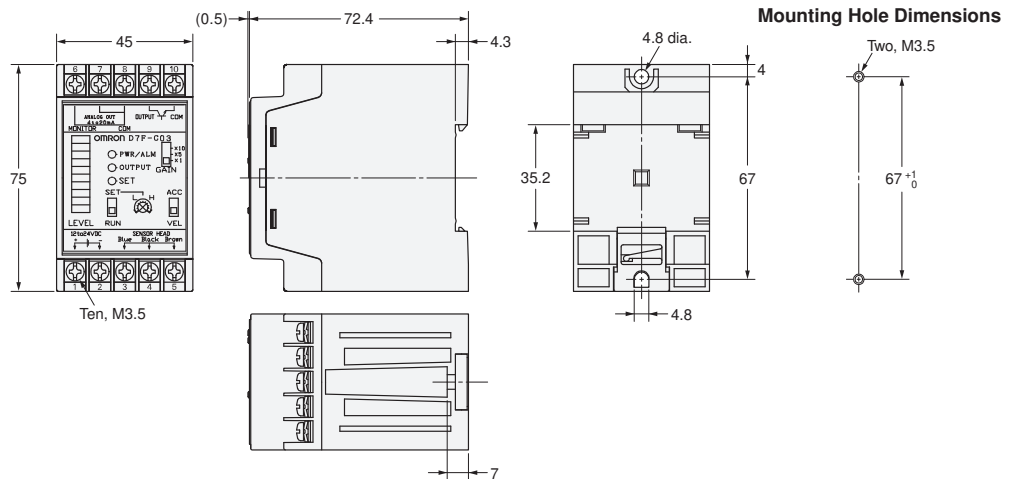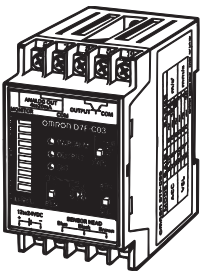
Terms and Conditions Agreement