

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China









Fluke 805 Vibration Meter

Technical Data

The reliable, repeatable, accurate way to check bearings and overall vibration.

Make go or no-go maintenance decisions with confidence. The Fluke 805 Vibration Meter is the most reliable vibration screening device available for frontline mechanical troubleshooting teams that need repeatable, severity-scaled readings of overall vibration and bearing condition.

What makes the Fluke 805 the most reliable vibration screening device available?

- Innovative sensor design minimizes measurement variations caused by device angle or contact pressure
- Consistent data quality at both low and high frequency ranges
- Four-level severity scale assesses urgency of problems for overall vibration and bearing condition
- Exportable data via USB
- Trending in Microsoft® Excel using built-in templates
- Overall vibration measurement (10 Hz to 1,000 Hz) for acceleration, velocity and displacement units of measurement for a wide variety of machines
- Crest Factor+ technology provides reliable bearing assessment using direct sensor tip measurements between 4,000 Hz and 20,000 Hz
- Colored lighting system (green, red) and on-screen comments indicate how much pressure needs to be applied to take measurements
- Temperature measurement with Spot IR Sensor increases diagnostic capabilities
- On-board memory holds and saves up to 3,500 measurements
- Audio output for listening to bearing tones directly
- External accelerometer support for hard to reach locations
- Flashlight for viewing measurement locations in dark areas
- Large screen with high resolution for easy navigation and viewing






What is Crest Factor +?

Fluke 805 with Crest Factor + takes the confusion out of bearing assessment

The original Crest Factor is used by vibration analysts to identify bearing faults. It is defined as the ratio of the peak value/RMS value of a time domain vibration signal.

A key limitation of using Crest Factor to identify bearing faults is that the Crest Factor does not increase linearly as the bearing degrades. In fact, the Crest Factor can actually decrease as a bearing nears catastrophic failure due to large RMS values.

In order to overcome this limitation, Fluke uses a proprietary algorithm known as Crest Factor + (CF+). CF+ values range from 1 to 16. As the bearing condition worsens, the CF+ value increases. To keep things simple, Fluke has also included a four-level severity scale that identifies the bearing health as Good, Satisfactory, Unsatisfactory or Unacceptable.

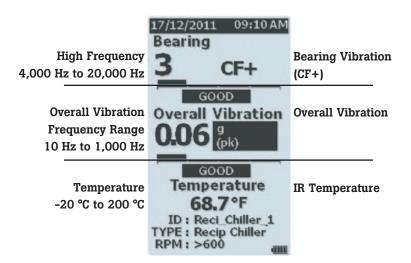

Exporting and Trending with the 805


Export and Trend in Excel

Trending, or repeated vibration measurements kept in a spreadsheet over time, is the best method to track machine health. With 805 you can easily:

- Export your result to Excel through USB connection
- Trend the readings with the pre-built Excel templates and plot graphs
- Compare the overall vibration readings to ISO Standards (10816-1, 10816-3, 10816-7)

Import measurements from the 805 Vibration Meter to an Excel template on your PC in order to trend the bearing parameters: overall vibration, CF+, and temperature. Looking at just the number alone for the overall vibration or temperature might not be of much benefit to the operator or technician if they don't know what the number means. The user may not know what is normal or what indicates a problem.

If measurements taken on the operator rounds are easily loaded into Excel, then the trend will show patterns of something that is becoming abnormal. The user can now see a clear picture of the changing bearing condition and deteriorating health of the machine.

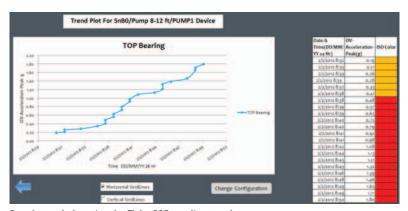

Sample trend plot using the Fluke 805 trending template.



Use the Fluke 805 Vibration Meter to check these machine categories:

Chiller (refrigeration)

- Reciprocating (Open motor and compressor separate)
- Reciprocating (Hermetic motor and compressor)
- Centrifugal (Hermetic or Open Motor

Fans

- Belt-driven Fans 1800 to 3600 RPM
- Belt-driven fans 600 to 1799 RPM
- General direct drive fans (direct coupled)
- Vacuum blowers (belt or direct drive)
- Large forced draft fans (fluid film brgs.)
- · Large induced draft fans (fluid film brgs.)
- Shaft-mounted intergral fan (extended motor shaft)
- Axial flow fans (belt or direct drive)

Cooling tower drives

- · Long, hollow drive shaft (motor)
- Belt drive (motor and fan all arrangements)
- Direct drive (motor and fan all arrangemetns

Centrifugal Pumps

Note: height is measured from grade to top motor bearing

- Vertical pumps (12' to 20' height)
- Vertical pumps (8' to 12' height)
- Vertical pumps (5' to 8' height)
- Vertical pumps (0' to 5' height)
- Horizontal centrifugal end suction pumps direct coupled

- Horizontal centrifugal double suction pumps direct coupled
- Boiler feed pumps (turbine or motor driven)

Positive Displacement Pumps

- Positive displacement horizontal piston pumps (under load)
- Positive displacement horizontal gear pumps (under load)

Air compressors

- Reciprocating
- · Rotary screw
- Centrifugal with or without external gearbox
- Centrifugal internal gear (axial meas.)
- Centrifugal internal gear (radial meas.)

Blowers

- Lobe-type rotary blowers (belt or direct drive)
- Multi-stage centrifugal blowers (direct drive)

Generic gearboxes (rolling element bearings)

Single stage gearbox

Machine tools

- Motor
- · Gearbox input
- Gearbox output
- Spindles roughing operations
- Spindles machine finishing
- Spindles critical finishing





Technical specifications

Low frequency range (overall measurement)	Vibration meter		
(CF+ measurement)			
Unacceptable Vibration limit 50 g peak (100 g peak-peak) A/D converter 16-bit Signal to noise ratio 80 dB Sampling rate Low frequency High frequency 80,000 Hz Real time clock backup Coin battery Sensor Sensitivity 100 mV / g ± 10% Measurement range 0.01 g to 50 g Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution 0.01 g Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration g, m/sec² Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
A/D converter Signal to noise ratio Sampling rate Low frequency High frequency Real time clock backup Sensor Sensitivity 100 mV / g ± 10% Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz 10 Hz to 1,000 Hz 20,000 Hz 10 Hz to 1,000 Hz 10 Hz to 1,000 Hz			
Signal to noise ratio Sampling rate Low frequency High frequency Real time clock backup Sensor Sensitivity 100 mV / g ± 10% Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution O.01 g Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration g, m/sec² Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Sampling rate Low frequency 20,000 Hz High frequency 80,000 Hz Real time clock backup Coin battery Sensor Sensitivity 100 mV / g ± 10% Measurement range 0.01 g to 50 g Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution 0.01 g Accuracy At 100 Hz ± 5 % of measured value and the sensor of the surface o			
Low frequency 80,000 Hz Real time clock backup Coin battery Sensor Sensitivity 100 mV / g ± 10% Measurement range 0.01 g to 50 g Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution 0.01 g Accuracy At 100 Hz ± 5 % of measured value and the sensor of the sensor of the surement of the sensor of the surement of the surement of the sensor of the surement of the suremen			
High frequency Real time clock backup Sensor Sensitivity 100 mV / g ± 10% Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration G, m/sec² Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range Coin battery 20,000 Hz 4,000 Hz 4,000 Hz 5 % of measured value 4,000 Hz 5 % of measured value 4,000 Hz 5 % of measured value 4 **C **C **C **D **C **C **C **C **C **C			
Real time clock backup Sensor Sensitivity 100 mV / g ± 10% Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution O.01 g Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration g, m/sec² Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 100 mV / g ± 10% 0.01 g 4,000 Hz to 20,000 Hz 4,000 Hz 5 % of measured value 4,000 Hz ± 5 % of measured value 4 measurement value 4 measurement value 4 measurement value 5 % of measured value 6 c value value 7 % of value value 8 % of value value 8 % of value value 9 % of value value 10 Hz to 1,000 Hz			
Sensitivity Sensitivity 100 mV / g ± 10% Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution O.01 g Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration g, m/sec² in/sec, mm/sec Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Sensitivity Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz to 1,000 Hz (CF+ measurement) Resolution O.01 g Accuracy At 100 Hz ± 5 % of measured value of measured value of measured value of measurement of mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Measurement range Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration G, m/sec² Velocity Displacement Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz 4,000 Hz 4,000 Hz 5 % of measured value 4,000 Hz 5 % of measured value 4 **C **C **C **C **C **C **C **C **C **			
Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz ± 5 % of measured value and the state of the s			
Low frequency range (overall measurement) High frequency range (CF+ measurement) Resolution Accuracy At 100 Hz ± 5 % of measured value and the state of the s			
CF+ measurement Resolution O.01 g			
Accuracy At 100 Hz ± 5 % of measured value Amplitude units Acceleration G, m/sec² Velocity in/sec, mm/sec mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Amplitude units Acceleration g, m/sec² Velocity in/sec, mm/sec Displacement mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Amplitude units Acceleration g, m/sec² Velocity in/sec, mm/sec Displacement mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz	ie		
Velocity in/sec, mm/sec Displacement mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Displacement mils, mm Infrared thermometer (temperature measurement) Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Infrared thermometer (temperature measurement) Range			
Range -20 °C to 200 °C (-4 °F to 392 °F) Accuracy ± 2 °C (4 °F) Focal length Fixed, at ~ 3.8 cm ($1.5''$) External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to $1,000$ Hz			
Accuracy ±2 °C (4 °F) Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Focal length Fixed, at ~3.8 cm (1.5") External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
External sensor Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
Note: Fluke supports, but does not provide, external sensors. Frequency range 10 Hz to 1,000 Hz			
1 0			
Bias voltage (to supply power) 20 V dc to 22 V dc			
Bias Current (to supply power) Maximum 5 mA			
Firmware			
Calibration Factory calibration required			
External interfaces USB 2.0 (full speed) communication	n		
Data capacity Database on internal flash memory			
Upgrade through USB			
Memory Up to 3,500 measurements			
Radiated emission			
Electrostatic discharge: Burst Standard EN 61000-4-2			
Electromagnetic interference Standard EN 61000-4-3			
RE Standard CISPR 11, Class A			

Environmental		
Operating temperature	-20 °C to 50 °C (-4 °F to 122 °F)	
Storage temperature	-30 °C to 80 °C (-22 °F to 176 °F)	
Operating humidity	10 % to 95 % RH (non-condensing)	
Operating/ Storage altitude	Sea Level to 3,048 meters (10,000 feet)	
IP rating	IP54	
Vibration limit	500 g peak	
Drop test	1 meter	
General specifications		
Battery type	AA (2) Alkaline or Lithium-ion 2 V dc	
Battery life	250 measurements	
Size (L x W x H)	25.72 cm x 16.19 cm x 9.84 cm (10.13 in x 6.38 in x 3.875 in)	
Weight	1.16 kg (2.55 lb)	
Connectors	USB mini-B 7-pin, stereo audio output jack (3.5 mm Audio Plug), external sensor jack (SMB connector)	

Ordering information

Fluke-805 Vibration Meter

Includes: 805 Vibration Meter, USB cable, storage case, belt holster, quick reference guide, CD-ROM (includes MS Excel template and documentation), and two AA batteries

> Fluke. Keeping your world up and running.®

Fluke Corporation

PO Box 9090, Everett, WA 98206 U.S.A.

Fluke Europe B.V.

PO Box 1186, 5602 BD Eindhoven, The Netherlands

For more information call: In the U.S.A. (800) 443-5853 or Fax (425) 446-5116

In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222 In Canada (800)-36-FLUKE or

Fax (905) 890-6866

From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116

Web access: http://www.fluke.com

©2012 Fluke Corporation. Specifications subject to change without notice. Printed in U.S.A. 4/2012 4151049A_EN

Modification of this document is not permitted without written permission from Fluke Corporation.