

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



### Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China







LASER **SENSORS** 

PHOTOELECTRIC

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY **SENSORS** 

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE **INTERFACES** 

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Wafer Detection

Liquid Leak Detection Liquid Level Detection

Water Detection

Color Mark Detection Hot Melt Glue Detection

Ultrasonic

Small / Slim Object Detection Obstacle Detection

Other Products

FZ-10

### Digital Mark Sensor Amplifier Built-in

Related Information

- General terms and conditions...... F-7
- Glossary of terms......P.1455~
- Sensor selection guide ......P.885~
- General precautions ...... P.1458~














Spot size 1 × 5 mm

 $0.039 \times 0.197$  in approx.

### Introduction of the 3 LED mark sensor

### Can detect any mark!

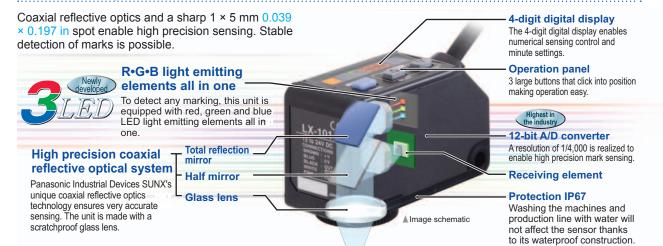


### **Automatic optimal LED selection function**


The 3 colors of the R•G•B LEDs are optimally selected according to the color combination. With the LX-100's Mark mode, the built-in "Automatic optimal LED selection function" automatically selects the LED for the largest contrast (S / N ratio) between the mark and base (non-mark area) to ensure optimal sensing. For more stable detection, the sensor makes selection according to the contrast and not according to the reflected light variation between the mark and base (non-mark area).

The example on the right deals with reflected light on packing film.

Great figures are indicated for the blue LED's light amount ratio and, for even more stable sensing, the blue LED effectuates this mark sensing.

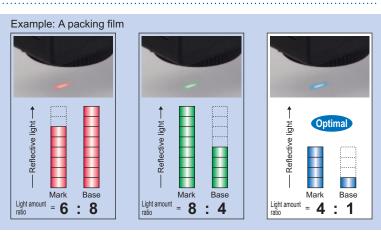


### Two detection modes can be selected from to suit the application

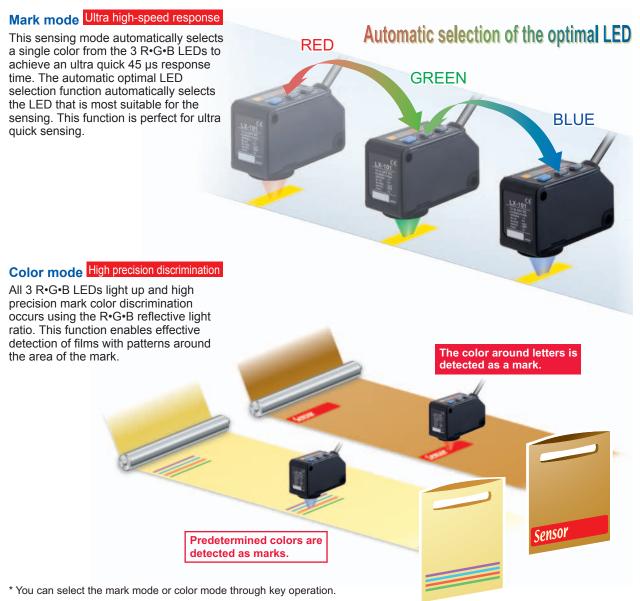

### High precision mark color discrimination

The color mode on the **LX-100** series utilizes all 3 R•G•B LEDs to determine the R•G•B ratio of the mark color. The built-in 12-bit A/D converter enables high precision 1/4,000-resolution judgments. The figure below is a graphic description of this process.

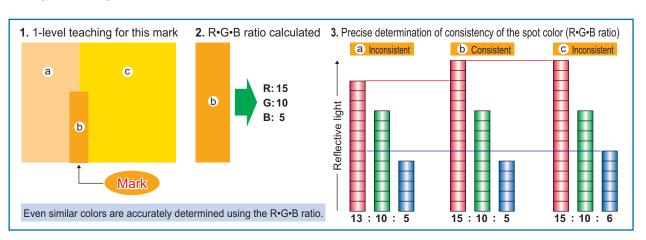

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR
USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

> LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

> Selection Guide Wafer Detection

Liquid Leak Detection Liquid Level Detection

Water Detection

Color Mark
Detection

Hot Melt Glue Detection

Ultrasonic

Small / Slim Object Detection Obstacle Detection

Other Products

LX-100

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY

SENSORS PARTICULAR

> SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

> LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

> Selection Guide

Wafer Detection
Liquid Leak
Detection

Liquid Level Detection

Water Detection

### Its digital display makes settings easy! Numerical control of the settings is possible

The 4-digit digital display enables easy verification of received light from marks and base (non-mark area). Also, the threshold value can be controlled numerically enabling setting indication easily. Displaying the direct code enables settings verification. This function is handy for remote maintenance.



### **Even beginners can quickly master MODE NAVI operation**


The sensor's basic operations are represented by 6 indicators (MODE NAVI). The user can check what mode the sensor is presently in with a quick glance making operation simple.



### Sensing status digitally controllable

The sensing status, displayed numerically, can be verified at a glance. Also, the sensor settings for each type of packing film can be digitally indicated.

### Example of sensor setting indication



### Direct codes enable settings verification at a glance

The settings for the **LX-100** series sensors are displayed using a 4-digit direct code. Direct codes enable easy setting verification and maintenance by phone.



Color Mark Detection Hot Melt Glue Detection Ultrasonic Small / Slim Object Detection Obstacle Detection

Other Products

LX-100

The sensor setting modes can be verified by a 4-digit code (D-Code). The table below shows a list of all available codes.



 When in RUN mode, press the MODE key for at least 2 sec. to display the direct code. (Remove your finger from the MODE key and the direct code will disappear.)

1st digit				2nd digit			3rd digit		4th digit			
Display Sen	nsing mode (light source color)		Sensing (Note 2)	Display		ECO mode (Note 4)	Turn mode (Note 5)	Display	Key lock	Timer mode		Timer period
<u> </u>		L-ON	FINE COARSE	JI LI		OFF	OFF ON		Full lock	non OFF-delay	II I	1 ms 2 ms
M	lark mode (green)	D-ON	FINE COARSE	ğ	Standard	ON	OFF ON	j.	(All operations disabled)	ON-delay non	Ž	5 ms
ů S	1	L-ON	FINE COARSE	Ÿ	Daniel diameter	OFF	OFF ON	Û	RUN teaching (Teaching only enabled)	OFF-delay ON-delay	Ŷ	20 ms 50 ms
i M	fark mode (blue)	D-ON	FINE COARSE		Percent display (Note 3)	ON	OFF ON		RUN adjust	non OFF-delay	5	100 ms 200 ms
	Mantenanda (nad)	L-ON	FINE COARSE	8	=			0	(adjustment only enabled)	ON-delay	8	500 ms
A IVI	Mark mode (red)	D-ON	FINE COARSE	Ä	=			A			A b	
<u> </u>		Consistent-ON	FINE COARSE	ď	_			Ē			Ę	
E E	Color mode	Inconsistent-ON	FINE	E	_						ğ	
- <del> </del>		ccc.cioint ort	COARSE	F	_			- }-			F	

Notes: 1) In Mark mode, L-ON / D-ON is automatically set in the sensor. For example, with 2-level teaching, press the ON key at the targeted mark and press the OFF key at the base (non-mark area). When doing so, the operator does not have to consider L-ON / D-ON.

- 2) Sensing accuracy can be set to either FINE (standard) or COARSE.
- 3) The percent display is only enabled in mark mode.
- 4) ECO mode is a function that reduces power consumption by turning off the digital display in the event that no button operations are made for a predetermined time (approx. 10 sec. or more) in RUN mode. Press any button to turn the digital display on again.
- 5) The turn mode is a function that reverses the digital display making it easily to be viewed in the event that the sensor installation renders the display up-side-down.

  \* Default setting: D-code = " 0004".

## Super simple teaching

### Press the ON button at the targeted mark.

Here is an example of the most basic setting method "2-level teaching".

Mode selection Press MODE key and select TEACH mode.





Teaching

Align the spot on the mark and press the ON key.
 Align the spot onto the base (non-mark area) and press the OFF key.

\* The 12 order can be reversed.





Display showing complete settings

Sensing

Teaching complete. The optimal LED is automatically selected and the sensor automatically returns to RUN mode.

### Other teaching methods

- Full-auto teaching: In Mark mode, teaching is effective without stopping the sensing object.
- 1-level teaching: In Color mode, the color detected is aligned by the spot and teaching is effective.

### Compact design for significant space savings

High precision sensing and multiple functions are all packed in a compact W57 × D24 × H38 mm W2.244 × D0.945 × H1.496 in body.

Cable and plug-in connector types are available depending on the equipment used. These sensors can be easily introduced to existing facilities.



### **External teaching possible**

Teaching is possible through external input using an operation panel or touch panel even on hard-to-reach color mark sensors located inside an equipment. Also, models can be interchanged easily.

#### Mark mode

2-level teaching and full-auto teaching possible

### Color mode

1-level teaching possible



### **Key lock function**

The key lock function enables input operation control that prevents mistaken changes in the sensor settings. Other detailed settings include "RUN adjust", allowing threshold value adjustment only, and "RUN teaching", allowing teaching operation only.

If the sensor is set to "RUN adjust" or "RUN teaching", adjustment and teaching are possible having the sensor remained in RUN mode.

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW

SENSORS
INDUCTIVE
PROXIMITY
SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Wafer Detection

Liquid Leak
Detection
Liquid Level
Detection

Water Detection

Color Mark Detection Hot Melt Glue Detection

Ultrasonic

Small / Slim Object Detection Obstacle Detection

Other Products

LX-100

LASER SENSORS

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS

PLC

MACHINE INTERFACES

MACHINE VISION SYSTEMS

PHOTO-ELECTRIC SENSORS

PRESSURE / FLOW SENSORS

SENSOR OPTIONS

LASER MARKERS

HUMAN

FA COMPONENTS

UV CURING SYSTEMS

Selection Guide

Wafer Detection Liquid Leak Detection Liquid Level Detection Water Detection

Hot Melt Glue Detection Ultrasonic

Small / Slim Object Detection Obstacle Detection

# ORDER GUIDE

**Sensors** Mating cable is not supplied with the plug-in connector type. Please order it separately.

Туре	Appearance	Model No.	Output	Sensing range		
Cable type		LX-101	NPN open-collector transistor	10 ±3 mm 0.394 ±0.118 in		
		LX-101-P	PNP open-collector transistor			
Plug-in connector type		LX-101-Z	NPN open-collector transistor	10 13 Hill 0.384 10.116 H		
		LX-101-P-Z	PNP open-collector transistor			


### Mating cables for plug-in connector type sensor Mating cable is not supplied with the plug-in connector type sensor. Please order it separately.

Туре	Model No.	Description		
Ctraight	CN-24B-C2	Length: 2 m 6.562 ft	0.34 mm <sup>2</sup> 4-core cabtyre cable, with connector on one end	
Straight	CN-24B-C5	Length: 5 m 16.404 ft		
Elbann	CN-24BL-C2	Length: 2 m 6.562 ft		
Elbow	CN-24BL-C5	Length: 5 m 16.404 ft		

#### Mating cables for plug-in connector type sensor

- CN-24B-C2
- CN-24BL-C2
- CN-24B-C5
- CN-24BL-C5






### **OPTIONS**

Type Model No.		Description		
Sensor	MS-LX-1	Mounting bracket made for LX-100 series applicable for		
mounting bracket	MS-LX-2	various kinds of installations		


### Sensor mounting bracket

• MS-LX-1



Two M4 (length 28 mm  $1.102 \, \text{in}$ ) screws with washers are attached.

• MS-LX-2



Two M4 (length 30 mm 1.181 in) screws with

### **SPECIFICATIONS**

		Туре	Cable type	Plug-in connector type			
	્રે ટ્રે	NPN output	LX-101	LX-101-Z			
Item	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	PNP output	LX-101-P	LX-101-P-Z			
	· <u>≥</u> sing range	Titi Gatpat	•				
Spot			10 ±3 mm 0.394 ±0.118 in 1 × 5 mm 0.039 × 0.197 in (at 10 mm 0.394 in setting distance)				
	oly voltage		,	Ripple P-P 10 % or less			
	ent consum	ption	Normal mode: 750 mW or less (Current consumption 30 mA or less at 24 V supply voltage) ECO mode: 600 mW or less (Current consumption 25 mA or less at 24 V supply voltage)				
Output 1 (OUT)			<npn output="" type=""> NPN open-collector transistor</npn>	<npn output="" type=""> NPN open-collector transistor • Maximum sink current: 100 mA • Applied voltage: 30 V DC or less (between output and 0 V) • Residual voltage: 1.5 V or less (at 100 mA sink current) <pnp output="" type=""> PNP open-collector transistor • Maximum source current: 100 mA • Applied voltage: 30 V DC or less (between output and +V) • Residual voltage: 1.5 V or less (at 100 mA source current)</pnp></npn>			
	Short-circ	uit protection	Incorp	orated			
	Output op	eration	Mark mode: Light-ON / Dark-ON (Auto-setting on teaching), Col	or mode: Consistent-ON / Inconsistent-ON (Setting on teaching)			
Output 2 (OUT)			<npn output="" type=""> NPN open-collector transistor  • Maximum sink current: 50 mA  • Applied voltage: 30 V DC or less (between output and 0 V)  • Residual voltage: 1.5 V or less (at 50 mA sink current)  <pnp output="" type=""> PNP open-collector transistor  • Maximum source current: 50 mA  • Applied voltage: 30 V DC or less (between output and +V)  • Residual voltage: 1.5 V or less (at 50 mA source current)</pnp></npn>				
Short-circuit protection		uit protection	Incorporated				
	Output op	eration	Inverted operation of the output 1				
Response time			Mark mode: 45 μs or less,	Color mode: 150 µs or less			
Teaching input			<npn output="" type=""> NPN non-contact input <ul> <li>Signal condition: High +5 V to +V, or open</li> <li>Low 0 to +2 V</li> <li>(source current: 0.5 mA or less)</li> <li>Input impedance: 10 kΩ approx.</li> </ul></npn>	<pnp output="" type=""> PNP non-contact input <ul> <li>Signal condition: High +4 V to +V</li> <li>(sink current: 3 mA or less)</li> <li>Low 0 to +0.6 V, or open</li> <li>Input impedance: 10 kΩ approx.</li> </ul></pnp>			
Digit	al display		4-digit red LED display				
Sens	sitivity settir	ng	Mark mode: 2-level teaching / Full-auto teaching, Color mode: 1-level teaching				
Fine	sensitivity ac	ljustment function	Incorporated				
Time	er function		Incorporated with variable ON-delay / OFF-delay timer, switchable either effective or ineffective (Timer period: 1 to 500 ms, 9 levels variable)				
φ	Protection		IP67 (IEC)				
stanc	Ambient to	emperature	-10 to +55 °C +14 to +131 °F (No dew condensation or icing allowed), Storage: -20 to +70 °C -4 to +158 °F				
Ambient humidity		umidity	35 to 85 % RH, Storage: 35 to 85 % RH				
Ambient illuminance		luminance	Incandescent light: 3,000 & at the light-receiving face				
Voltage withstandability		ithstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure				
Ambient temperature Ambient humidity Ambient illuminance Voltage withstandability Vibration resistance			10 to 500 Hz frequency, 3.0 mm 0.118 in amplitude (max. 20 G) in X, Y and Z directions for two hours each				
Shock resistance			500 m/s² acceleration (50 G approx.) in X, Y and Z directions for three times each				
Emitting element		nt	Combined Red / Green / Blue LEDs (Peak emission wavelength: 640 nm 0.025 mil / 525 nm 0.021 mil / 470 nm 0.019 mil)				
Material			Enclosure: PBT, Display cover: Polycarbonate, Operation buttons: Silicone rubber, Lens: Glass, Lens holder: Aluminum				
Cabl	е		0.34 mm <sup>2</sup> 5-core cabtyre cable, 2 m 6.562 ft long	(Note 2)			
Cable extension		1	Extension up to total 100 m 328.084 ft is	s possible with 0.3 mm², or more, cable.			
Weig	ght		Net weight: 120 g approx., Gross weight: 180 g approx. Net weight: 55 g approx., Gross weight: 120 g approx.				
Accessory			M4 (length 30 mm 1.181 in) screw with washers: 2 pcs.				

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) Mating cable is not supplied with the plug-in connector type. Please order it separately.

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC FLECTRICITY

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

\_\_\_\_

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide
Wafer Detection
Liquid Leak Detection
Liquid Level Detection
Water
Detection

Color Mark Detection Hot Melt Glue Detection

Ultrasonic
Small / Slim
Object Detection

Object Detection
Obstacle
Detection
Other

LASER SENSORS PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS

COMPONENTS PRESSURE / FLOW SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION

DEVICES LASER MARKERS

> PLC HUMAN


FA COMPONENTS MACHINE VISION SYSTEMS

CURING SYSTEMS

Liquid Leve


### I/O circuit diagram

LX-101(-Z)

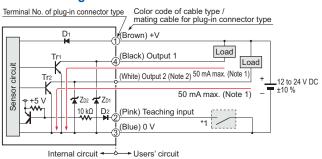

I/O CIRCUIT AND WIRING DIAGRAMS

Notes: 1) The current of the plug-in connector type **LX-101-Z** is 100 mA max. 2) The output 2 is not incorporated to the plug-in connector type LX-101-Z.



Symbols ... D<sub>1</sub>, D<sub>2</sub> : Reverse supply polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: NPN output transistor


### LX-101-P(-Z)

NPN output type

I/O circuit diagram Color code of cable type / mating cable for plug-in connector type Terminal No. of plug-in connector type (Brown) +V D<sub>2</sub> I (Pink) Teaching input , OV Sensor circuit **★**ZD1 **★**ZD2 50 mA max. (Note 1) \_12 to 24 V DC Tr<sub>1</sub> **+10 %** (Black) Output 1 50 mA max. (Note 1) Tr<sub>2</sub> (White) Output 2 (Note 2) Load (Blue) 0 V → Users' circuit


PNP output type

Notes: 1) The current of the plug-in connector type  ${\bf LX-101-P-Z}$  is 100 mA max. 2) The output 2 is not incorporated to the plug-in connector type LX-101-P-Z.




Symbols ... D<sub>1</sub>, D<sub>2</sub> : Reverse supply polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: PNP output transistor

### Connector pin layout of plug-in connector type



Connector pin No.	Description	
1	+V	
2	Teaching input	
3	0 V	
4	Output	

### SPOT SIZE CHARACTERISTICS (TYPICAL)

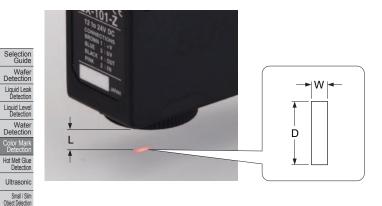

(Unit: mm in)

Setting distance L	Spot size (Note 2)		
(Note 1)	Width (W)	Length (D)	
7 0.276	2.0 0.079	5.5 0.217	
8 0.315	1.7 0.067	5.5 0.217	
9 0.354	1.2 0.047	5.3 0.209	
10 0.394	1.0 0.039	5.0 0.197	
11 0.433	1.3 0.051	5.0 0.197	
12 0.472	1.5 0.059	5.0 0.197	
13 0.512	2.0 0.079	5.0 0.197	

Notes: 1) Setting distance "L" represents the distance from the lens surface to the sensing object.

2) Examples only meant for use as a guideline.

Obstacle Detection

### PRECAUTIONS FOR PROPER USE

Refer to p.1458~ for general precautions.

<u>^</u>

 Never use this product as a sensing device for personnel protection.

 In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

### Mounting

 Care must be taken regarding the sensor mounting direction with respect to the object's direction of movement.





Do not make the sensor detect an object in this direction because it may cause unstable operation.

Mark and base

• The tightening torque should be 0.8 N·m or less.

### Sensing glossy object

- Objects with a glossy surface have a large amount of specular reflection particles that may destabilize sensing.
   In such a case, by slightly tilting the sensor's beam axis, this specular reflection can be reduced rendering sensing more stable.
- If the surface of the sensing object has a shine, mount the sensor inclining approx. 10 to 15 degrees against the sensing object.

# 10 to 15°

#### Wiring

- Make sure to carry out wiring in the power supply off condition.
- Take care that wrong wiring will damage the sensor.
- Verify that the supply voltage variation is within the rating.
- Take care that if a voltage exceeding the rated range is applied, or if an AC power supply is directly connected, the sensor may get burnt or damaged.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this product, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Take care that short-circuit of the load or wrong wiring may burn or damage the sensor.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- Extension up to total 100 m is possible with 0.3 mm<sup>2</sup>, or more, cable. However, in order to reduce noise, make the wiring as short as possible.

#### **Others**

- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Take care that the sensor is not directly exposed to fluorescent light from a rapid-starter lamp or a high frequency light device or sunlight etc., as it may affect the sensing performance.
- Do not touch the lens of the sensor by hand directly. If the lens becomes dirty, wipe it off with a soft cloth gently.
- When the inside lens is steamed up, unscrew the lens to get rid of the condensation.
- These sensors are only for indoor use.
- Do not use this sensor in places having excessive vapor, dust, etc., or where it may come in direct contact with water, or corrosive gas.
- Take care that the product does not come in contact with water, oil, grease, or organic solvents, such as, thinner, etc.
- Make sure that stress by forcible bend or pulling with 76 N, or more, force is not applied to the sensor cable joint.
- This sensor cannot be used in an environment containing inflammable or explosive gases.
- Never disassemble or modify the sensor.

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

MACHINE INTERFACES ENERGY

FA

MACHINE VISION SYSTEMS

JV CURING SYSTEMS

Selection Guide Wafer Detection Liquid Leak Detection

Liquid Level Detection Water Detection

Color Mark Detection Hot Melt Glue Detection

Ultrasonic

Obstacle Detection Other

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE /

INDUCTIVE PROXIMITY SENSORS

FLOW SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS MACHINE

VISION SYSTEMS

CURING SYSTEMS


Selection Guide

Wafer Detection Liquid Leak Detection Liquid Level Water Color Mark Detection Hot Melt Glue Ultrasonio Small / Slim Object Detection Obstacle Detection

### FZ-10

### LIST OF PROMODE SETTING ITEMS

· Before performing teaching or each detail setting, perform the setting of either mark mode or color mode with mark / color mode setting of NAVI mode.

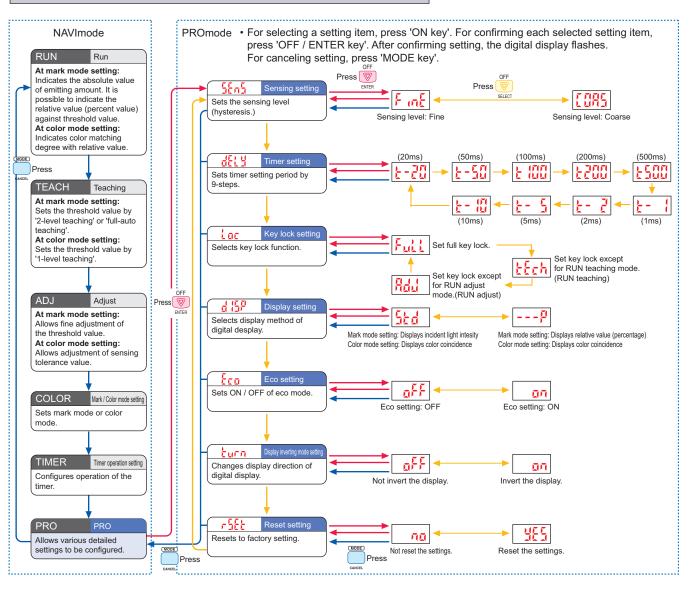


### DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.


1.5 0.059 0.197 0.197 0.118


MS-LX-1 Sensor mounting bracket (Optional)

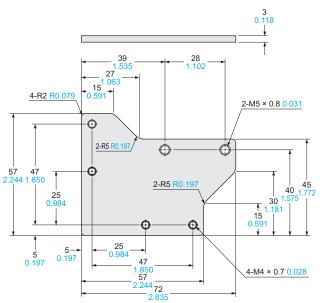

Material: Stainless steel (SUS)

Two M4 (length 28 mm 1.102 in) screws with washers are attached.

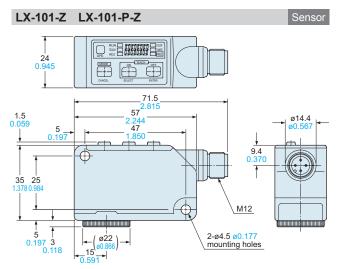

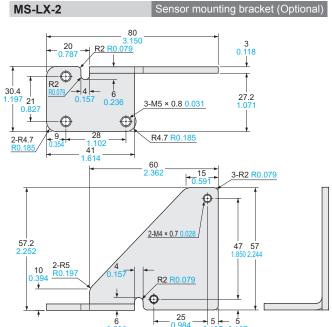

Material: Stainless steel (SUS)

Two M4 (length 30 mm 1.181 in) screws with washers are attached.

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Wafer Detection Liquid Leak Detection Liquid Level Detection

Water Detection Color Mark Detection

Hot Melt Glue Detection

Object Detection
Obstacle
Detection