# imall

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



## Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832 Email & Skype: info@chipsmall.com Web: www.chipsmall.com Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China



# Si7015-A10

## DIGITAL I<sup>2</sup>C HUMIDITY AND TEMPERATURE SENSOR

#### Features

- Precision Relative Humidity Sensor
  - ± 4.5% RH (max), 0–80% RH
- High-Accuracy Temperature Sensor
   ±1 °C (max), -10 to 85 °C
- 0 to 100% RH operating range

SILICON LABS

- 0 to +70 °C operating range (FM)
- -40 to +85 °C operating range (GM)
- Low Voltage Operation (1.9 to 3.6 V)
- Low Power Consumption
  - 150 µA active current
  - 60 nA standby current
- Applications
- HVAC/R
- Thermostats/humidistats
- Instrumentation
- White goods

- Drop-In Upgrade for Si7005
- Factory-calibrated
- I<sup>2</sup>C Interface
- Integrated on-chip heater
- 4x4 mm QFN package
- Excellent long term stability
- Optional factory-installed cover
  - Low-profile
  - Protection during reflow
  - Excludes liquids and particulates
- Micro-environments/data centers
- Industrial controls
- Weather stations
- Asset tracking and storage

#### Description

The Si7015 I<sup>2</sup>C Humidity and Temperature Sensor is a monolithic CMOS IC integrating humidity and temperature sensor elements, an analog-todigital converter, signal processing, calibration data, and an I<sup>2</sup>C Interface. The patented use of industry-standard, low-K polymeric dielectrics for sensing humidity enables the construction of low-power, monolithic CMOS Sensor ICs with low drift and hysteresis and excellent long term stability.


Each unit is factory-calibrated, and the calibration data is stored in the onchip non-volatile memory. This ensures that the sensors are fully interchangeable, with no recalibration or software changes required. The Si7015 can be used as a drop-in upgrade for the Si7005 with only minor software changes because the register sets are the same, and the 4x4 mm QFN package is footprint-compatible with that of the Si7005.

The device is compatible with standard SMT assembly processes, such as reflow. The optional factory-installed cover offers a low profile and convenient means of protecting the sensor during assembly (e.g., reflow soldering) and throughout the life of the product, excluding liquids (hydrophobic/oleophobic) and particulates.


The Si7015 offers an accurate, low-power, factory-calibrated digital solution ideal for measuring humidity, dew-point, and temperature in applications ranging from HVAC/R and asset tracking to industrial and consumer platforms.



Patent protected; patents pending

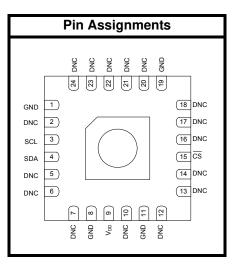

#### **Functional Block Diagram**

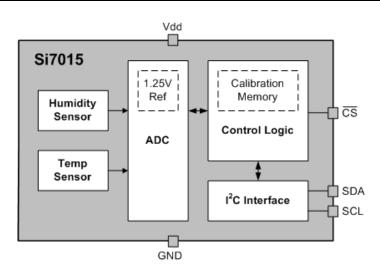



## TABLE OF CONTENTS

## Section

## <u>Page</u>

1. Electrical Specifications	
2. Typical Application Circuit	
3. Bill of Materials	
4. Functional Description	
4.1. Overview	
4.2. Relative Humidity Sensor Accuracy	
4.3. Temperature Compensation	
4.4. Hysteresis	
4.5. Prolonged Exposure to High Humidity	
4.6. PCB Assembly	15
4.7. Protecting the Sensor	
4.8. Bake/Hydrate Procedure	
4.9. Long Term Drift/Aging	
5. Host Interface	
5.1. I2C Interface	18
5.2. I2C Operation	23
6. Control Registers	26
6.1. Register Detail	26
7. Pin Descriptions: Si7015	.30
8. Ordering Guide	31
9. Package Outline	
9.1. 24-Pin QFN	
9.2. 24-Pin QFN with Protective Cover	
10. PCB Land Pattern and Solder Mask Design	
11. Top Marking	
11.1. Si7015 Top Marking	
11.2. Top Marking Explanation	
12. Additional Reference Resources	
Document Change List	
Contact Information	
	33



## 1. Electrical Specifications

Unless otherwise specified, all min/max specifications apply over the recommended operating conditions.

#### Table 1. Recommended Operating Conditions

Parameter	Symbol	Test Condition	Min	Тур	Max	Unit
Power Supply	Vdd		1.9	—	3.6	V
Operating Temperature	TA	F grade	0	—	+70	°C
Operating Temperature	TA	G grade	-40	—	+85	°C

#### **Table 2. General Specifications**

 $1.9 \le V_{DD} \le 3.6 \text{ V}$ ; TA = -40 to 85 °C (G grade) or 0 to 70 °C (F grade); default conversion time unless otherwise noted.

Parameter	Symbol	Test Condition <sup>1</sup>	Min	Тур	Max	Unit
Input Voltage High	V <sub>IH</sub>	AD0, SCL, SDA pins	0.7xVdd			V
Input Voltage Low	VIL	AD0, SCL, SDA pins			0.3xVdd	V
Input Voltage Range	VIN	SCL, SDA, RSTb pins with respect to GND	0.0	—	Vdd	V
Input Leakage	lı∟	SCL, SDA pins; V <sub>IN</sub> = GND		—	1	μA
		CS pin (200K nominal pull up); Vin = GND		5xVdd		μA
Output Voltage Low	Vol	SDA pin; IOL = 2.5 mA; VDD = 3.3 V	—	—	0.6	V
		SDA pin; IoL = 1.2 mA; VDD = 1.9 V	—	—	0.4	V
Current	I <sub>DD</sub>	RH conversion in progress	—	150	180	μA
Consumption		Temperature conversion in progress	—	90	120	μA
		$\overline{\text{CS}}$ < V <sub>IL</sub> ; no conversion in progress; V <sub>DD</sub> = 3.3 V; SDA = SCL $\ge$ V <sub>IH</sub> ; HEAT = 1	_	24	_	mA
		Standby <sup>2</sup> , –40 to +85°C	—	0.06	0.62	μA
		Peak IDD during powerup <sup>3</sup>	—	3.5	4.0	mA
		Peak IDD during I <sup>2</sup> C operations <sup>4</sup>		3.5	4.0	mA
Conversion Time	t <sub>CONV</sub>	RH Normal (Fast = 0)	—	5.8	7.0	ms
		RH Fast (Fast = 1)	—	2.6	3.1	ms
		Temperature Normal (Fast = 0)	—	4.0	6.2	ms
		Temperature Fast (Fast = 1)	—	1.5	2.4	ms

#### Notes:

 Initiating a RH measurement will also automatically initiate a temperature measurement. The total conversion time will be t<sub>CONV</sub>(RH) + t<sub>CONV</sub>(T).

2. No conversion or I<sup>2</sup>C transaction in progress. Typical values measured at 25 °C.

- **3.** Occurs once during powerup. Duration is <5 msec.
- Occurs during I<sup>2</sup>C commands for Read Device ID and Read Firmware Version. Duration is < 100 μs when I<sup>2</sup>C clock speed is >100 kHz.



#### Table 2. General Specifications (Continued)

1.9 ≤ VDD ≤ 3.6 V; TA = -40 to 85 °C (G grade) or 0 to 70 °C (F grade); default conversion time unless otherwise noted.

Parameter	Symbol	Test Condition <sup>1</sup>	Min	Тур	Max	Unit
Wake Up Time	t <sub>cs</sub>	From $\overline{CS}$ < VIL to ready for a temp/RH conversion	_	—	1	ms
Power Up Time	t <sub>PU</sub>	From V <sub>DD</sub> ≥ 1.9 V to ready for a temp/ RH conversion, 25°C		18	25	ms
		From $V_{DD} \ge 1.9$ V to ready for a temp/ RH conversion, full temperature range	—	—	80	ms

Notes:

- 1. Initiating a RH measurement will also automatically initiate a temperature measurement. The total conversion time will be  $t_{CONV}(RH) + t_{CONV}(T)$ .
- 2. No conversion or I<sup>2</sup>C transaction in progress. Typical values measured at 25 °C.
- **3.** Occurs once during powerup. Duration is <5 msec.
- 4. Occurs during I<sup>2</sup>C commands for Read Device ID and Read Firmware Version. Duration is < 100 µs when I<sup>2</sup>C clock speed is >100 kHz.

#### Table 3. I<sup>2</sup>C Interface Specifications<sup>1</sup>


 $1.9 \le V_{DD} \le 3.6$  V;  $T_A = 0$  to 70 °C (F grade) or -40 to +85 °C (G grade) unless otherwise noted.

Parameter	Symbol	Test Condition	Min	Тур	Max	Unit
Hysteresis	V <sub>HYS</sub>	High-to-low versus low-to- high transition	0.05 x V <sub>DD</sub>	_	—	V
SCLK Frequency	f <sub>SCL</sub>		_		400	kHz
SCL High Time	t <sub>SKH</sub>		0.6	_	—	μs
SCL Low Time	t <sub>SKL</sub>		1.3	_	—	μs
Start Hold Time	t <sub>STH</sub>		0.6	_	—	μs
Start Setup Time	t <sub>STS</sub>		0.6	—	—	μs
Stop Setup Time	t <sub>SPS</sub>		0.6	_	—	μs
Bus Free Time	t <sub>BUF</sub>	Between Stop and Start	1.3		—	μs
SDA Setup Time	t <sub>DS</sub>		100	_	—	ns
SDA Hold Time	t <sub>DH</sub>		100		_	ns
SDA Valid Time	t <sub>VD;DAT</sub>	From SCL low to data valid	_		0.9	μs
SDA Acknowledge Valid Time	t <sub>VD;ACK</sub>	From SCL low to data valid	_	_	0.9	μs
Suppressed Pulse Width <sup>2</sup>	t <sub>SP</sub>		50	_	—	ns
Notes:		•			•	

otes:

1. All values are referenced to  $V_{IL}$  and/or  $V_{IH}$ . 2. Pulses up to and including 50ns will be suppressed.



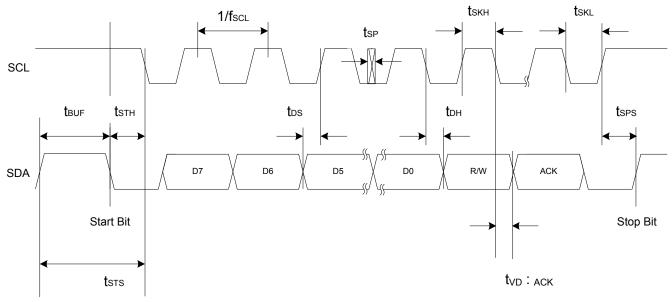





#### Table 4. Humidity Sensor

Parameter	Symbol	Test Condition	Min	Тур	Мах	Unit
Operating Range <sup>1</sup>		Non-condensing	0		100	%RH
Accuracy <sup>2, 3</sup>		0 – 80% RH	_	±3.0	±4.5	%RH
		80 – 100% RH	S	ee Figure	2	%RH
Repeatability/Noise		Normal Mode	_	0.05		%RH RMS
		Fast Mode	_	0.2		%RH RMS
Response Time <sup>4</sup>	т <sub>63%</sub>	1 m/s airflow	_	18		S
Drift vs. Temperature			_	0.05		%RH/°C
Hysteresis			_	±1	—	%RH
Long Term Stability <sup>3</sup>			_	<u>&lt;</u> 0.25		%RH/yr


Notes:

1. Recommended humidity operating range is 20% to 80% RH (non-condensing) over –10 °C to 60 °C. Prolonged operation beyond these ranges may result in a shift of sensor reading with slow recovery time.

2. Excludes hysteresis, long term drift, and certain other factors and is applicable to non-condensing environments only. See "4.2. Relative Humidity Sensor Accuracy" for more details.

Drift due to aging effects at typical room conditions of 30°C and 30% to 50%. May be impacted by dust, vaporized solvents or other contaminants, e.g., out-gassing tapes, adhesives, packaging materials, etc. See "4.9. Long Term Drift/Aging".

4. Response time to a step change in RH. Time for the RH output to change by 63% of the total RH change.

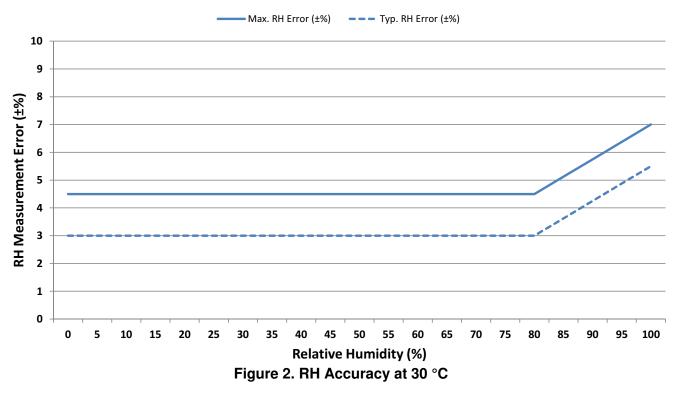

#### **RH Accuracy**



#### Table 5. Temperature Sensor

 $1.9 \le V_{DD} \le 3.6 \text{ V}$ ; TA = -40 to +85 °C (G grade) or 0 to +70 °C (F grade), default conversion time unless otherwise noted.


Parameter	Symbol	Test Condition	Min	Тур	Max	Unit
Operating Range		F Grade	0	_	+70	°C
		G Grade	-40	_	+85	°C
Accuracy <sup>1</sup>		0 °C ≤ t <sub>A</sub> ≤ 70 °C	_	±0.5	±1.0	°C
		–40 °C <u>≤</u> t <sub>A</sub> <u>≤</u> 85 °C		Figure 3		°C
Repeatability/Noise		Normal Mode	_	0.02		°C RMS
		Fast Mode	_	0.08		°C RMS
Response Time <sup>2</sup>	т <sub>63%</sub>	Unmounted device	_	0.7		S
		Si7015-EB board	_	5.1		S
Long Term Stability			_	<u>&lt;</u> 0.01		°C/Yr
			- I.	1		1

Notes:

1. 14b measurement resolution (default).

2. Time to reach 63% of final value in response to a step change in temperature. Actual response time will vary dependent on system thermal mass and air-flow.

### **Temperature Accuracy**

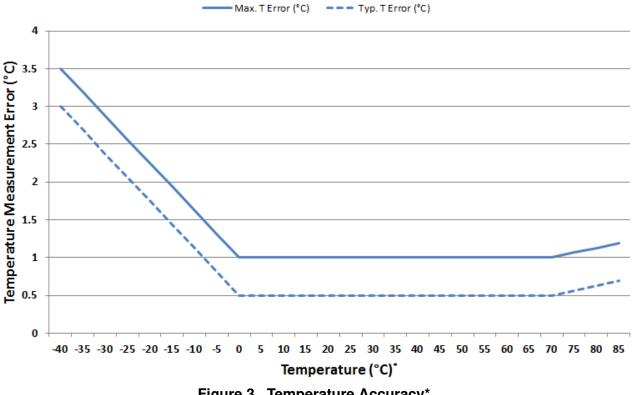

#### Figure 3. Temperature Accuracy\*

Note: Figure 3 only applies to G-grade devices beyond 70° C.



#### **Table 6. Thermal Characteristics**

Parameter	Symbol	Test Condition	QFN-24	Unit
Junction-to-Air Thermal Resistance	$\theta_{JA}$	JEDEC 4-layer board	55	°C/W
Junction-to-Air Thermal Resistance	$\theta_{JA}$	2-layer evaluation PCB with minimal thermal pad	110	°C/W

#### Table 7. Absolute Maximum Ratings<sup>1,2</sup>


Parameter	Symbol	Test Condition	Min	Тур	Мах	Unit
Ambient Temperature under Bias			-55		125	°C
Storage Temperature			-65		150	°C
Voltage on SDA or SCL pin with respect to GND			-0.3		VDD + 0.3	V
Voltage on $\overline{\text{CS}}$ pin with respect to GND			-0.3		VDD + 0.3	V
Voltage on $V_{DD}$ with respect to GND			-0.3	—	4.2	V
ESD Tolerance		HBM	—	_	2	kV
		CDM	—	—	1.25	kV
		MM	—	—	250	V
Notes:					·	

1. Absolute maximum ratings are stress ratings only; operation at or beyond these conditions is not implied and may shorten the life of the device or alter its performance.

2. Special handling considerations apply; see "AN607: Si70xx Humidity Sensor Designer's Guide" for details.



## 2. Typical Application Circuit

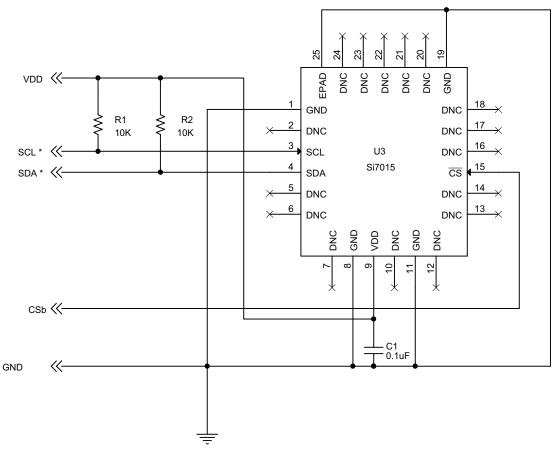

#### Figure 4. Typical Application Circuit\*

\*Note: If Si7015 is replacing an Si7005, the capacitor connected to Pin 10 may be left connected or removed.



## 3. Bill of Materials

Reference	Description	Mfr Part Number	Manufacturer		
C1	Capacitor, 0.1 µF, 6.3 V, X7R, 0603	C0603X7R6R3-104M	Venkel		
R1 <sup>*</sup>	Resistor, 10 kΩ, ±5%, 1/16 W, 0603	CR0603-16W-1002J	Venkel		
R2 <sup>*</sup>	Resistor, 10 kΩ, ±5%, 1/16 W, 0603	CR0603-16W-1002J	Venkel		
U1 IC, digital temperature/humidity sensor Si7015-A10 Silicon Labs					
*Note: Typical value shown. Optimal value depends on bus capacitance and speed of bus operation; not needed if present elsewhere in the system.					

Table 8. Typical Application Circuit BOM\*



## 4. Functional Description

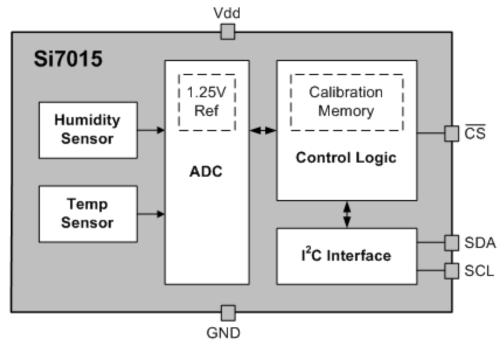


Figure 5. Si7015 Functional Block Diagram

#### 4.1. Overview

The Si7015 is a digital relative humidity and temperature sensor. This monolithic CMOS IC integrates temperature and humidity sensor elements, an analog-to-digital converter, signal processing, calibration data, and an I<sup>2</sup>C host interface. Both the temperature and humidity sensors on each unit are factory-calibrated and the calibration data is stored in the on-chip non-volatile memory. This ensures that the sensors are fully interchangeable, with no recalibration or software changes required.

While the Si7015 is largely a conventional mixed-signal CMOS integrated circuit, relative humidity sensors in general and those based on capacitive sensing using polymeric dielectric have unique application and use requirements that are not common to conventional (non-sensor) ICs. Chief among those are:


- The need to protect the sensor during board assembly, i.e., solder reflow, and the need to subsequently rehydrate the sensor.
- The need to apply temperature correction to the humidity readings.
- The need to protect the sensor from damage or contamination during the product life-cycle.
- The impact of prolonged exposure to extremes of temperature and/or humidity and their potential effect on sensor accuracy.
- The effects of humidity sensor "memory".

Each of these items is discussed in more detail in the following sections.



#### 4.2. Relative Humidity Sensor Accuracy

To determine the accuracy of a relative humidity sensor, it is placed in a temperature and humidity controlled chamber. The temperature is set to a convenient fixed value (typically  $30 \,^{\circ}$ C) and the relative humidity is swept from 20 to 80% and back to 20% in the following steps: 20% - 40% - 60% - 80% - 80% - 60% - 40% - 20%. At each set-point, the chamber is allowed to settle for a period of 60 minutes before a reading is taken from the sensor. Prior to the sweep, the device is allowed to stabilize to 50%RH. The solid top and bottom trace in Figure 6, "Measuring Sensor Accuracy Including Hysteresis," shows the result of a typical sweep after non-linearity compensation.

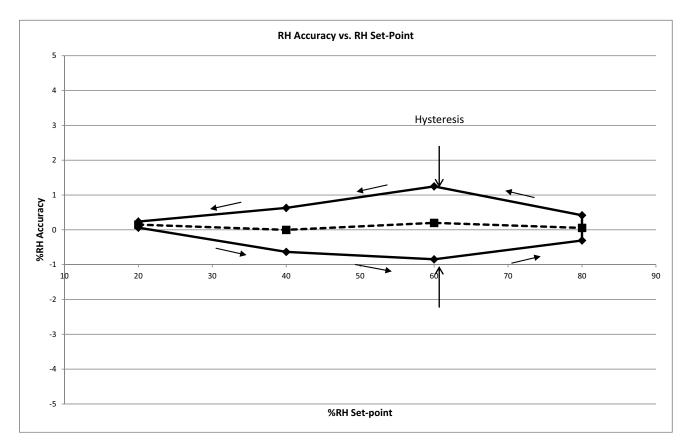

#### Figure 6. Measuring Sensor Accuracy Including Hysteresis

The RH accuracy is defined as the center (dashed) line shown in Figure 6, which is the average of the two data points at each relative humidity set-point. In this case, the sensor shows an accuracy of 0.25%RH. The Si7015 accuracy specification (Table 4) includes the following:

- Unit-to-unit and lot-to-lot variation in non-linearity compensation
- Accuracy of factory calibration
- Margin for shifts that can occur during solder reflow.

The accuracy specification does not include the following:

- Hysteresis (typically ±1%)
- Effects from long term exposure to very humid conditions
- Contamination of the sensor by particulates, chemicals, etc.
- Other aging related shifts ("Long-term stability")
- Variations due to temperature



#### 4.3. Temperature Compensation

The Si7015 relative humidity sensor is calibrated at a temperature of 30 °C; it is at this temperature that the sensor will give the most accurate relative humidity readings. For relative humidity measurements at other temperatures, the RH reading from the Si7015 must be compensated for the change in temperature relative to 30 °C. Temperature-compensated relative humidity readings can be calculated as follows:

 $RH_{TempCompensated} = RH_{Linear} + (Temperature - 30) \times (RH_{Linear} \times Q_1 + Q_0)$ 

Where:

- RH<sub>TempCompensated</sub> is the temperature compensated relative humidity value in %RH.
- RH<sub>Linear</sub> is the linear corrected relative humidity value in %RH.
- Temperature is the ambient temperature in °C as measured by the Si7015 on chip temperature sensor.
- Q<sub>1</sub> and Q<sub>0</sub> are unit-less correction coefficients derived through characterization of Si7015s by Silicon Laboratories.

This temperature compensation is most accurate in the range of 15–50 °C. The values for the correction coefficients are shown in Table 9.

Coefficient	Value
Q <sub>0</sub>	0.060162
Q <sub>1</sub>	0.000508

**Table 9. Linearization Coefficients** 

#### 4.4. Hysteresis

The moisture absorbent film (polymeric dielectric) of the humidity sensor will carry a memory of its exposure history, particularly its recent or extreme exposure history. A sensor exposed to relatively low humidity will carry a negative offset relative to the factory calibration, and a sensor exposed to relatively high humidity will carry a positive offset relative to the factory calibration. This factor causes a hysteresis effect illustrated by the solid top and bottom traces in Figure 6. The hysteresis value is the difference in %RH between the maximum absolute error on the decreasing humidity ramp and the maximum absolute error on the increasing humidity ramp at a single relative humidity Setpoint and is expressed as a bipolar quantity relative to the average, the center dashed trace in Figure 6. In the case of Figure 6, the measurement uncertainty due to the hysteresis effect is ±1.05%RH.

#### 4.5. Prolonged Exposure to High Humidity

Prolonged exposure to high humidity will result in a gradual upward drift of the RH reading. The shift in sensor reading resulting from this drift will generally disappear slowly under normal ambient conditions. The amount of shift is proportional to the magnitude of relative humidity and the length of exposure. In the case of lengthy exposure to high humidity, some of the resulting shift may persist indefinitely under typical conditions. It is generally possible to substantially reverse this affect by baking the device (see Section "4.8. Bake/Hydrate Procedure").



#### 4.6. PCB Assembly

#### 4.6.1. Soldering

Like most ICs, Si7015 devices are shipped from the factory vacuum-packed with an enclosed desiccant to avoid any drift during storage and to prevent any moisture-related issues during solder reflow. The following guidelines should be observed during PCB assembly:

- Si7015 devices are compatible with standard board assembly processes. Devices should be soldered using reflow per the recommended card reflow profile. See Section "10. PCB Land Pattern and Solder Mask Design" for the recommended card reflow profile.
- A "no clean" solder process is recommended to minimize the need for water or solvent rinses after soldering. Cleaning after soldering is possible, but must be done carefully to avoid impacting the performance of the sensor. See AN607 for more information on cleaning.
- It is essential that the exposed polymer sensing film be kept clean and undamaged. This can be accomplished by careful handling and a clean, well-controlled assembly process. When in doubt or for extra protection, a heat-resistant, protective cover such as Kapton<sup>®</sup> KPPD-1/8 can be installed during PCB assembly.

Si7015s may be ordered with a factory-fitted, solder-resistant protective cover. This cover provides protection during PCB assembly or rework but without the time and effort required to install and remove the Kapton<sup>®</sup> tape. It can be left in place for the lifetime of the product, preventing liquids, dust, or other contaminants from coming into contact with the polymer sensor film. See Section "8. Ordering Guide" for a list of ordering part numbers that include the cover.

#### 4.6.2. Rehydration

The measured humidity value will generally shift slightly after solder reflow. A portion of this shift is permanent and is accounted for in the accuracy specifications in Table 4. After soldering, an Si7015 should be allowed to equilibrate under controlled RH conditions (room temperature, 45-55%RH) for at least 48 hours to eliminate the remainder of the shift and return the device to its specified accuracy performance.



#### 4.6.3. Rework

To maintain the specified sensor performance, care must be taken during rework to minimize the exposure of the device to excessive heat and to avoid damage/contamination or a shift in the sensor reading due to liquids, solder flux, etc. Manual touch-up using a soldering iron is permissible under the following guidelines:

- The exposed polymer sensing film must be kept clean and undamaged. A protective cover is recommended during any rework operation (Kapton<sup>®</sup> tape or the factory-installed cover).
- Flux must not be allowed to contaminate the sensor; liquid flux is not recommended even with a cover in place. Conventional lead-free solder with rosin core is acceptable for touch-up as long as a cover is in place during the rework.
- If possible, avoid water or solvent rinses after touch-up. Cleaning after soldering is possible, but must be done carefully to avoid impacting the performance of the sensor. See AN607 for more information on cleaning.
- Minimize the heating of the device. Soldering iron temperature should not exceed 350 °C and the contact time per pin should not exceed 5 seconds.
- Hot air rework is not recommended. If a device must be replaced, remove the device by hot air and solder a new part in its place by reflow following the guidelines above.

\*Note: All trademarks are the property of their respective owners.



Figure 7. Si7015 with Factory-Installed Protective Cover



#### 4.7. Protecting the Sensor

Because the sensor operates on the principal of measuring a change in capacitance, any changes to the dielectric constant of the polymer film will be detected as a change in relative humidity. Therefore, it is important to minimize the probability of contaminants coming into contact with the sensor. Dust and other particles as well as liquids can affect the RH reading. It is recommended that a filter cover is employed in the end system that blocks contaminants but allows water vapor to pass through. Depending on the needs of the application, this can be as simple as plastic or metallic gauze for basic protection against particulates or something more sophisticated such as a hydrophobic membrane providing up to IP67 compliant protection.

Si7015s may be ordered with a factory fitted, solder-resistant cover, which can be left in place for the lifetime of the product. It is very low-profile, hydrophobic and oleophobic, and excludes particulates down to 0.35 microns in size. See Section "8. Ordering Guide" for a list of ordering part numbers that include the cover. A dimensioned drawing of the IC with the cover is included in Section "9. Package Outline". Other characteristics of the cover are listed in Table 10. The sensor should be protected from direct sunlight to prevent heating effects as well as possible material degradation.

Parameter	Value
Material	ePTFE
Water Entry Pressure	2.7 bar
Pore Size	0.35µ
Operating Temperature	–40 to +125 °C
Maximum Reflow Temperature	260 °C
Oleophobicity (AATCC 118 – 1992)	7
IP Rating (per IEC 529)	IP67

#### Table 10. Specifications of Protective Cover

#### 4.8. Bake/Hydrate Procedure

After exposure to extremes of temperature and/or humidity for prolonged periods, the polymer sensor film can become either very dry or very wet; in each case the result is either high or low relative humidity readings. Under normal operating conditions, the induced error will diminish over time. From a very dry condition, such as after shipment and soldering, the error will diminish over a few days at typical controlled ambient conditions, e.g., 48 hours of  $45 \le \%$ RH  $\le 55$ . However, from a very wet condition, recovery may take significantly longer. To accelerate recovery from a wet condition, a bake and hydrate cycle can be implemented. This operation consists of the following steps:

- Baking the sensor at 125 °C for ≥ 12 hours
- Hydration at 30 °C in 75 %RH for ≥ 10 hours

Following this cycle, the sensor will return to normal operation in typical ambient conditions after a few days.

#### 4.9. Long Term Drift/Aging

Over long periods of time, the sensor readings may drift due to aging of the device. Standard accelerated life testing of the Si7015 has resulted in the specifications for long-term drift shown in Table 4 and Table 5. This contribution to the overall sensor accuracy accounts only for the long-term aging of the device in an otherwise benign operating environment and does not include the affects of damage, contamination, or exposure to extreme environmental conditions.



## 5. Host Interface

## 5.1. I<sup>2</sup>C Interface

The Si7015 has an I<sup>2</sup>C serial interface with a 7-bit address of 0x40. The Si7015 is a slave device supporting data transfer rates up to 400 kHz. Table 20 shows the register summary of the Si7015.

#### 5.1.1. Performing a Relative Humidity Measurement

The following steps should be performed in sequence to take a relative humidity measurement:

- 1. Set START (D0) in CONFIG to begin a new conversion.
- Poll RDY (D0) in STATUS (register 0) until it is low (= 0). (This must be done at least once prior to reading results even if the host waits longer than t<sub>CONV</sub>.)
- 3. Read the upper and lower bytes of the RH value from DATAh and DATAI (registers 0x01 and 0x02), respectively. Table 11 shows the format of the 12-bit relative humidity result.
- 4. Convert the RH value to %RH using the following equation:

$$\% RH = \left(\frac{RH}{16}\right) - 24$$

where RH is the measured value returned in DATAh:DATAI.

5. Apply temperature compensation as discussed elsewhere in this data sheet.

Due to normal variations in RH accuracy of the device as described in Table 4, it is possible for the measured value of %RH to be slightly less than 0 when the actual RH level is close to or equal to 0. Similarly, the measured value of %RH may be slightly greater than 100 when the actual RH level is close to or equal to 100. This is expected behavior, and it is acceptable to limit the range of RH results to 0 to 100%RH in the host software by truncating values that are slightly outside of this range.

Table 12 shows the 12-bit values that correspond to various measured RH levels.

#### Table 11. 12-Bit Relative Humidity Result Available in Registers 1 and 2

DATAh									DA	ΤΑΙ					
D7	D6	D5	D4	D3	D2	D1	D0	D7	D6	D5	D4	D3	D2	D1	D0
	12-Bit Relative Humidity Code														



%RH	12 Bit	Code
	Dec	Hex
0	384	180
10	544	220
20	704	2C0
30	864	360
40	1024	400
50	1184	4A0
60	1344	540
70	1504	5E0
80	1664	680
90	1824	720
100	1984	7C0

#### Table 12. Typical %RH Measurement Codes for 0 to 100% RH Range

The above sequence assumes normal mode, i.e.,  $t_{CONV}$  = 5.8 ms (typical). Conversions may be performed in fast mode. See Section "5.1.4. Fast Conversion Mode".



#### 5.1.2. Performing a Temperature Measurement

The following steps should be performed in sequence to take a temperature measurement:

- 1. Set START (D0) and TEMP (D4) in CONFIG (register 0x03) to begin a new conversion, i.e., write CONFIG with 0x11
- 2. Poll RDY (D0) in STATUS (register 0) until it is low (=0). This must be done at least once prior to reading results even if the host waits longer than t<sub>CONV</sub>.
- 3. Read the upper and lower bytes of the temperature value from DATAh and DATAI (registers 0x01 and 0x02), respectively

Table 13 shows the format of the 14-bit temperature result. This value may be converted to °C using the following equation:

$$\mathsf{Temperature}(^{\circ}\mathsf{C}) = \left(\frac{\mathsf{TEMP}}{32}\right) - 50$$

where TEMP is the measured value returned in DATAh:DATAI.

Table 14 shows the 14-bit values that correspond to various measured temperature levels.

Table 13. 14-Bit Temperature Result Available in Register	s 1 and 2
---	-----------

DATAh									DA	TAI					
D7	D6	D5	D4	D3	D2	D1	D0	D7	D6	D5	D4	D3	D2	D1	D0
					14-Bi	t Tempe	erature	Code							

The above sequence assumes normal mode, i.e.,  $t_{CONV}$  = 5.8 ms (typical). Conversions may be performed in fast mode. See Section "5.1.4. Fast Conversion Mode".

#### 5.1.3. Entering Low-Power Mode

Either of the following sequences can be used to place the Si7015 into its low-power standby mode following an RH conversion:

Option A:

Bring CSb high. This puts the Si7015 in low-power mode and disables  $I^2C$  communication. This is similar to Si7005 except that the response to CSb high takes only a few usec and the VDD current is <1  $\mu$ A (as opposed to Si7005 which can take >1second and can have VDD current of up to 100  $\mu$ A).

Option B:

- 1. Poll /RDY until it returns zero, indicating that the conversion is finished.
- 2. Read the results of the RH conversion from DATAh:DATAI.
- 3. Clear the start bit (START) by writing 0x0 to register 3.
- 4. Clear the start bit (START) a second time by again writing 0x0 to register 3.

The Si7015 does enter its low-power standby mode following a temperature conversion. No action is required in this case. However, please note that doing a temperature conversion following an RH conversion will not put the Si7015 in low power state.



Temp(°C)	14 Bit Code					
	Dec	Hex				
-40	320	0140				
-30	640	0280				
-20	960	03C0				
-10	1280	0500				
0	1600	0640				
10	1920	0780				
20	2240	08C0				
30	2560	0A00				
40	2880	0B40				
50	3200	0C80				
60	3520	0DC0				
70	3840	0F00				
80	4160	1040				
90	4480	1180				
100	4800	12C0				

#### Table 14. Typical Temperature Measurement Codes for the -40 °C to 100 °C Range



#### 5.1.4. Fast Conversion Mode

The time needed to perform a temperature or RH measurement can be reduced from 5.8 ms (typical) to 2.6 ms (typical) by setting FAST (D5) in CONFIG (register 0x03). Fast mode reduces the total power consumed during a conversion or the average power consumed by the Si7015 when making periodic conversions. It also reduces the resolution of the measurements.

#### 5.1.5. Heater

The Si7015 relative humidity sensor contains an integrated, resistive heating element that may be used to raise the temperature of the humidity sensor. This element can be used to drive off condensation or to implement dew-point measurement when the Si7015 is used in conjunction with a separate temperature sensor such as another Si7015.

The heater can be activated by setting HEAT (D1) in CONFIG (register 0x03). Turning on the heater will reduce the tendency of the humidity sensor to accumulate an offset due to "memory" of sustained high humidity conditions. When the heater is enabled, the reading of the on-chip temperature sensor will be affected (increased).

#### 5.1.6. Device Identification

The Si7015 device and its revision level can be determined by reading ID (register 0x11). Table 15 lists the values for the various device revisions and may include revisions not yet in existence.

Device	Device	Revision		
D[7:4]	D[3:0]	Туре	Level	
1111	0000	Si7015	А	

Table 15. Device ID Revision Values



## 5.2. I<sup>2</sup>C Operation

The format of the address byte is shown in Table 16.

					-		
A6	A5	A4	A3	A2	A1	A0	R/W
1	0	0	0	0	0	0	1/0

#### Table 16. I<sup>2</sup>C Slave Address Byte

#### 5.2.1. I<sup>2</sup>C Write Operation

To write to a register on the Si7015, the master should issue a start command (S) followed by the slave address, 0x40. The slave address is followed by a 0 to indicate that the operation is a write. Upon recognizing its slave address, the Si7015 issues an acknowledge (A) by pulling the SDA line low for the high duration of the ninth SCL cycle. The next byte the master places on the bus is the register address pointer, selecting the register on the Si7015 to which the data should be transferred. After the Si7015 acknowledges this byte, the master places a data byte on the bus. This byte will be written to the register selected by the address pointer. The Si7015 will acknowledge the data byte, after which the master issues a Stop command (P). See Table 17.

## Master Slave

### Table 17. I<sup>2</sup>C Write Sequence

#### Sequence to Write to a Register

#### Sequence to Start a Relative Humidity Conversion

S 0x40 0 A 0x03 A 0x	1 A	Ρ
----------------------	-----	---

Sequence to Start a Temperature Con	version
-------------------------------------	---------

S	0x40	0	А	0x03	А	0x11	А	Ρ
---	------	---	---	------	---	------	---	---



#### 5.2.2. I<sup>2</sup>C Read Operation

To read a register on the Si7015, the master must first set the address pointer to indicate the register from which the data is to be transferred. Therefore, the first communication with the Si7015 is a write operation. The master should issue a start command (S) followed by the slave address, 0x40. The slave address is followed by a 0 to indicate that the operation is a write. Upon recognizing its slave address, the Si7015 will issue an acknowledge (A) by pulling the SDA line low for the high duration of the ninth SCL cycle. The next byte the master places on the bus is the register address pointer selecting the register on the Si7015 from which the data should be transferred. After the Si7015 acknowledges this byte, the master issues a repeated start command (Sr) indicating that a new transfer is to take place. The Si7015 is addressed once again with the R/W bit set to 1, indicating a read operation. The Si7015 will acknowledge its slave address and output data from the previously-selected register onto the data bus under the control of the SCL signal, the master should not acknowledge (Ā) the data byte and issue a stop (P) command (see Table 22). However, if a RH or Temperature conversion result (two bytes) is to be read, the master should acknowledge (A) the first data byte and continue to activate the SCL signal. The Si7015 will automatically output the second data byte. Upon receiving the second byte, the master should issue a not Acknowledge (Ā) followed by a stop command. (See Table 23.)

#### Table 18. I<sup>2</sup>C Read Sequence for a Single Register

#### Sequence to Read from a Single Register

S	Slave Address	W	А	Address Pointer	А	Sr	Slave Address	R	А	Register Data	Ā	Ρ
---	---------------	---	---	-----------------	---	----	---------------	---	---	---------------	---	---

#### Sequence to Read Device ID

s	0x40	0	А	0x11	А	Sr	0x40	1	А	ID	Ā	Ρ	
---	------	---	---	------	---	----	------	---	---	----	---	---	--

#### Sequence to Read RDY bit

S	0x40	0	А	<b>0x</b> 00	А	Sr	0x40	1	А	 RDY	Ā	Р
0	0740	Ŭ	~	0,00	~	01	07-10		~	IND I	~	

#### Table 19. I<sup>2</sup>C Read Sequence for RH or Temperature Conversion Result

#### Sequence to Read Conversion Result

SSlaveWAAddressASrSlaveRARegister 1ARegister 2APAddressAddressPointerASrSlaveAADataDataDataAP
---

S	0x40	0	А	0x01	А	Sr	0x40	1	А	Data H	А	Data L	Ā	Ρ
---	------	---	---	------	---	----	------	---	---	--------	---	--------	---	---



#### 5.2.3. Firmware Revision

The internal firmware revision can be read with the following I<sup>2</sup>C transaction:

S	Slave Address	W	A	0x8	4	A	0xB8	A	S	Slave Address
R	A FWREV	′ A		NA	Р					

The values in this field are encoded as follows:

0xFF = Firmware revision 1.0

