

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com


Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China








			·	
DRAWING NUMBER		REV	REVISIONS	DATE
SSF-LXH1071LID	1			

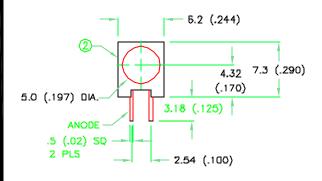

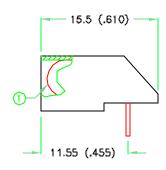

ELECTRO-OPTICAL CHARACTERISTICS TA=25 °C I_f=20mA

PARAMETER	MIN	TYP	MAX	UNITS	TEST COND
PEAK WAVELENGTH		635 (RED)		nm	
FORWARD VOLTAGE		1.9	2.7	V _f	
REVERSE VOLTAGE	5.0			٧ _r	I _C —1 DOu A
AXIAL INTENSITY		20		mcd	I _f =20mA
	1.0			micd	I _f =2mA
VIEWING ANGLE		BO		2x theta	
EMITTED COLOR:	RED				
EPOXY LENS FINISH:	RED	DIFFUSE	D		

LIMITS OF SAFE OPERATION AT 25 DEG. C

PARAMETER	MAX	UNITS
PEAK FORWARD CURRENT*	155	mA
STEADY CURRENT	30	m A
POWER DISSIPATION	110	mW
DERATE FROM 25 °C	-1.2	mW/ ∘ C
OPERATING, STORAGE TEMP.	-55 TO +100	°C .
LEAD SOLDERING TEMP.	+260	C
1.6mm FROM BODY		5 SEC. MAX

^{*} t<10u5

NOTES:

- 1. SSL-LX509F3LID LED.
- 2. SSH-LXH1071 WHITE HOLDER.
- 3. TOLERANCE: +/-0.25 (+/-.010).

RELIABILITY NOTE:

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



292 E. HELLEN RUAD PALATINE, ILLINGIS 60067 (708) 359—2790

DATE: 9-3-93

SCALE: N/A

APPROVED BY:

DRAWN BY:

T-5 (T-1 3/4) RIGHT ANGLE FAULT INDICATOR, RED DIFFUSED, LOW CURRENT SELECTION

PAGE 1 DF 1

DRAWING NUMBER
SSF-LXH1071LID

REV

FXH107AG