



Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from,Europe,America and south Asia,supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of “Quality Parts,Customers Priority,Honest Operation,and Considerate Service”,our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip,ALPS,ROHM,Xilinx,Pulse,ON,Everlight and Freescale. Main products comprise IC,Modules,Potentiometer,IC Socket,Relay,Connector.Our parts cover such applications as commercial,industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China



Instructions for the Assembly of 3M™ Printed Circuit Board (PCB) Connectors

1.0 General

3M Printed Circuit Board Connectors can be terminated before or after being soldered. 3M™ Locator Plates 3443-15, 3443-16, 3443-19 and 3443-34 are drilled to relieve the solder contacts before being soldered. 3M™ Locator Plate 3443-8 has a rubber cushion to relieve the solder contacts and fillets after being soldered. These locator plates are used with 3M™ Manual or Pneumatic Assembly Presses and other convenient assembly tooling to reduce set-up time, provide easier and faster assembly, and reduce assembly error.

3M printed circuit board connectors are designed for production wave soldering, but hand soldering is acceptable. Avoid excessive or prolonged temperature. Connectors should be held down to prevent “floating” during wave soldering. When hand soldering, apply the soldering iron to the printed circuit pad, and bridge the solder round and onto the contact.

Number of Contacts	Product Part No.	3M Locator Plate No.	Shut Height Setting		Platen Part No.
			3640 Press	3335, 3339	
10	3474-0000	3443-15	2	2 1/2	3442-9
		† 3443-8	3*	3 1/2*	
	3474-0000T	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3474-0001T	3443-15	2	2 1/2	
		† 3443-8	4**	4 1/2**	
20	3422-0000	3443-16	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3422-0000T	3443-16	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3422-0001T	3443-16	2	2 1/2	
		† 3443-8	4**	4 1/2**	
26	3434-0000	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3434-0000T	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3434-0001T	3443-15	2	2 1/2	
		† 3443-8	4**	4 1/2**	
34	3402-0000	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3402-0000T	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3402-0001T	3443-15	2	2 1/2	
		† 3443-8	4**	4 1/2**	
40	3418-0000	3443-16	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3418-0000T	3443-16	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3418-0001T	3443-16	2	2 1/2	
		† 3443-8	4**	4 1/2**	
50	3426-0000	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3426-0000T	3443-15	2	2 1/2	
		† 3443-8	3*	3 1/2*	
	3426-0001T	3443-15	2	2 1/2	
		† 3443-8	4**	4 1/2**	

* Connector soldered to 0.062" board
 ** Connector soldered to 0.125" board

† For assembly AFTER soldering
 Use 3M Locator Plate 3443-8

2.0 Assembly:

2.1 Remove the platen from the assembly press and adjust the press shut height to the appropriate setting. (Figure 1)

2.2 Position the locator plate on the assembly press table over the mounting studs for tight, left or front cable entry.

2.3 Replace the platen and position it parallel with the conductor length.

2.4 Unsoldered Connector

- Locate a connector body on the locator plate so the solder contacts are within the relief holes.

Soldered Connector

- Locate a connector body to a PC board over the rubber cushion
- The connector body should be centered directly below the assembly press shaft.

2.5 Grasp a plug cover strip between thumb and forefinger of both hands, with the liner facing you. Rotate the outermost cover down against the adjacent cover on the strip, breaking it from the liner. Pull laterally away from the strip. Adhesive should be present on the cover. (Figure 2)

2.6 Firmly press ribbed side of cable into the alignment grooves on cover. The adhesive will help it to stay in place. Visually inspect to ensure that:

- Cable is properly aligned to cover grooves.
- Cable end is flush with the cover for end terminations or perpendicular to cover for bussing.

2.7 Place the connector cover and cable over the connector body, aligning the cover holes with the cover retaining posts. Push down firmly.

2.8 Complete the connection by lowering the assembly press handle fully.

2.9 Visually inspect to ensure that : (Figure 3)

- Cover is fully seated and parallel with the body.
- Cover is properly aligned with the cable.
- Connector is parallel with PC board.

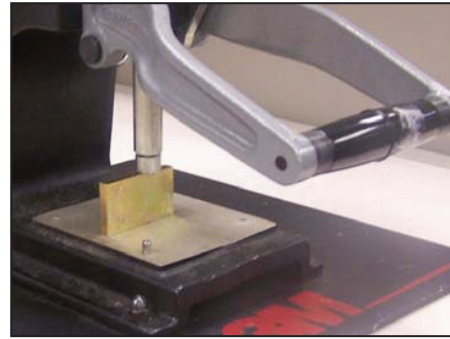


Figure 1



Figure 2

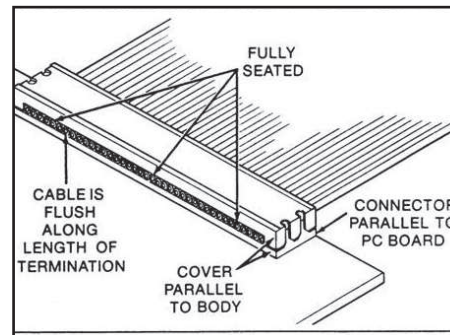


Figure 3

3M is a trademark of 3M Company.

Important Notice

PRODUCT USE: All statements, technical information and recommendations contained in this document are based upon tests or experience that 3M believes are reliable. However, many factors beyond 3M's control can affect the use and performance of a 3M product in a particular application, including the conditions under which the product is used and the time and environmental conditions in which the product is expected to perform. Since these factors are uniquely within the user's knowledge and control, it is essential that the user evaluate the 3M product to determine whether it is fit for a particular purpose and suitable for the user's application.

Warranty; Limited Remedy; Limited Liability.

3M's product warranty is stated in its Product Literature available upon request. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.**



Electronic Solutions Division Interconnect Products

6801 River Place Blvd.
Austin, TX 78726-9000
800-225-5373
www.3Mconnector.com

Please recycle. Printed in USA.
© 3M 2011
78-9100-8157-5-A