

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China










SOURIAU

Clipper Series

Industrial Plastic Connector



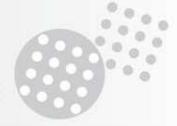

SOURIAU

Connectors and interconnect systems for harsh environments

The company designs, manufactures and markets high performance interconnect solutions for severe environments from industrial broadline and universal ranges to complex system with integrated functions: filtering, high speed data transmission, hermetic seal, separation mechanism, remote handling, underwater mating, ...



Industrial



Aeronautical



Equipment & system

The dedicated end markets for SOURIAU's products are aeronautical, defense-space and industrial.



Railway Geophysics Manufacturing environment Instrumentation Automation & process



Civil & military aircraft Helicopter Weapon delivery system Avionics



Military marine Communications Satellites Launcher & missile

SOURIAU was established in 1917 and has been created by successive acquisitions of the industrial, aeronautical, defense and space activities of SOURIAU, JUPITER and BURNDY.

The Group's products are engineered and manufactured in the USA and Dominican Republic, Europe and Morocco, Japan and India, and sold by a worldwide sales and marketing organization, and in addition to SOURIAU's offices, a large network of licensed distributors and agents.


SOURIAU complies with most of national and international Quality Assurance Standards, production unit with ISO 14001.

Quality Certificate Management System Environment Certificate Management System Quality Certificate Management System

ISO 9001

ISO 14001


Aeronautic Industry: EN 9100






Contents

Description/Features/Presentation	4
Square flange receptacle and in-line receptacle	5
Plug and backnut	6
Electrical thread backshell	7
Accessories	8
Stamped and formed contacts	9
Machined contacts	10
IP68 configuration	11
IP67 configuration	13
Mated and unmated connectors (with backshells) overall dimensions	16
Dimensions (receptacle and plug)	17
Manual crimping tool	18
Automatic crimping tool	19
Panel mounting/panel cut-out	20
Wiring instruction	21
Assembly instruction	22
General technical information	24

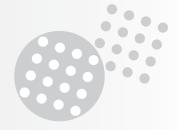

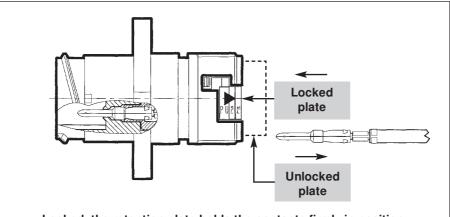

<u>Locked</u>, the retention plate holds the contacts firmly in position <u>Unlocked</u>, the retention plate allows

the insertion/extraction of contacts without tooling

Description

Retention plate principle

Features

Mechanical

- Monobloc shell and insulator in thermoplastic material self-extinguishing to UL 94 V0.
- 180° screw coupling with positive audible safety latch.
- Scoop proof.
- Copper alloy contacts, machined or stamped and formed
- plating : gold on active part over nickel.
- Mechanical endurance :
- connector: 250 cycles mating / unmating,
- retention plate : 50 cycles mating / unmating.
- Retention force :
- # 20 $\;\rightarrow\;70$ N
- -#16 \rightarrow 90 N.
- Vibration :
- frequency range : 10-2000 Hz, 20 g
- 10 cycles in accordance with CEI 68-2-6

Electrical

- Withstand voltage: 1500 Vrms min or in accordance with DIN 57110b.
- Contact resistance < 10 mW.
- Current rating per contact :
- machined contacts :
- # 20 (7 Amps), # 16 (13 Amps)
- stamped and formed contacts: # 20 (5 Amps), # 16 (10 Amps).

Environmental

- · Sealing:
- up to IP68
- Working temperature :
- -40°C to +125°C. (-40°F to +257°F)
- Resistance to salt spray :
- 48 h min
- -> 1000 h (sealed mated connectors).
- · Resistance to fluids :
- oil,
- petrol, fuel,
- lubricants
- other fluids : consult us.

Presentation





CLIPPER is a plastic low cost range of industrial connectors, UL & CSA approved.

Complementing SOURIAU product range CLIPPER offers:

- · a high sealing level:
- IP67 for the sealed plug (with o'ring and mating seal)
- IP68 for the enhanced sealed plug (with o'ring and a special mating seal).
 This version allows a permanent waterproof level when immersed at depths down to 30 meters.
- a retention plate system allowing insertion/extraction of the contacts without the need for tooling,
- facilities to use trade backshells with the electrical thread adaptor (PG).

CLIPPER range is composed of :

- 4 sizes of shell in molded black thermoplastic material (size 1/2/3/4).
- 7 contact layouts (4/9/14/18/26/31/40 contacts).
- #20, #16 contacts, machined or stamped and formed, crimp, solder or PC tail
- An adaptor with electrical PG thread for PG backshells.
- · Backnut with grommet facilities.



Available Style Square flange receptacle and in-line receptacle

			<u>*</u>		Part number								
			Receptacle types without contacts	Unsealed (withou	receptacle t o'ring)	(with o	eceptacle o'ring) e with shell	Sealed re (with o' panel (ing and	In-line receptacle			
		Contacts layouts		CL I PPER		CL 1 PPER		o ring					
				for male contacts	for female contacts	for male contacts	for female contacts	for male contacts	for female contacts	unsealed for male contacts	sealed for male contacts		
	1	4 cts # 16		CL1M1100	CL1R1100	CL1M1101	CL1R1101	CL1M1102	CL1R1102	CL1C1100	CL1C1101		
	•	9 cts # 20	(, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0,	CL1M1200		CL1M1201		CL1M1202		CL1C1200	CL1C1201		
	2	9 cts # 16	00000	CL1M2100	CL1R2100	CL1M2101	CL1R2101	CL1M2102	CL1R2102	CL1C2100	CL1C2101		
sizes	_	14 cts # 20	00000	CL1M2200		CL1M2201		CL1M2202		CL1C2200	CL1C2201		
Shell	3	18 cts # 16	000000000000000000000000000000000000000	CL1M3100	CL1R3100	CL1M3101	CL1R3101	CL1M3102	CL1R3102	CL1C3100	CL1C3101		
		31 cts # 20		CL1M3200		CL1M3201		CL1M3202		CL1C3200	CL1C3201		
	4	26 cts # 16	0 010	CL1M4100		CL1M4101		CL1M4102		CL1C4100	CL1C4101		
		40 cts # 16		CL1M4200	CL1R4200	CL1M4201	CL1R4201	CL1M4202	CL1R4202	CL1C4200	CL1C4201		




Plug and backnut

							Part n	umber		
			Plug types	Unseal (withou and mat	ed plug it o'ring iing seal)	Sealed (with and mat	o'rina	Sealed backnut		Unsealed backnut
		Contact layouts	without		G. Libera	Mating seal		Grommet Oring Thrust ring		
		layouts		for male contacts	for female contacts	for male contacts	for female contacts	for male contacts	for female contacts	for male and female contacts
	1	4 cts # 16		CL1P1100	CL1F1100	CL1P1101	CL1F1101 (IP67) CL1F1103 (IP68)	CL111102	CL111101	CL111000
		9 cts # 20	(0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		CL1F1200		CL1F1201 (IP67) CL1F1203 (IP68)	CL111202	CL111201	GE111000
	2	9 cts # 16	000000000000000000000000000000000000000	CL1P2100	CL1F2100	CL1P2101	CL1F2101 (IP67) CL1F2103 (IP68)	CL112102	CL112101	CL112000
sizes		14 cts # 20	(0)0000		CL1F2200		CL1F2201 (IP67) CL1F2203 (IP68)			OE112000
Shell	3	18 cts # 16	000000	CL1P3100	CL1F3100	CL1P3101	CL1F3101 (IP67) CL1F3103 (IP68)	CL113102	CL113101	CL113000
	3	31 cts # 20	0 0 14 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		CL1F3200		CL1F3201 (IP67) CL1F3203 (IP68)	CL113202	CL113201	GE113000
	4	26 cts # 16	000000000000000000000000000000000000000		CL1F4100		CL1F4101 (IP67) CL1F4103 (IP68)	CL114102	CL114101	CL114000
		40 cts # 16		CL1P4200	CL1F4200	CL1P4201	CL1F4201 (IP67) CL1F4203 (IP68)	CL114202	CL114201	



Electrical thread backshells (PG)

Unsealed (IP40)										
Part numbers										
	Description	1 (PG 13,5)	2 (PG 16)	3 (PG 21)	(PG 29)	(PG 36)				
	Straight backshell for flexible conduit systems	CL101040	CL102040	CL103040	CL124040	CL104040				
	Straight cable clamp	CL101030	CL102030	CL103030	CL124030	*				

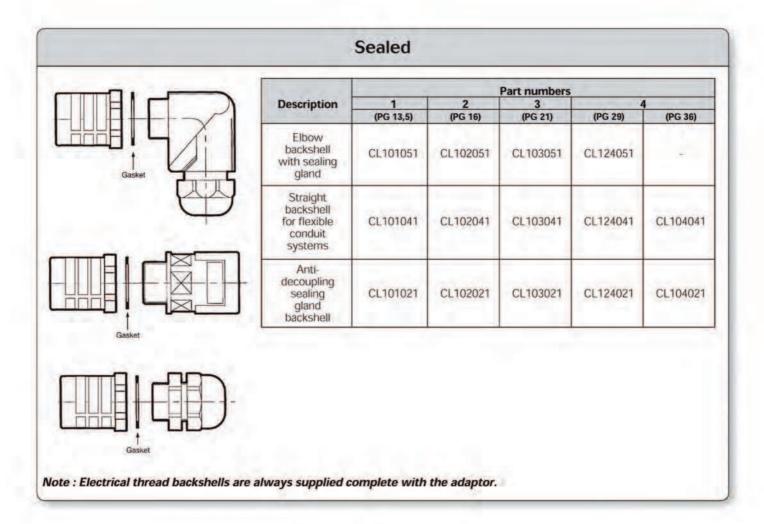




Accessories

Panel gasket (for square flange receptacle)

Shell sizes	1	2	3	4
Part numbers	CL191001	CL192001	CL193001	CL194001



$90\,^{\circ}$ adaptors for receptacles

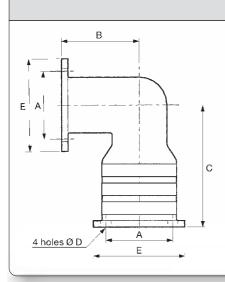

Dim. (inches) / Shell sizes	Α	В	С	D	E
1	.84	.96	1.52	.13	1.15
2	.97	1.10	1.56	.13	1.21
3	1.12	1.20	1.69	.15	1.40
4	1.44	1.55	1.95	.15	1.87

90° sealed adaptors for receptacles Shell 1 to 4

Shell	Part numbers
One	Sealed*
1	CL131001
2	CL132001
3	CL133001
4	CL134001

^{*} with panel gasket



Stamped and formed contacts

Packaging	Crimp Contact with strain relief			Size	Ø mm over insulation (inches)	AWG	Admissible section mm2
Bulk		male	CF16PC10RF			18 to 16	
Bulk		female	CF16SC10RF	16	2 mm to 3 mm (0.08" to 0.12")		0.7 to 1.5 mm ²
Reel 5,000		male	CF16PC18RF				0.7 to 1.5 11111
pcs.		female	CF16SC18RF				
Bulk -			CF10PC10RF				
Duik		female	CF10SC10RF	20	1.2 mm to 2.1 mm	22 to 20	0.35 to 0.6 mm ²
Reel 5,000 pcs.		male	CF10PC18RF		(0.05" to 0.08")		
		female	CF10SC18RF				
Plating RF	gold flash on active part for standard version	(For oth	ner platings, consult F	FCI)			

Filler plug # 16
(for un-used contact cavities)

Part number: 8500 479 CL

Part number: 8500 479 CL

Part number: 8500 4144

Part number: CP16SW9700

(instruction for polarizing connector - see page 23)

Print Circuit (PC) Tail Machined Contact

Bulk	male	16		CM16PT10LY
	male	20		CM10PT10LY



Machined contacts


Packaging	Contact types		Part numbers	Size	Ø mm over insulation (inches)	AWG	Admissible section mm2		
	crimp	male	CM16PC10MQ			18 to 14	0.93		
		female	CM16SC10MQ	16	2 mm to 3 mm		to 1.91 mm ²		
	solder	male	CM16PS10MQ	10	(0.08" to 0.12")	14* Max			
		female	CM16SS10MQ						
Bulk	crimp	male	CM10PC10MQ		1.2 mm to 2.1 mm (0.05" to 0.08")	24 to 18	0.21		
		female	CM10SC10MQ	20			to 0.93 mm ²		
	solder	male	CM10PS10MQ			18 Max			
		female	CM10SS10MQ						
	crimp	male	CM16PC00MQ	16	2 mm to 3 mm	18 to 13	0.93		
		female	CM16SC00MQ		(0.08" to 0.12")		to 2.60 mm ²		
		male	CM16PC20MQ	16	2 to 3 mm	20	0.21		
		female	CM16SC20MQ		(0.08" to 0.12")		to 0.60 mm ²		
	contact reducing cable sleeve	male	CM10PC20MQ	20	1.2 to 2.1 mm	30 to 24	0.06		
female CM10SC20MQ (0.05" to 0.08") 30 to 24 to 0.21 r									
Plating Mo	Q: 0.4μ mm gold on active part (.016μ inche	es)				* L	Jp to 1.91 mm ²		

Extended ground contact-crimp (Length + .039 inch = +1 mm)

	,								
Bulk		male	16	0.08" to 0.12"	18 to 14	8501 9641			
Duik		male	20	0.05" to 0.08"	24 to 18	8501 9642 CL			



IP68 Configuration

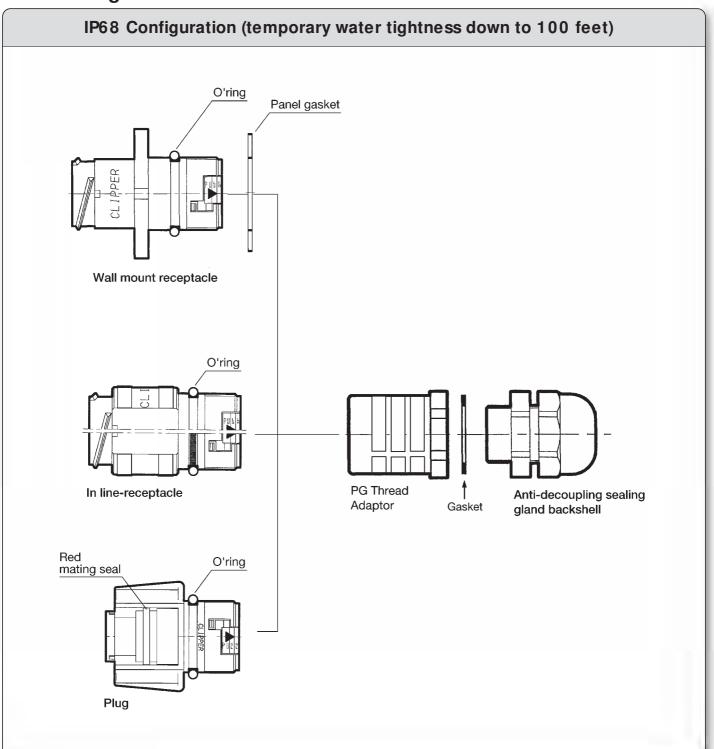




IP68 Configuration

					Part nu	ımbers		
			Shell types (without	Sealed receptacle (with o'ring and panel gasket)	Sealed In-line receptacle	Sealed plug (with o'ring and mating seal)	Anti-decoupling sealing gland backshell	
		Contacts layouts	contacts) and Backshell type	O ring	o'ring	Mating seal Oring	Gaskel	
				for male contacts	for male contacts	for female contacts		
	1	4 cts # 16		CL1M1102	CL1C1101	CL1F1103	CL101021	
	•	9 cts (0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		CL1M1202	CL1C1201	CL1F1203	(pg 13.5)	
	2	9 cts # 16		CL1M2102	CL1C2101	CL1F2103	CL102021	
sizes	_	14 cts # 20		CL1M2202	CL1C2201	CL1F2203	(pg 16)	
Shell	3	18 cts # 16	000000000000000000000000000000000000000	CL1M3102	CL1C3101	CL1F3103	CL103021	
	3	31 cts # 20	18 0 18 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	CL1M3202	CL1C3201	CL1F3203	(pg 21)	
	4	26 cts # 16 CL1M4102		CL1C4101	CL1F4103	CL124021 CL104021		
		40 cts # 16		CL1M4202	CL1C4201	CL1F4203	(pg 29) (pg 36)	




IP67 Configuration

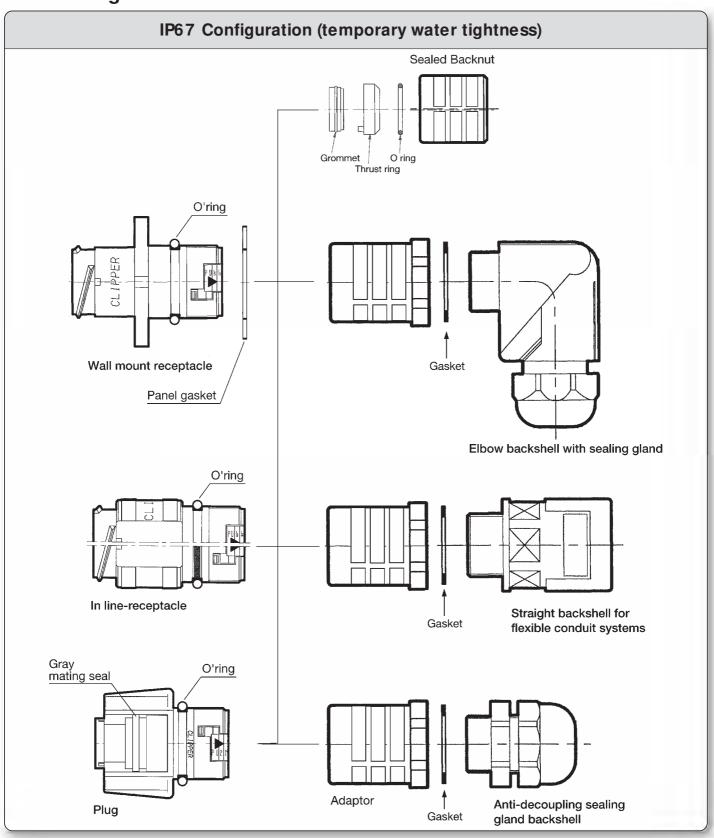



IP67 Configuration

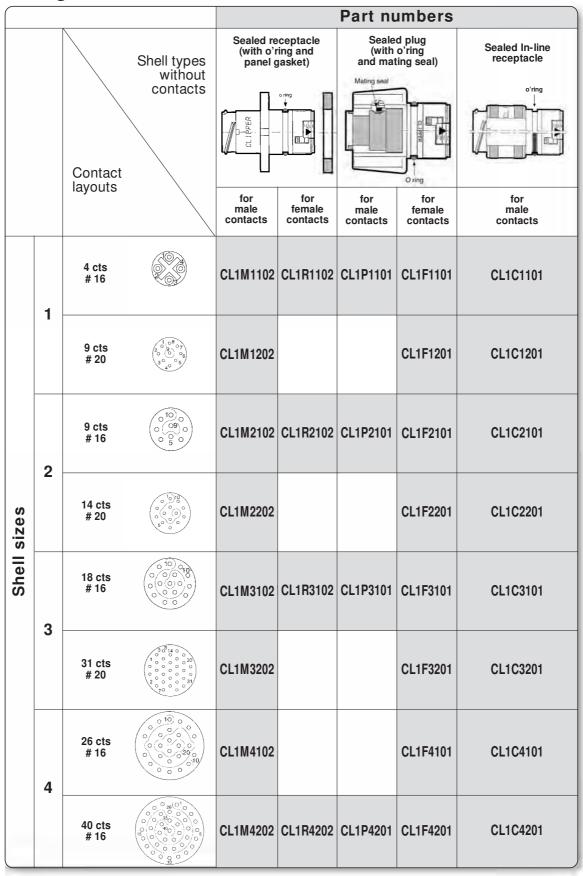




IP67 Configuration

				Part numbers						
			Backshell types		oacknut	Elbow backshell with sealing gland	Straight ba	ickshell for duit systems	Anti-decoup gland ba	oling sealing ackshell
	Contact			Grommet Orini Thrust ring	ng .		Charles			
		layouts		for male contacts	for female contacts					
	1	4 cts # 16		CL111102	CL111101	CL101051	CL10		CL10	
sizes		9 cts # 20	20 9 07 20 0 0 0 30 0 5	CL111202	CL111201	(pg 13.5)	(pg	13.5)	(pg	13.5)
	2	9 cts # 16	010000000000000000000000000000000000000	CL112102	CL112101	CL102051	CL10		CL10	
		14 cts # 20	60,000			(pg 16)	(pg	16)	(pg	16)
Shell	3	18 cts # 16	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	CL113102	CL113101	CL103051	CL10		CL10	
		31 cts # 20	3 8 14 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	CL113202	CL113201	(pg 21)	(pg	21)	(pg	21)
	4	26 cts # 16	010000000000000000000000000000000000000	CL114102	CL114101	CL124051	CL124041	CL104041	CL124021	CL104021
	4	40 cts # 16	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	CL114202	CL114201	(pg 29)	(pg 29)	(pg 36)	(pg 29)	(pg 36)



Mated and unmated connectors with backshells

Overall dimensions in inches

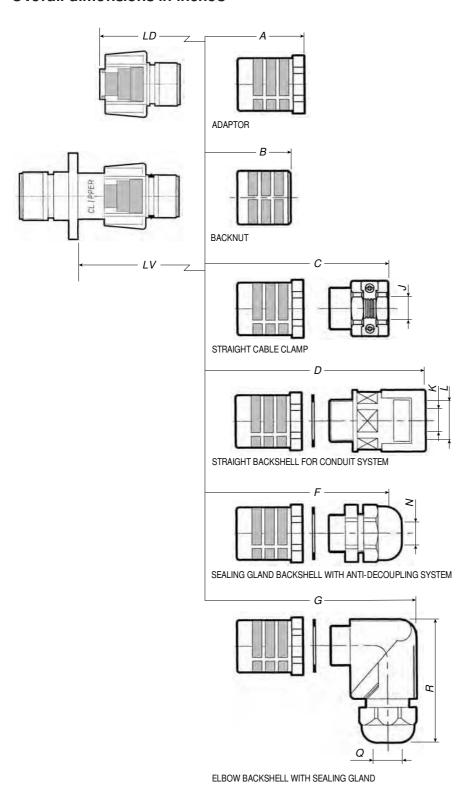

Dimensions (PG 29)(PG 36) Dim. (inches) 2.01 | 2.09 | 2.09 | 2.17 | 2.17 LDA LVA 2.29 2.33 2.33 2.41 2.41 LDB 1.85 1.81 1.85 1.85 LVB 2.09 | 2.09 | 2.09 | 2.09 LDC 2.68 2.85 3.03 3.41 LVC 2.97 3.09 3.27 3.60 LDD 3.41 3.50 3.62 3.70 4.25 LVD 3.70 3.74 3.86 3.94 4.47 **LDF** 3.15 3.27 3.35 3.74 4.02

3.31 3.46

3.43 3.50 3.58 3.98 4.25

3.58 3.70 4.01 4.52

2.24 2.34 2.87 3.58

3.77 4.29

LVF

LDG

LVG

R Max.


Cable acceptance*


Shell	1	2	3	4	,
Dim. (inches)				(PG 29)	(PG 36)
J	24/ 55	24/ 63	.31/.83	.39/	_
"	.2 17.00	.2 17.00	.0 .7.00	1.10	
Conduit L	.67	.67	.91	1.14	1.42
Pmaflex					
K Max	.63	.63	.85	1.08	1.42
N	24/47	39/ 55	.51/.71	71/ 98	.87/
	/ -/ /	.00,.00	.0 .,.,	., .,	1.26
Q	.24/.47	.39/.55	.51/.71	.71/.98)

^{*} For other needs, consult FCI.



Dimensions in inches

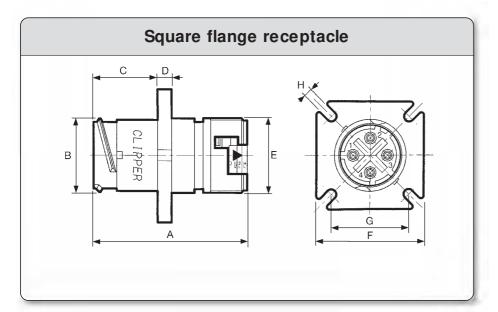

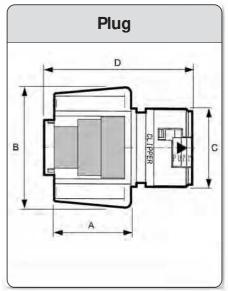


Shell Shell sizes	1	2	3	4
Α	1.67	1.67	1.67	1.67
В	.83	.96	1.14	1.59
С	.71	.71	.71	.71
D	.16	.16	.16	.16
Ε	.81	.94	1.12	1.57
F	1.17	1.23	1.42	1.89
G min.	.83	.96	1.11	1.43
Max.	.92	.98	1.17	1.57
Н	.13	.13	.15	.15


Dim.	1	2	3	4
Α	.8	.8	.8	.8
В	1.15	1.28	1.46	1.92
С	.81	.94	1.12	1.57
D	1.52	1.56	1.56	1.56




Manual Crimping Tool

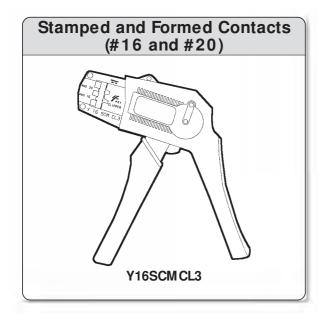

- Squeeze the plier handles until a final click sounds, release, the pliers should open by themselves.
- Fully insert the contact into the locator (corresponding gauge), the contact crimping lugs should be directed upwards, according to the drawing.
- Put the stripped wire in the crimping part until it comes in contact with the stopper plate. Make sure that no strands stick out of the crimping part.
- Squeeze the plier handles until a final click sounds, release, the pliers should open by themselves.
- · Check the overall aspect of the crimping.

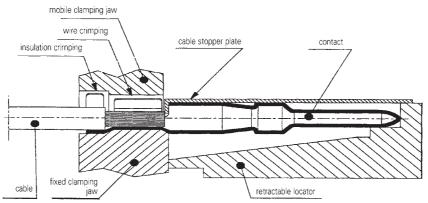

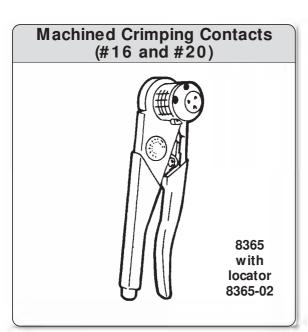

- Push the cable into the contact barrel and make sure the cable strands stick out of the inspection hole.
- The pliers must be used on the jaws side.
- Squeeze the plier handles until a final click sounds, release, the pliers should open by themselves.
- Insert both wire and contact (or wire, reducing sleeve and contact) between the 4 jaws until stopped by the locator.
- Fully squeeze until a final click sounds, the pliers should open once the crimping is performed
- Extract the wire and crimped contact, then check the overall aspect of the crimping.



Automatic crimping tool



UTM2 Automatic crimping tool for Clipper

Description

Electromechanical high speed semi automatic press is designed for mass production and is realized totally in assembled steel parts.

Voltage: 115VAC - 60 Hz Power.: 700 Watts

Weight: 300 lbs. (including one

crimp mechanism)
Dimensions: 939.8x533.4x711.2 mm
(37.0"x21.0"x28.0")

Crimping Mechanism (left side miniapplicators)

Contacts	AWG	Contact P/N	Crimp Mech. P/N
16	16-18	CF16 PS 18RF CF16 SC 18RF	CM30-R
20	20-22	CF10 PS 18RF CF10 SC 18RF	CM31-R




Press and crimping mechanism are rental. Please contact Customer Service.




Panel mounting / Panel cut-out

Panel mounting


There are two types of mounting possible: through the front or through the back of the panel.

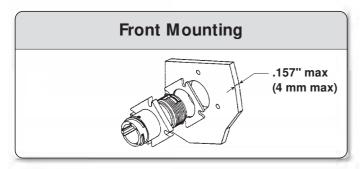

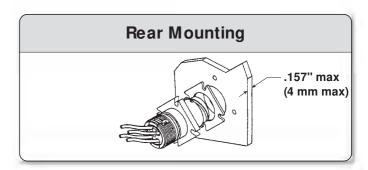


Panel cut-out

• For a sealed mounting, the seal gasket shall be used, making sure the surface is in good condition.

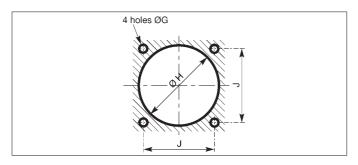

- Observe the drilling hole diameters indicated below.
- Use the recommended screws: M3 (all shells) or # 4.40 (shells 1 and 2) # 6.32 (shells 3 and 4)
- Respect the coupling torques indicated M3 (all shells): 0.70 N.m Max

Shell	1	2	3	4
Dim. (inches)				
Н	.85	.98	1.22	1.61
I	.84	.97	1.13	1.44
J	.13	.13	.15	.15






Wiring Instruction

Stripping Instructions

Use the upmost care with stripping operation:

- Use stripping pliers appropriate for the cable gauge and which are in perfect condition.
- In order to obtain a correct crimping and to maintain all of the connector sealing characteristics, the wires must have the dimensions described below.

Jacketed Cable Stripping Length

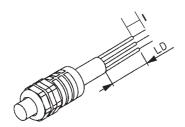

Make a 90° cut at the cable end.

carefully make an incision in order to remove the cable protection on a length LD as described.

Shell size	1	2	3	4	4
layouts	Indifferent			26	40
LD mm	60	65	65	80	100
(inch)	(2.36')	(2.56')	(2.56')	(3.15")	(3.94")

Caution: This operation should be realized without deterioration of wires insulation.

Then, follow the normal stripping instructions :

- single wire with machined crimping contacts,
- single wire with stamped and formed crimping contacts

Wire Stripping Length

• With machined crimping contacts

Contact size	I = Wire stripping lenght
layouts	6 mm (.236")
#20	Ø over insulation > 2 mm \Rightarrow I = 5 (> .08" \Rightarrow I = .20") Ø over insulation > 2 mm \Rightarrow I = 7 (> .08" \Rightarrow I = .27")

• With stamped and formed crimping contacts

Contact diameter	I = Wire stripping lenght
#16	4 mm (.157")
#20	4 mm (.157")



Instruction For Assembly

Insertion and extraction of contacts

Single wires

Contact insertion and extraction is performed without a tool thanks to te retainer plate system.

Insertion



- With the thumb and index finger, squeeze the retainer plate flaps and pull backwards: the plate is then in the unlocked position.
- 2) Fully insert the wired contact in the cavity.



- 3) Repeat the same procedure for the other contacts.
- Once again squeeze the retainer plate flaps and push forwards: the plate is then locked and retains the contacts (90 N of retention force for contacts of 1.6 mm dia.)
- The plate can only be pushed backed if the contacts are correctly engaged (backup security)

Extraction



- With the thumb and index finger, squeeze the retainer plate flaps and pull backwards: the plate is then in the unlocked position.
- 2) Pull the contact wire: the the contact comes out of the cavity.



3) Repeat the same procedure for the other contacts.

Special case of jacketed cables

- 1) Locate the first contact and the corresponding cavity.
- 2) The wire should described a buckle as describe below.
- 3) Unlock the retainer plate as described above.
- 4) Fully insert the wired contact in the cavity.
- 5) Respect the same procedure for the other contacts
- 6) Once again squeeze the retainer plate flaps and push forwards : the plate is then locked


Special case of jacketed cables

7) Manually fully screw the adaptor and the backshell on the connector.

Caution: In the sealed version don't forget the O-ring.

- 8) Push forwards the cable of 10 mm in the backshell.
- Fully screw on the backshell with a wrench while keeping the adaptor with another wrench.

Note: The plate can only be pushed back if the contacts are correctly engaged (backup-security)

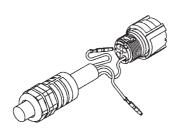



Instruction For Assembly

Adaptor and PG electrical thread backshells


The CLIPPER connector must be equipped with an adaptor in order to use a PG electrical thread backshell (e.g.: cable clamp or sealing gland, or flexible conduits system backshells, etc.)



- Manually, fully screw the adaptor on the connector, the hexagonal nut towards the rear.
- In the sealed version, cover the O-ring.
- Manually, fully screw the PG thread backshell of your choice.



Note: In the case of an elbow backshell, it is possible to adjust the position according to the angle desired.

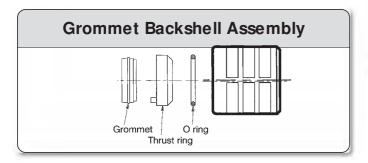

- 1) Position the O-ring at the bottom of the backnut.
- 2) Run the backnut around the cable.
- 3) Unlock the retainer plate.
- 4) Position the grommet in the thrust ring, resting against the retainer plate.
- 5) Insert the contacts through the grommet and the retainer plate.
- 6) Lock the retainer plate.
- 7) Screw the backshell.




Heat shrink boot

Shrink sleeve as follows:

- 1) Use heat gun with an air deflector nozzle.
- 2) Adjust air deflector opening to accommodate tubing size. Turn switch ON. Wait until full heat output is reached.
- 3) Position the air deflector over section of tubing to be shrunk. Start at pre-shrunk section and work towards open end.
- 4) When tubing begins to shrink, move gun so that air is distributed in a band around the tubing circumference causing it to shrink evenly around the cable.
- 5) Move nozzle to adjacent section and shrink in the same manner. Repeat process on section at a time until entire length is shrunk.

Avoid excessive heat. Direct heat away from connector assembly to prevent damage.

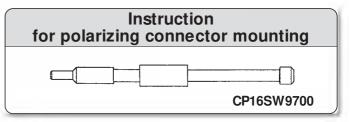

When the insert is partially filled with contacts, place polarization contact into selected hole location in the FEMALE INSERT and push in until seated.

- Polarization contacts are used to provide keying capabilities for the CLIPPER series.
- Polarization contacts are used in the **socket-cavities** of standard plugs and reverse receptacles.

In order to lock the couple of chosen connectors, you have to let free the cavity in front of the polarization contact.

To avoid the connection with other connectors, you have to insert a contact in the cavity in front of the polarization contact.



General technical information

Degree of protection in accordance with CEI 529, DIN 40050, NF EN 60529 First index Second index Third index Protection against accidental or inadvertent contact. Prot. against ingress of foreign bodies. Protection against mechanical Protection against ingress of water Test 0 Protection against diagonal drop water drips (up to < of 15° of vertical) 0 No protection No protection 0 $\mathbb{P} \times 0$ Test Ball Ø 2 inch Protection against vertical drop water drips. Impact strength: 0,225 J 1 250 g Ball Ø .5 inch Impact strength: 0,5 J 2 3 250 g Protection against contact with the fingers prot. against solid foreign bodies with \emptyset 0.5 inch 3 Impact strength: 2 J Protection against tools wires or similar objects with $\varnothing>0.1$ inch, prot. against small foreign solid bodies with $\varnothing>0.1$ inch 500 g 5 Protection against water 15.7 incl 4 Impact strength: 6 J Protection against tools wires or similar objects with $\emptyset > .04$ inch, prot. against small foreign solid bodies with $\emptyset > .04$ inch ⊮×5 Full protection against accid. or inadv. contact. Prot. against interio injurious dust deposits. 6 Proof against temporary flooding Talc 5 Impact strength: 20 J #×6 8 Water tight water plunging 9 6 Proof against temporary water plunging Proof against water pressure Total protection against accid. or inadv contact. Protection against of dust. EXAMPLE: IP66-5 means: - Total protection against dust Proof against temporary flooding Proof against impact strength of 2 Joule



Conversion Table

(mm) (inches) 0.1 0.00394 0.2 0.00788 0.3 0.01182 0.4 0.01576 0.5 0.01970 0.6 0.02364 0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11024 2.7 0.10638 2.8 0.113002 3.4 </th <th></th> <th></th>		
0.2 0.00788 0.3 0.01182 0.4 0.01576 0.5 0.01970 0.6 0.02364 0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3	(mm)	(inches)
0.3 0.01182 0.4 0.01576 0.5 0.01970 0.6 0.02364 0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12608 3.3 0.13002 3.4 0.13396 3.5	0.1	
0.4 0.01576 0.5 0.01970 0.6 0.02364 0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13996 3.5	0.2	
0.5 0.01970 0.6 0.02364 0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.1396 3.5 0.13790 3.6	0.3	
0.6	0.4	
0.7 0.02758 0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8	0.5	0.01970
0.8 0.03152 0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9		
0.9 0.03546 1.0 0.03940 1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0		
1.0	0.8	
1.1 0.04334 1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3		
1.2 0.04728 1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3		
1.3 0.05122 1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4		
1.4 0.05516 1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.1736 4.5	1.2	
1.5 0.05910 1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17330 4.6 0.18124 4.7		
1.6 0.06304 1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16548 4.3 0.16942 4.4 0.17330 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9		
1.7 0.06698 1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.1736 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8		
1.8 0.07092 1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.1736 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9	1.6	
1.9 0.07486 2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.1396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0		
2.0 0.07880 2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4		
2.1 0.08274 2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4		
2.2 0.08668 2.3 0.09062 2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.2064 5.8 0.22265 6.0	2.0	
2.3		
2.4 0.09456 2.5 0.09850 2.6 0.10244 2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0	2.2	
2.5		
2.6	2.4	
2.7 0.10638 2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6		
2.8 0.11032 2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8	2.6	0.10244
2.9 0.11426 3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26992 7.0		0.10638
3.0 0.11820 3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732	2.8	0.11032
3.1 0.12214 3.2 0.12608 3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732	2.9	
3.2	3.0	0.11820
3.3 0.13002 3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732	3.1	0.12214
3.4 0.13396 3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
3.5 0.13790 3.6 0.14184 3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.13002
3.6		
3.7 0.14578 3.8 0.14972 3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.13790
3.8		
3.9 0.15366 4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.14578
4.0 0.15760 4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.1 0.16154 4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.15366
4.2 0.16548 4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.15760
4.3 0.16942 4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.4 0.17336 4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.5 0.17730 4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.6 0.18124 4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.7 0.18518 4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
4.8 0.18912 4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732	4.6	
4.9 0.19306 5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
5.0 0.19700 5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
5.2 0.20488 5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		0.19306
5.4 0.21276 5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
5.6 0.22064 5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
5.8 0.22852 6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
6.0 0.23640 6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
6.2 0.24428 6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
6.4 0.25216 6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
6.6 0.26004 6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
6.8 0.26792 7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
7.0 0.27580 7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
7.2 0.28368 7.4 0.29156 7.6 0.29944 7.8 0.30732		
7.4 0.29156 7.6 0.29944 7.8 0.30732		
7.4 0.29156 7.6 0.29944 7.8 0.30732	7.2	
7.6 0.29944 7.8 0.30732	7.4	
	7.6	
	7.8	0.30732
		0.31520

	Convers
(mm)	(inches)
8.2	0.32308
8.4	0.33096
8.6	0.33884
8.8	0.34672
9.0	0.35460
9.2	0.36248
9.4	0.37036
9.6	0.37824 0.38612
9.8 10.0	0.39400
10.5	0.39400
11.0	0.43340
11.5	0.45310
12.0	0.47280
12.5	0.49250
13.0	0.51220
13.5	0.53190
14.0	0.55160
14.5	0.57130
15.0	0.59100
15.5	0.61070
16.0	0.63040
16.5	0.65010
17.0	0.66980
17.5	0.68950
18.0	0.70920
18.5 19.0	0.72890 0.74860
19.5	0.74880
20.0	0.78800
20.5	0.80770
21.0	0.82740
21.5	0.84710
22.0	0.86680
22.5	0.88650
23.0	0.90620
23.5	0.92590
24.0	0.94560
24.5	0.96530
25.0	0.98500
25.5	1.00470
26.0	1.02440
26.5	1.04410
27.0	1.06380 1.08350
27.5 28.0	1.10330
28.5	1.12290
29.0	1.14260
29.5	1.16230
30.0	1.18200
30.5	1.20170
31.0	1.22140
31.5	1.24110
32.0	1.26080
32.5	1.28050
33.0	1.30020
33.5	1.31990
34.0	1.33960
34.5	1.35930
35.0	1.37900
35.5	1.39870
36.0	1.41840 1.43810
36.5	1.45780
37.0	1.45/00

(mm)	(inches)
38.0	1.49720
38.5	1.51690
39.0	1.53660
39.5	1.55630
40.0	1.57600
40.5	1.59570
41.0	1.61540
41.5	1.63510
42.0	1.65480
42.5	1.67450
43.0	1.69420
43.5	1.71390
44.0 44.5	1.73360
45.0	1.75330
45.5	1.77300
46.0	1.79270 1.81240
46.5	1.83210
47.0	1.85180
47.5	1.87150
48.0	1.89120
48.5	1.91090
49.0	1.93060
49.5	1.95030
50.0	1.97000
51.0	2.00940
52.0	2.04880
53.0	2.08820
54.0	2.12760
55.0	2.16700
56.0	2.20640
57.0	2.24580
58.0	2.28520
59.0	2.32460
60.0	2.36400
61.0	2.40340
62.0	2.44280
63.0	2.48220
64.0	2.52160
65.0	2.56100
66.0	2.60040
67.0	2.63980
68.0	2.67920
69.0	2.71860
70.0	2.75800
71.0	2.79740
72.0	2.83680
73.0	2.87620
74.0	2.91560
75.0	2.95500
80.0	3.15200
85.0	3.34900
90.0	3.54600
100.0	3.94000
200.0	7.88000
400.0	15.76000
600.0	23.64000
800.0	31.52000
1000.0	39.40000
1200.0 1600.0	47.28000
	63.04000
2000.0 3200.0	78.80000 126.08000
3200.0	120.00000

(°C)	(°F)
- 70	- 94
- 65	- 85
- 55	- 67
- 50	- 58
- 40	- 40
0	32
37	98.6
80	176
125	257
150	302
170	338
200	392
250	482

bar	psi	mmHg (torr)
10	145.0	7600
5	72.5	3800
2	29.0	1520
1	14.5	760
0.5	7.2	380
0.1	1.4	76

psi	torr (mmHg)
145.0	7600
72.5	3800
29.0	1520
14.5	760
7.2	380
1.4	76
	145.0 72.5 29.0 14.5 7.2

^{(1) 6145}DJ - Câbles multipaires (armés, paires blindées) 250 MZH.

^{(2) 6145}DJ - Câbles multipaires (armés, paires non blindées) 250 MZH.