

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China











4½ Digit, 4-20mA Input, LED Display Meters



FEATURES

- Full-size, 0.52" (13.2mm) high, LED digits
- +7.5-32Vdc model draws 30mA
- +24V Isolated-power models
- Dip-switch selectable range, offset, and decimal points
- Non-interacting, 20-turn, gain (span) and offset (zero) adjustments
- Insensitive to ground loops
- 103 Ohm max. loop burden
- Vibration-resistant package; reliable screw-terminal connections
- Hundreds of different input/readout combinations
- Miniature size: 2.17" x 0.92" x 1.02" (55mm x 23mm x 26mm)

The DMS-40PC-4/20S Series' superior design makes them ideal for use in demanding 4-20mA process monitoring applications requiring a full 4½ digits (0-19999) of display resolution. Their full-size, 0.52" (13.2mm) high, LED displays can be read in virtually any lighting condition and are available in green, high-intensity red, or low-power red.

Two operating power supply ranges are available: a wide-input +7.5 to 32V model for use with popular +12Vdc and +24Vdc industrial supplies, and +4.75 to 5.25V models for use with +5V logic supplies. The reverse-polarity protected +7.5-32V red LED model consumes only 30mA from a +24V supply, but still provides excellent display brightness.

The DMS-40PC-4/20's input, span, and offset circuits all employ super-stable, $\pm 0.5\%$ thin-film chip resistors. Long-term stability and accuracy are assured by driving these tight-tolerance resistors with an ultra-stable, $\pm 0.2\%$ bandgap voltage reference. And, unlike many competing designs, the two precision 20-turn span and zero adjust potentiometers do not interact with one another.

All range-change and decimal point selections are made by configuring two gold-plated, vibration-resistant, six-position DIP switches. To further enhance reliability, both power supply and current loop connections are made via reliable screw-type terminal blocks. All these outstanding features make the DMS-40PC-4/20S Series meters the most rugged $4\frac{1}{2}$ digit LED display process monitors available.

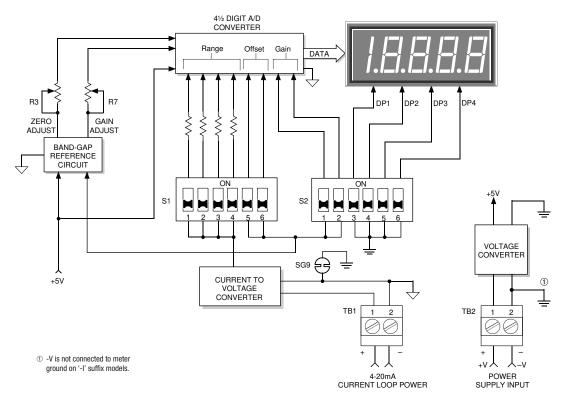






Figure 1. DMS-40PC-4/20S Simplified Schematic

DMS-40PC-4/20S

4½ Digit, 4-20mA Input, LED Display Meters **TECHNICAL NOTES**

(1) Full Scale Input: The DIP Switch settings display readings in Table 1 can typically be obtained with transmitters having a low-level output of 3.7 to 4.3mA and a full-scale output of 19.4 to 20.4mA. When using transmitters whose outputs fall outside these ranges, try using the next highest DIP switch setting if the desired reading is too low, or the next lowest setting if the desired display reading is too high. Example number 2 illustrates this point.

Please keep in mind that the DMS-40PC meter from which the DMS-40PC-4/20S is derived has an accuracy specification of ± 3 counts (max.); thus, it may not always be possible to obtain the exact desired display readings. A change of ± 1 count is defined as the right-hand most digit (the"ones" LED) going up or down by one.

Other display readings not shown in Table 1 are obtainable. For example, some negative readings with a 4mA input are possible. Consult Murata Power Solutions for more information regarding display readings not shown in the table.

- (2) Loop Impedance/Drop: The maximum loop impedance and the maximum loop voltage-drop are both specified with DIP switch setting #20 enabled. The maximum loop voltage drop is specified with a 20.0mA input current.
- (3) Temperature Drift: Temperature drift of zero and temperature drift of gain are both specified with the meter configured for range #20 with 4mA adjusted (using R3) to read "0000" ±1 count, and 20mA adjusted (using R7) to read "19000" ±2 counts.

The temperature drift of gain is proportional to the full scale range being used. It is typically less pronounced at the lower range settings, that is, if the observed gain drift of a particular meter is +12 counts when reading "19000" on range #20 at 40° C, the same meter will most likely have a drift of only +6 counts when reading "9000" on range #12 at 40° C.

The normally very accurate autozeroing feature of the DMS-40PC-4/20S's internal analog-to-digital converter (A/D) is not a factor in determining the meter's zero-reading stability over temperature due to the fact that an offset voltage is applied to the A/D's LO input. This offset voltage is used to null the voltage developed with a 4ma input. To function properly, the autozeroing feature found in most digital panel meters requires both A/D inputs to remain at zero volts with varying temperature. The meter's zero-reading stability over its specified operating temperature is affected by the drift of three terms: the voltage developed by the meter's offset circuitry; the voltage developed across the meter's input resistor(s) with a 4mA input; and the stability of the applied 4mA input signal itself. In the lower DIP switch settings (ranges #1-4), the meter's parasitic etch and switch interconnect resistances also contribute a small error.

The meter's performance with regards to span stability over temperature is affected by the drift of the meter's gain circuitry and the drift of the input resistor(s). To counter these drifts in applications requiring the utmost in temperature stability, where possible, the meter should be calibrated at its anticipated operating temperature. For these applications, use of the DMS-40PC-4/20S-5RL model is highly recommended because of its inherently lower power consumption and self-heating.

Performance/Functional Specifications

Typical at $TA = +25^{\circ}C$, unless otherwise noted.

| Current Loop Input | Min. | Тур. | Max. | Units |
|--------------------------------|--|-------------|-----------|---------|
| Full Scale Input Range (1) | +3.7 | - | +20.4 | mA |
| Loop Burden (2) | 12 | - | 103 | Ohms |
| Voltage Drop (2) | - | - | 2.1 | Volts |
| Overcurrent Protection | - | - | ±40 | mA |
| Performance | | | | |
| Sampling Rate | 2 | 2.5 reading | per secon | d |
| Accuracy (1 minute warm-up) | T | o ±0.01%F | S ±2 Cour | nt |
| Temperature Drift of Span (3) | _ | ±0.3 | ±0.6 | Cnts/°C |
| Temperature Drift of Zero (3) | - | ±0.2 | ±0.5 | Cnts/°C |
| Power Supply Requirements (4) | | | | |
| DMS-40PC-4/20S-5RS | +4.75 to +5.25Vdc at 140mA max. | | | |
| DMS-40PC-4/20S-5GS | +4.75 to +5.25Vdc at 140mA max. | | | |
| DMS-40PC-4/20S-5RH | +4.75 to +5.25Vdc at 140mA max. | | | |
| DMS-40PC-4/20S-RL | +4.75 to +5.25Vdc at 50mA max. | | | |
| DMS-40PC-4/20S-24RL | +7.5 to +32Vdc at 50mA max. | | | |
| DMS-40PC-4/20S-24XX-I (models) | +21.6 to +26.4Vdc at 60mA max. | | | |
| Display | | | | |
| Display Type and Size | 4½ digit, 0.52"/13.2mm high LED | | | |
| Polarity Indication | "-" for negative readings | | | |
| Overrange Indication | "-1" for negative inputs "1" for positive inputs | | | |
| Physical/Environmental | i ioi positive iriputs | | | |
| Operating Temperature | 0 | | +50 | °C |
| Storage Temperature | -40 | _ | +75 | °C |
| Humidity (non-condensing) | 0 | _ | 95 | °C |
| Case Material | Polycarbonate | | | |
| Weight | 0.1 ounces (28 grams) | | | |
| | 0.1 ounces (20 grains) | | | |

Ordering Information

DMS-40PC-4/20S-5RS-C +5V supply, standard-intensity red LEDs DMS-40PC-4/20S-5GS-C +5V supply, standard-intensity green LEDs DMS-40PC-4/20S-5RL-C +5V supply, low-power red LEDs DMS-40PC-4/20S-5RH-C +5V supply, high-intensity red LEDs DMS-40PC-4/20S-24RL-C +7.5V to +32V supply, low-power red LEDs DMS-40PC-4/20S-24RS-I-C +24V isolated supply, standard-intensity red LEDs DMS-40PC-4/20S-24RH-I-C +24V isolated supply, high-intensity red LEDs DMS-40PC-4/20S-24GS-I-C +24V isolated supply, standard-intensity green LEDs DMS-BZL1-C Panel-mount bezel assembly DMS-BZL2-C Panel-mount bezel assembly with sealing gasket DMS-30-CP Panel cutout punch

See www.murata-ps.com/dpm-availability for model-specific availability.

A panel-mount retaining clip is supplied with each meter.

41/2 Digit, 4-20mA Input, LED Display Meters

Table 1. DIP-Switch Settings

| | | Switch S1 | | | | | | Switch S2 | | |
|-----|-------|-------------|-----|-----|-----|-----|-----|-----------|-----|-----|
| | Displ | ay Reading | SW1 | SW2 | SW3 | SW4 | SW5 | SW6 | SW1 | SW2 |
| | 4mA | 20mA | | | | | | | | |
| 1. | 0000 | 2250-2500 | Off | 0n | 0n | 0n | Off | Off | On | On |
| 2. | 0000 | 2500-2800 | Off | 0n | On | 0n | Off | Off | Off | On |
| 3. | 0000 | 2800-3200 | Off | 0n | On | 0n | Off | Off | On | Off |
| 4. | 0000 | 3200-3850 | Off | 0n | On | 0n | Off | Off | Off | Off |
| 5. | 0000 | 3850-4300 | On | Off | On | On | Off | Off | On | On |
| 6. | 0000 | 4300-4900 | On | Off | On | On | Off | Off | Off | On |
| 7. | 0000 | 4900-5600 | On | Off | On | On | Off | Off | On | Off |
| 8. | 0000 | 5600-6200 | On | Off | On | On | Off | Off | Off | Off |
| 9. | 0000 | 6200-6800 | Off | Off | 0n | 0n | 0n | Off | On | On |
| 10. | 0000 | 6800-7750 | Off | Off | On | 0n | 0n | Off | Off | On |
| 11. | 0000 | 7750-8600 | On | On | Off | On | On | Off | On | On |
| 12. | 0000 | 8600-9850 | On | On | Off | On | On | Off | Off | On |
| 13. | 0000 | 9850-11000 | 0n | 0n | 0n | Off | Off | 0n | On | On |
| 14. | 0000 | 11000-12000 | 0n | 0n | On | Off | Off | 0n | Off | On |
| 15. | 0000 | 12000-13000 | On | Off | Off | On | Off | 0n | On | On |
| 16. | 0000 | 13000-14000 | On | Off | Off | On | Off | On | Off | On |
| 17. | 0000 | 14000-15300 | On | Off | 0n | Off | 0n | 0n | On | 0n |
| 18. | 0000 | 15300-16300 | On | Off | 0n | Off | On | 0n | Off | 0n |
| 19. | 0000 | 16300-17800 | Off | Off | 0n | Off | On | On | On | On |
| 20. | 0000 | 17800-20000 | Off | Off | On | Off | On | On | Off | On |

Since the DMS-40PC-4/20S uses extremely-stable thin-film chip resistors, periodic re-calibration is typically required only in environmentally demanding applications where shock, vibration and temperature extremes may have a detrimental affect on the 20-turn potentiometers.

(4) Input Grounding: Except for the "-I" suffix models which feature isolated current loop inputs, all other DMS-40PC-4/20S meters are supplied with their 4-20mA negative-input terminals (TB1-2, "-") internally connected to their power supply ground terminal (TB2-2, "-V"). This single-ended input configuration is compatible with most grounded-referenced 4-20mA transmitters.

Applications in which the DMS-40PC-4/20S and its associated 4-20mA transmitter are connected to a common ground and the transmitter drives two or more loads (for example, the meter is in series with a PLC) must have the meter connected as the **first** device in the current loop, that is, closest to the system ground (see Figure 2). If this connection scheme is not possible and/or the meter must be connected in the middle of the current loop, then'-l' suffix models **must be used** to provide the required isolation between the meter's current loop input and the power supply ground ("-V"). See Figures 2, 3, 4, and 5 for typical loop connections.

Table 2. Decimal Point Settings

| Switch S2 | | | | | | |
|-----------|-----|-----|-----|--|--|--|
| SW3 | SW4 | SW5 | SW6 | | | |
| DP1 | DP2 | DP3 | DP4 | | | |

Using the Decimal Point Settings Table as a guide, the DMS-40PC-4/20S's decimal points can be enabled to suit the user's particular readout requirements. Place the selected decimal point's DIP switch to the ON position (up) to illuminate the decimal point. The decimal points are merely placeholders, that is, they can all be illuminated or all turned off; they have no affect on the meter's operation and/or display readings.

OPERATING AND SETUP INSTRUCTIONS

The following procedure must be performed as the <u>first</u> re-calibration step every time DIP switches S1 and S2 are changed to select a new display range. The following procedure also assumes the DMS-40PC-4/20S is initially completely mis-adjusted, i.e., both potentiometers and both DIP switches S1 and S2 are randomly set. When performing switch settings, make sure that the DIP switch's small actuator is pushed up as far as it will go to ensure that the switch is truly set to the ON (closed) position.

- Set R7 (gain/span adjust) and R3 (zero/offset adjust) fully clockwise, roughly 20 turns, then using the settings found in the selected range, place the DIP switches on S1 and S2 to the appropriate positions for the desired display reading.
- Apply a precision 4mA input with proper polarity and adjust R3 (top 20-turn potentiometer) until the meter's display reads "0000".
- Apply a precision 20mA input and adjust R7 (bottom 20-turn potentiometer) until the display reads the maximum desired reading. Repeat steps 2 and 3 to make sure the adjustments did not affect one another.

DMS-40PC-4/20S

4½ Digit, 4-20mA Input, LED Display Meters

4. If necessary, select the appropriate decimal point by setting either SW3, SW4, SW5, or SW6 of S2 to ON (DP1, DP2, DP3, or DP4, respectively, as shown in Table 2).

NOTE: Please keep in mind that the transmitter's 4mA and 20mA output accuracy may affect display readings which are at, or very close to, the high and low extremes of the selected range. See Example #2 below and Technical Note 1 for more information.

Examples

The examples below illustrate how to configure the meter to perform some typical measurements. Remember to first set R3 and R7 to their full clockwise position before calibrating the meter.

1. Desired display readings are:

4mA = "0.000" 20mA = "3.000"






Use DIP-switch setting #3 and enable decimal point DP2 by placing SW4 of switch S2 to ON. Apply 4mA and adjust R3 so the display reads "0.000". Apply 20mA and adjust R7 so the display reads "3.000".

2. Desired display readings are:

4mA = "0000" 20mA = "8600"





Use DIP-switch setting #11. Apply 4mA and adjust R3 so the display reads "0000". Apply 20mA and adjust R7 so the display reads "8600". If the transmitter's full-scale output is less than 20.0mA, it may not be possible to adjust R7 for a reading of "8600" with setting #11. If this occurs, select setting #12 and re-calibrate both R3 and R7 to obtain "0000" and "8600". Note that for these display readings no decimal points are used. Set SW3, SW4, SW5 and SW6 on switch S2 to OFF.

3. Desired display readings are:

4mA = "0000" 20mA = "10000"





Use DIP-switch setting #13. Apply 4mA and adjust R3 so the display reads "0000". Apply 20mA and adjust R7 so the display reads "10000". For these display readings no decimal points are used. Set SW3, SW4, SW5 and SW6 on switch S2 to OFF.

4. Desired display readings are:

4mA = ".0000" 12mA = ".2500"





This example is not as straightforward as the previous three. Notice that 12mA is exactly halfway between 4mA and 20mA. If we assume the input could go up to 20mA, the display reading would then be $2 \times .2500$ or ".5000". From the table, we can select DIP-switch setting #7 and enable DP1 via SW3 of switch S2. Apply 4mA and adjust R3 so the display reads ".0000". Apply 12mA and adjust R7 so the display reads ".2500".

CONNECTION DIAGRAMS

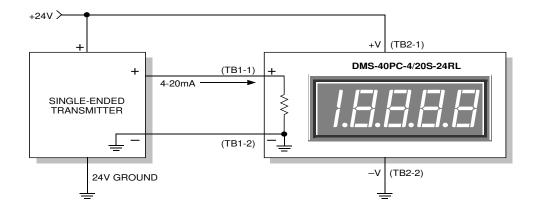


Figure 2. Typical Connections for Single-Ended Transmitters Driving Single-Ended +24V Powered Meters.

4½ Digit, 4-20mA Input, LED Display Meters

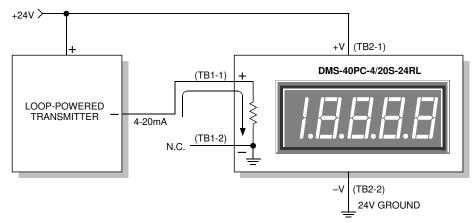


Figure 3. Typical Connections for Loop-Powered Transmitters Driving Single-Ended Meters.

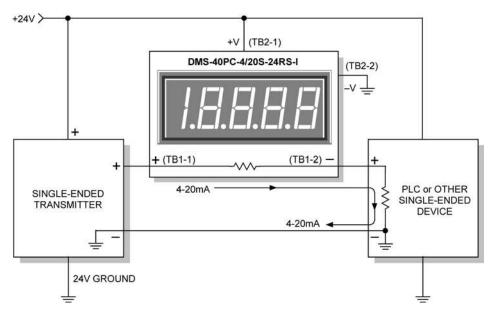


Figure 4. Typical Connections for Isolated-Supply Meters in Series with an Auxiliary Device.

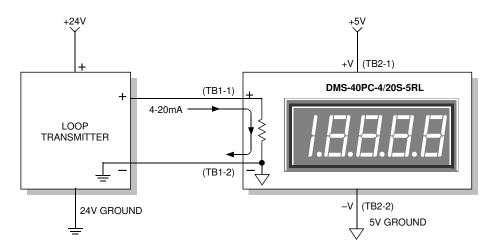


Figure 5. Typical Connections for +5V Powered Meters. Note that 5V Ground and 24V Ground are Tied Together Inside the Meter.

41/2 Digit, 4-20mA Input, LED Display Meters

MECHANICAL DIMENSIONS: Inches (mm)


TOLERANCES: 2 PL DEC ± 0.02 (± 0.51)

3 PL DEC ±0.010 (±0.254)

WIRE SIZE: 18 To 26 AWG


(Solid or stranded)

STRIPPING LENGTH: 0.20" (5.08mm)

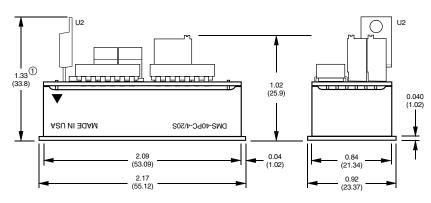


① Depth dimension for the DMS-40PC-4/20S-24RL model only U2 is not used on 5V-powered models.

Back View

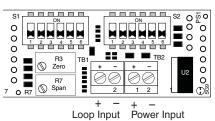



Front View




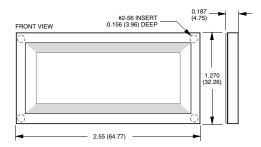

RECOMMENDED DRILL AND PANEL CUTOUT DIMENSIONS

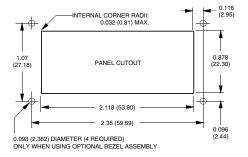

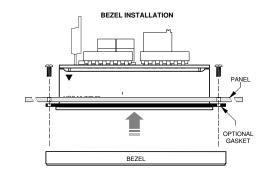

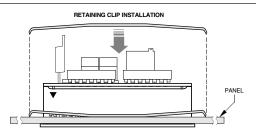

A panel-mount retaining clip is supplied with all models.

Murata Power Solutions, Inc.
11 Cabot Boulevard, Mansfield, MA 02048-1151 U.S.A.
ISO 9001 and 14001 REGISTERED



This product is subject to the following operating requirements and the Life and Safety Critical Application Sales Policy:

Refer to: http://www.murata-ps.com/requirements/

Murata Power Solutions, Inc. makes no representation that the use of its products in the circuits described herein, or the use of other technical information contained herein, will not infringe upon existing or future patent rights. The descriptions contained herein do not imply the granting of licenses to make, use, or sell equipment constructed in accordance therewith. Specifications are subject to change without notice.