



Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from,Europe,America and south Asia,supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of “Quality Parts,Customers Priority,Honest Operation,and Considerate Service”,our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip,ALPS,ROHM,Xilinx,Pulse,ON,Everlight and Freescale. Main products comprise IC,Modules,Potentiometer,IC Socket,Relay,Connector.Our parts cover such applications as commercial,industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China



Monitoring Relays 3-Phase Load Guard Types DWA01, PWA01

CARLO GAVAZZI



DWA01



PWA01

- Cos ϕ monitoring relays
- Measuring if power factor is within set limits
- Measure their own power supply (voltage) and current for balanced systems
- Measuring ranges for current: 5A and MI current transformers range
- Power ON delay 1, 2 or 6 s selectable
- Knob adjustable level on absolute scale
- Output: 8 A SPDT relay Normally Energized
- For mounting on DIN-rail in accordance with DIN/EN 50 022 (DWA01) or plug-in module (PWA01)
- 22.5 mm Euronorm housing (DWA01) or 36 mm plug-in module (PWA01)
- LED indication for power supply and output ON


Product Description

DWA01 and PWA01 are precise over or under cos ϕ monitoring relays. The relays monitor their own power supply voltage and the current of a balanced 3-phase system.

For current measure direct connection, 5A standard current transformers and MI CT can be used. The LED's indicate the state of the alarm and the output relay.

Ordering key

DWA 01 C M48 5A

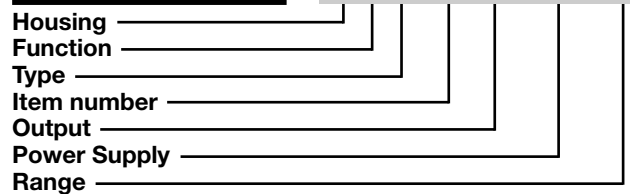

Type Selection

Mounting	Output	Supply: 208 to 240 VAC	Supply: 380 to 415 VAC	Supply: 380 to 480 VAC
DIN-rail	SPDT	DWA 01 C M23 5A		
Plug-in	SPDT	PWA 01 C M23 5A	PWA 01 C M48 5A	DWA 01 C M48 5A

Input Specifications

Input	Measuring ranges	Level
Voltage (Own power supply): 3 - phase DWA01: L1, L2, L3 PWA01: 5, 6, 7 M23: 208 to 240 VAC \pm 15% DWA01CM48: 380 to 480 VAC \pm 15% PWA01CM48: 380 to 415 VAC \pm 15%	Power factor (cos ϕ)	0.1 to 0.99
1- phase DWA01CM235A: L1, L3 PWA01CM235A: 5, 7 208 to 240 VAC \pm 15%	Direct input	AACrms Max. curr. 0.5 to 5 A 30A 30s
Current DWA01: 5A: L1, I2 MI CT: U1, U3 PWA01: 5A: 9, 10 MI CT: 8, 11	Standard CT (examples) TADK 2 50 A/5 A CTD1 150 A/5 A CTD4 400 A/5 A TAD12 1000 A/5 A TACO200 6000 A/5 A MI CT ranges MI 100 MI 500	5 to 50 A 60 A 15 to 150 A 180 A 40 to 400 A 480 A 100 to 1000 A 1200 A 600 to 6000 A 7200 A 10 to 100 A 250 AAC 50 to 500 A 750 AAC
	Note: The input voltage cannot raise over 300 VAC with respect to ground (PWA01 only).	
	Hysteresis	\sim cos ϕ = 0,02 - fixed



Output Specifications

Output	SPDT relay
Rated insulation voltage	250 VAC
Contact ratings (AgSnO₂)	μ
Resistive loads AC 1	8 A @ 250 VAC
DC 12	5 A @ 24 VDC
Small inductive loads AC 15	2.5 A @ 250 VAC
DC 13	2.5 A @ 24 VDC
Mechanical life	≥ 30 x 10 ⁶ operations
Electrical life	≥ 10 ⁵ operations (at 8 A, 250 V, cos φ = 1)
Operating frequency	≤ 7200 operations/h
Dielectric strength	
Dielectric voltage	≥ 2 kVAC (rms)
Rated impulse withstand volt.	4 kV (1.2/50 μs)

Supply Specifications

Power supply	Overvoltage cat. III (IEC 60664, IEC 60038)
Rated operational voltage through terminals:	
DWA01:	L1, L2, L3
PWA01:	5, 6, 7
M23	177 to 276 VAC 45 to 65 Hz
DWA01CM48	323 to 552 VAC 45 to 65 Hz
PWA01CM48	323 to 477 VAC 45 to 65 Hz
Dielectric voltage supply to output	None 2kV
Rated operational power	13 VA @400VAC Supplied by L1 and L3

General Specifications

Power ON delay	1, 2, or 6 s ± 0.5 s
Reaction time	(input signal variation from -20% to +20% or from +20% to -20% of set value)
Alarm ON delay	< 400 ms
Alarm OFF delay	< 400 ms
Accuracy	(15 min warm-up time)
Temperature drift	± 1000 ppm/°C
Repeatability	± 0.5% on full-scale
Indication for	
Power supply ON	LED, green
Output ON	LED, yellow
Environment	
Degree of protection	IP 20
Pollution degree	3 (DWA01), 2 (PWA01)
Operating temperature	
@ Max. voltage, 50 Hz	-20 to 60°C, R.H. < 95%
@ Max. voltage, 60 Hz	-20 to 50°C, R.H. < 95%
Storage temperature	-30 to 80°C, R.H. < 95%

Housing	
Dimensions	DWA01: 22.5 x 80 x 99.5 mm PWA01: 36 x 80 x 94 mm
Material	PA66 or Noryl
Weight	Approx. 200 g
Screw terminals	
Tightening torque	Max. 0.5 Nm acc. to IEC 60947
Product standard	EN 60255-6
Approvals	UL, CSA
CE Marking	L.V. Directive 2006/95/EC EMC Directive 2004/108/EC
EMC	
Immunity	According to EN 60255-26 According to EN 61000-6-2
Emissions	According to EN 60255-26 According to EN 61000-6-3



Function/Delay/Level Settings

Level setting (cos φ):
Knob adjustable on absolute scale, from 0.1 to 0.99

Setting of function and power ON delay
Adjust the desired function (over or underload monitoring) with DIP switch 1 and

the power ON delay with DIP Switches 3 and 4 as shown on the below table. To access the DIP-switch open the plastic cover using a

screwdriver as shown on the left.

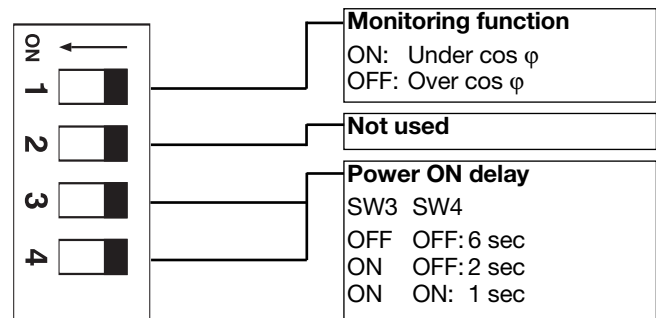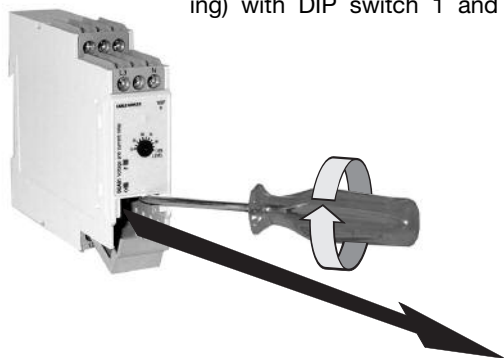

Mode of Operation

DWA01 and PWA01 can be used for monitoring the actual load of asynchronous motors.

The relays measure the 3-phase supply voltage and the current of the phase L1 connected to an asynchronous motor.

The relay monitor the cosine of the angle between motor current and motor voltage ($\cos \varphi$).

As $\cos \varphi$ varies with the load of the motor, overload (or underload) can be indirectly detected by DWA01 and

PWA01. The relation between the load and $\cos \varphi$ depends on the type of motor.

As a guideline to ensure correct working conditions for a motor, the level could be set above (or below) the $\cos \varphi$ marking on the motor. It is however recommended to make the adjustment in connection with a practical test. The relay has an inhibit delay at power ON in order to avoid overload detection during motor start.


Example 1: Overload monitoring. The relay operates and the yellow LED is ON as long as $\cos \varphi$ is below the set limit. The relay releases when it exceeds the set level.

Example 2: Underload monitoring. The relay operates and the yellow LED is ON as long as $\cos \varphi$ is above the set limit. The relay releases when it drops below the set level.


Example 3: DWA01CM235A and PWA01CM235A can be used for monitoring the $\cos \varphi$ of a 1-Phase load with 208 to 240 V AC mains voltage. In this case the power supply has to be connected between L1, L3 (or 5, 7) and L2 and L3 (or 6 and 7) have to be connected.

Operation Diagrams

Overload monitoring

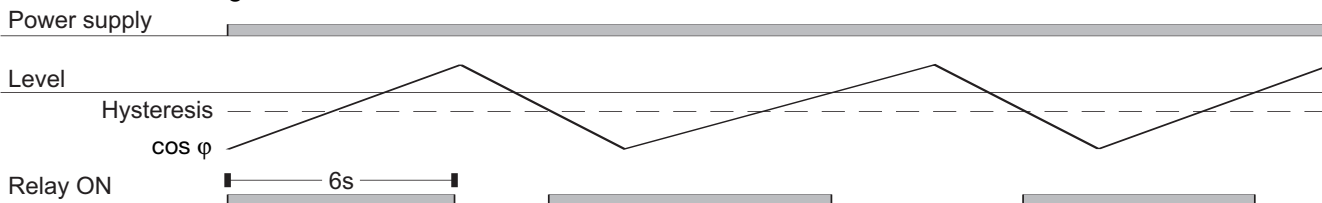


Underload monitoring

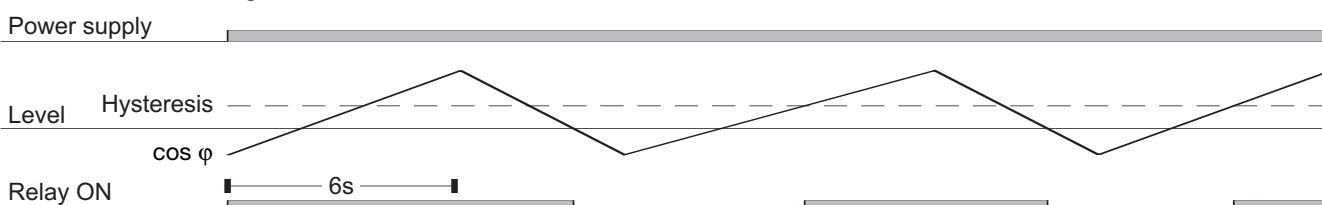


Wiring Diagrams







DWA01 - Direct connection

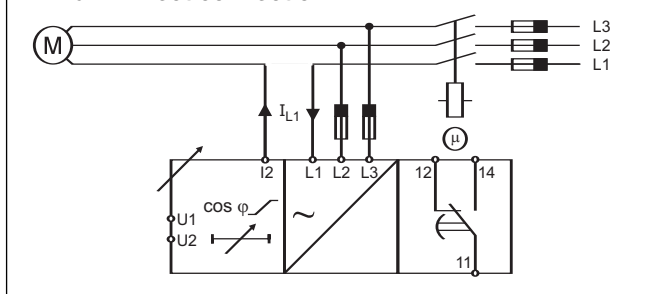

PWA01 - Direct connection

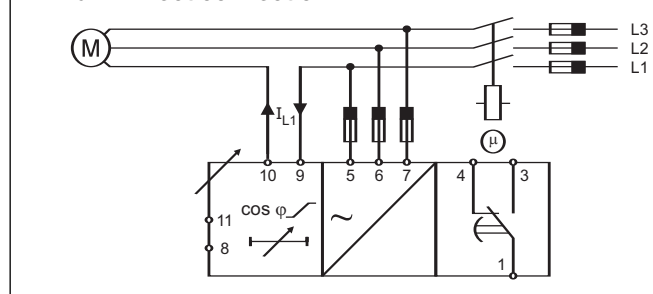

Wiring Diagrams (cont.)

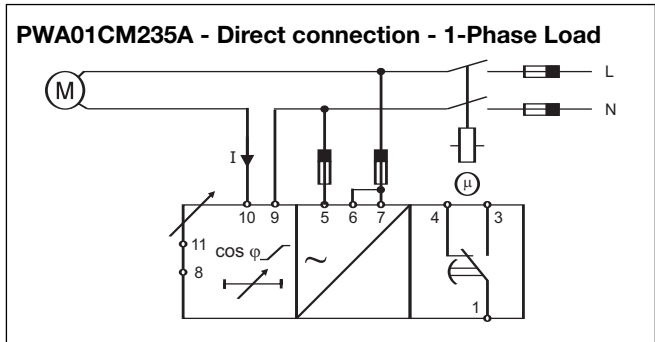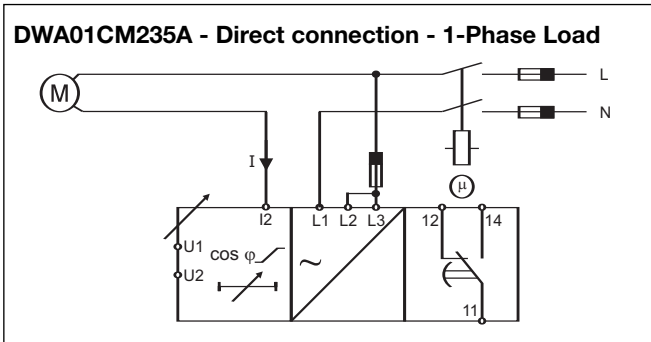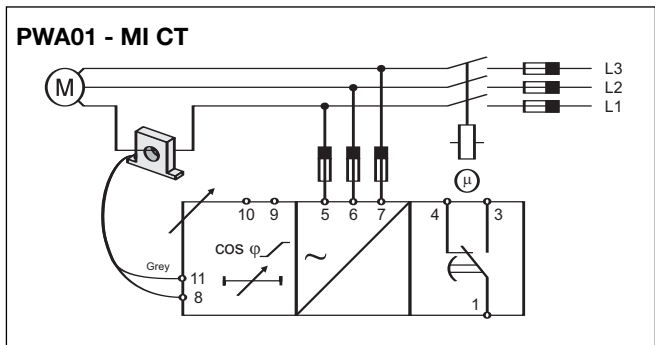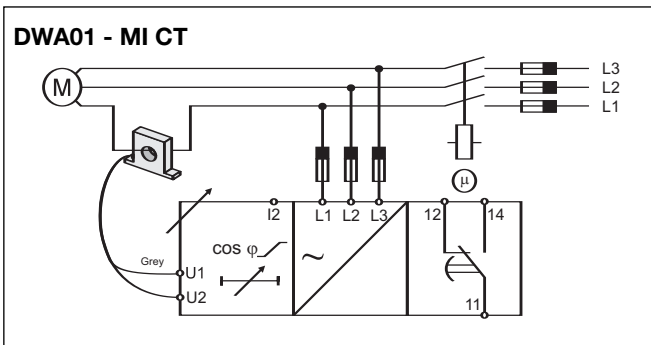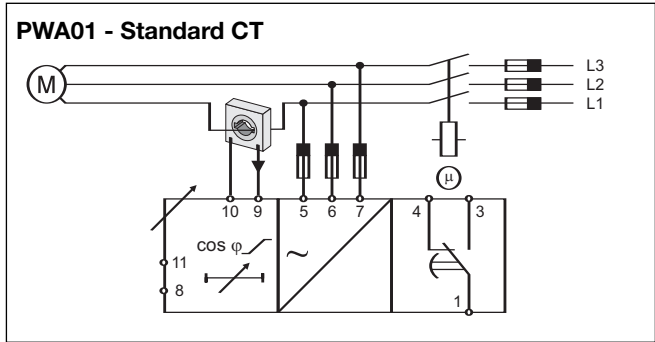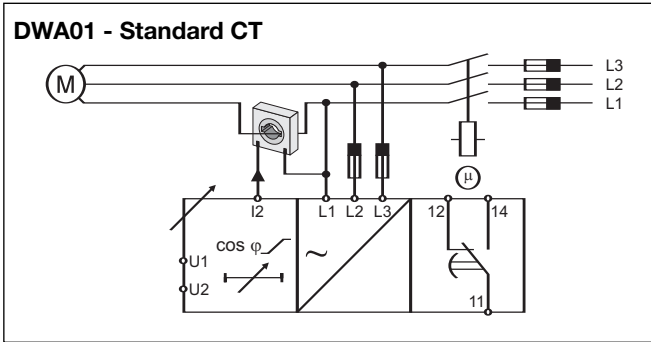

Dimensions

