

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



# Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China







FIBER SENSORS

Related Information

LASER SENSORS

PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY **SENSORS** 

PARTICUI AR

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE **INTERFACES** 

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Convergent Reflective

PM-64 PM-24

PM-44/PM-54



■ General terms and conditions ...... F-13

■ Glossary of terms / General precautions......P.1455~ / P.1458~



S)

Certified (Some models only)

■ Sensor selection guide......P.427~

■ Korea's S-mark...... P.1506





# **Enables space saving and quick installation!**

# **Equipped with two independent outputs**

All models are equipped with two independent outputs Light-ON and Dark-ON.

Hence, one model suffices even if the output is to be used differently, depending upon the location of use. Also, since two independent outputs have been provided, cumbersome handling of the output conversion control input, or fear of logic inversion due to a cable break, is eliminated. The sensor can be connected to the existing wiring as it is.

# **Quick fitting hook-up connector**

Easy to maintain connector type models are available. Its exclusive connector is the hookup connector.

Since only crimping with exclusive pliers is to be done, cumbersome soldering or insulation is absolutely not


Further, connector attached cable is also available.





Quick connection to the sensor.

#### xample of connection with a commercial intermediate connector

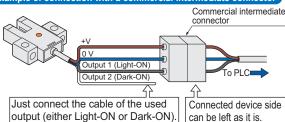

Note: Ensure to insulate the unused output wire.

# Wide model variety

A wide variety of 12 shapes and 24 models is available. You may select from this wide range to suit the mounting conditions.


### Meets global requirements

Conforms to Europe's EMC Directive and obtains UL Recognition.

The NPN output type with cable (excluding 3 m 9.843 ft cable length type) has also obtained Korea's Smark certification.

Both, NPN and PNP output models are available.

#### **APPLICATIONS**

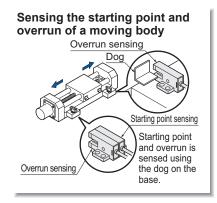

## ORDER GUIDE

		LK GOIDE				
Туре		Appearance (mm in)	Sensing range Model No.	Output	Output operation	
	K type	7 0.276		PM-K44	NPN open-collector transistor	
		25.4 1.000 26.2 1.031		PM-K44P	PNP open-collector transistor	
	T type	13.7 0.539		PM-T44	NPN open-collector transistor	
	_	26.2 1.024 1.031		PM-T44P	PNP open-collector transistor	
	L type	15.5 0.610		PM-L44	NPN open-collector transistor	
With cable	_	18.5 1.024 0.728		PM-L44P	PNP open-collector transistor	
With	Y type	15.5 0.610		PM-Y44	NPN open-collector transistor	
	Υt	25.5 13.4 0.528		PM-Y44P	PNP open-collector transistor	
	F type	13.2 0.520	PM-F44 PM-F44P PM-R44	PM-F44	NPN open-collector transistor	
	F ty	13.7 0.539 26.2 1.031		PNP open-collector transistor		
	R type	13,2 0.520		PM-R44	NPN open-collector transistor	Incorporated with 2 outputs: Light-ON / Dark-ON
Small		26.2 13.7 0.539	5 mm 0.197 in	PM-R44P	PNP open-collector transistor	
σ	K type	7 0.276	2.2	PM-K54	NPN open-collector transistor	
		25.4 1.000 22.2 0.874		PM-K54P	PNP open-collector transistor	
	T type	13.7 0.539		PM-T54	NPN open-collector transistor	
		26 1.024 22.2 0.874		PM-T54P	PNP open-collector transistor	
	L type	15.5 0.610	PM-L54 PM-L54P PM-Y54	PM-L54	NPN open-collector transistor	
With connector		26 1.024 1.024 1.024		PNP open-collector transistor		
With co	ype	15.5 0.610 21.5 13.4 0.528		PM-Y54	NPN open-collector transistor	
	Υ.			PM-Y54P	PNP open-collector transistor	
	F type	13.2 0.520		PM-F54	NPN open-collector transistor	
	Ft	13.7 0.539 22.2 0.874		PM-F54P	PNP open-collector transistor	
	R type	13.2 0.520		PM-R54	NPN open-collector transistor	
	Rt	13.7 0.539 22.2 0.874		PM-R54P	PNP open-collector transistor	

FIBER SENSORS

> LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

SYSTEMS

MEASURE-MENT SENSORS STATIC ELECTRICITY

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

- INVITATE TO

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide U-shaped

PM-64 PM-24

PM-44/ PM-54 FIBER SENSORS

## **ORDER GUIDE**

LASER SENSORS



AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS

LASER MARKERS PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Convergent Reflective

PM-64 PM-24 PM-44/ PM-54


3 m 9.843 ft cable length type 3 m 9.843 ft cable length type (standard: 1 m 3.281 ft) is also available. When ordering this type, suffix "-C3" to the model No. (e.g.) 3m 9.843 ft cable length type of PM-K44 is "PM-K44-C3".

# **OPTIONS**

Designation	Model No.		Description	
Connector	CN-14	Connector for soldering		
Hook-up	CN-14H	This connector can be hooked-up on 0.08 to 0.2 mm² cable simply in one grip. Wire diameter: Ø0.7 to Ø1.2 mm Ø0.028 to Ø0.047 in		
connector	CN-14H-2	Suitable for UL standard cable. This connector can be hooked-up on 0.18 to 0.22 mm² cable simply in one grip. Wire diameter: ø1.2 to ø1.52 mm ø0.047 to ø0.060 in		
Connector	CN-14H-C1	Length: 1 m 3.281 ft Net weight: 20 g approx.	For the connector type, with 0.2 mm <sup>2</sup>	
attached cable	CN-14H-C3	Length: 3 m 9.843 ft Net weight: 65 g approx.	4-core cabtyre cable Cable diameter: ø3.7 mm ø0.146 in	
Hook-up pliers	CN-HP	These are exclusive pliers for hook-up connectors <b>CN-14H</b> and <b>CN-14H-2</b> .		

#### Connector

• CN-14



## **Hook-up connector**

- CN-14H
- CN-14H-2

• CN-14H-C1


Connector attached cable

• CN-14H-C3



#### **Hook-up pliers**

• CN-HP



## **SPECIFICATIONS**

_		_	Sm	nall	
		Туре	With cable	With connector	
\	\ <u>\</u> 2	NPN output	PM-□44	PM-□54	
Item	Model No.	PNP output	PM-□44P	PM-□54P	
Sens	sing range		5 mm 0.19	7 in (fixed)	
Minin	num sensii	ng object	0.8 × 1.8 mm 0.031 × 0.071 in opaque object		
Hyste	eresis		0.05 mm 0.002 in or less		
Repe	eatability		0.03 mm 0.0	001 in or less	
Supp	ly voltage		5 to 24 V DC ±10 % R	Ripple P-P 10 % or less	
Curre	ent consum	nption	15 mA	or less	
Output			<npn output="" type=""> NPN open-collector transistor</npn>	<pnp output="" type=""> PNP open-collector transistor  • Maximum source current: 50 mA  • Applied voltage: 30 V DC or less (between output and +V)  • Residual voltage: 0.7 V or less (at 50 mA source current)  0.4 V or less (at 16 mA source current)</pnp>	
	Utilization	category	DC-12 or DC-13		
	Output op	eration	Incorporated with 2 outputs: Light-ON / Dark-ON		
Response time			Under light received condition: 20 µs or less, Under light interrupted condition: 100 µs or less (Response frequency: 1 kHz or more) (Note 2)		
Oper	ation indic	ator	Vermilion LED (lights up under light received condition)		
	Pollution of	degree	3 (Industrial environment)		
ø	Ambient to	emperature	-25 to +55 °C -13 to +131 °F (No dew condensation or icing allowed), Storage: -30 to +80 °C -22 to +176 °F		
Environmental resistance	Ambient h	umidity	35 to 85 % RH, Stor	rage: 35 to 85 % RH	
resis	Ambient il	luminance	Fluorescent light: 1,000 & at the light-receiving face		
ental	EMC		EN 60947-5-2		
Voltage withstandability		ithstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure		
invirc	Insulation	resistance	50 M $\Omega$ , or more, with 250 V DC megger between all	supply terminals connected together and enclosure	
Ш	Vibration i	resistance	10 to 2,000 Hz frequency, 1.5 mm 0.059 in ampl	itude in X, Y and Z directions for two hours each	
Shock resistance		istance	15,000 m/s² acceleration (1,500 G approx.) in X, Y and Z directions for three times each		
Emitting element		nt	Infrared LED (Peak emission wavelength: 940 nm 0.037 mil, non-modulated)		
Material			Enclosure: PBT, Slit cover: Polycarbonate, Terminal part [PM-□54(P) only]: Solder plated		
Cable	е		0.09 mm² 4-core cabtyre cable, 1 m 3.281 ft long		
Cable extension		n	Extension up to total 100 m 328.084 ft is possible with 0.3 mm², or more, cable.		
Weig	ıht		Net weight: 15 g approx.	Net weight: 3 g approx.	

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) The response frequency is the value when the disc, given in the figure below, is rotated.



FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

MEASURE-MENT SENSORS

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

Selection Guide

PM-64 PM-24

447

FIBER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS

CONTAINS)
SAFETY
COMPONENTS
PRESSURE /
FLOW
SENSORS
INDUCTIVE
PROXIMITY
SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

PARTICULAR

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

MACHINE VISION SYSTEMS


UV CURING SYSTEMS

SENSORS LASER SENSORS

# I/O CIRCUIT AND WIRING DIAGRAMS

# PM-□44 PM-□54

#### I/O circuit diagram

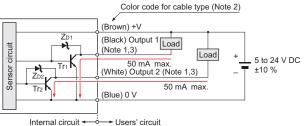


Notes: 1) Make sure to connect terminals correctly as the sensor does not incorporate a reverse polarity protection circuit.

Further, the output is not incorporated with a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load. Faulty wiring may result in damage.

- 2) The color code of the connector attached cable is also the same.
- 3) Ensure to insulate the unused output wire.

Symbols ... ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: NPN output transistor

#### Wiring diagram




NPN output type

#### **Output operation**

	Color code	Output operation
Output 1	Black	Light-ON
Output 2	White	Dark-ON

## PM-□44P PM-□54P PNP output type

#### I/O circuit diagram

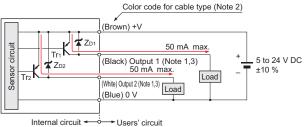

Notes: 1) Make sure to connect terminals correctly as the sensor does not incorporate a reverse polarity protection circuit.


Further, the output is not incorporated with a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load. Faulty wiring may result in damage.

2) The color code of the connector attached cable is also the same.

3) Ensure to insulate the unused output wire.

Symbols ... ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: PNP output transistor

#### Wiring diagram




#### **Output operation**

	Color code	Output operation
Output 1	Black	Light-ON
Output 2	White	Dark-ON

# SENSING CHARACTERISTICS (TYPICAL)

#### PM-L44(P)/K44(P) PM-L54(P)/K54(P)

#### Sensing position

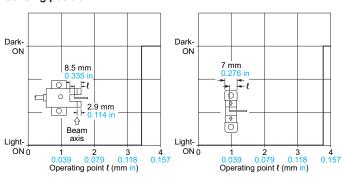

Selection Guide U-shaped Convergent Reflective

PM-64 PM-24 PM-44/ PM-54

#### PRECAUTIONS FOR PROPER USE

Refer to p.1458~ for general precautions.

#### All models



· Never use this product as a sensing device for personnel protection.

• In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.



Make sure to connect terminals correctly as the sensor does not incorporate a reverse polarity protection circuit.


Further, the output is not incorporated with a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load. Faulty wiring may result in damage.

#### Mounting

· When fixing the sensor with screws, use M3 screws and the tightening torque should not exceed the values given


Further, use small, round type plain washers (ø6 mm ø0.236 in).

Model No.	Tightening torque	
PM-□44(P)	0.5 N m	
PM-□54(P)	0.5 N·m	



#### **Cable extension**

· Cable extension is possible up to an overall length of 100 m 328.084 ft with a 0.3 mm<sup>2</sup>, or more, cable. However, since a voltage drop shall occur due to the cable extension, ensure that the power supply voltage at the end of the cable attached to the sensor or at the sensor terminals is within the rating.



But, when the overall cable length, including the cable attached to the sensor, is as given below, there is no need to confirm the voltage.

Conductor cross-section area of extension cable	Total cable length
0.08 to 0.1 mm <sup>2</sup>	Up to 5 m 16.404 ft
0.2 mm <sup>2</sup>	Up to 10 m 32.808 ft
0.3 mm²	Up to 20 m 65.617 ft

#### Others

· Since the sensor is intended for use inside machines, no special countermeasures have been taken against extraneous light. Take care that extraneous light is not directly incident on the beam receiving section.



· Do not use during the initial transient time (50 ms) after the power supply is switched on.



Selectio Guide

PM-64 PM-24

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR

USE SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

DEVICES LASER MARKERS

PLC

MACHINE INTERFACES

FA COMPONENTS MACHINE VISION SYSTEMS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS COMPONENTS PRESSURE

SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR SENSORS

SIMPLE WIRE-SAVING UNITS WIRE-SAVING SYSTEMS

SENSOR OPTIONS

MEASURE MENT SENSORS

LASER MARKERS

HUMAN

PLC

FA COMPONENTS

MACHINE VISION SYSTEMS

CURING SYSTEMS

PM-64 PM-24 PM-44/ PM-54

#### PRECAUTIONS FOR PROPER USE

#### PM-□54 PM-□54P


### Cautions in plugging or unplugging a connector




- · Do not plug or unplug a connector more than 10 times.
- · Be sure not to give stress more than 5 N to a terminal of both a connector and a sensor. If you do not follow the above cautions, it will cause a poor contact.

#### Procedures of plugging or unplugging a connector

①Insert a connector straight into a sensor until the connector lug is locked by the sensor hook.



When unplugging, give as much stress as a connector lug can be relieved from a hook. Then unplug it.



Caution: Be sure to hold a connector when plugging or unplugging it. Do not hold a terminal or a cable when plugging or unplugging the connector. Otherwise, it will cause a poor contact.



#### Soldering (Both connector CN-14 and sensor)


· If soldering is done directly on the terminals, strictly adhere to the conditions given below.

Soldering temperature	260 °C 500 °F or less
Soldering time	3 sec. or less
Soldering position	Refer to the below figure

Sensor	Connector
+V 1 2 0V	+V 1 2 0V 1.5 mm 0.059 in
	O O O Soldering position


#### Crimping of hook-up connectors CN-14H and CN-14H-2


Model No.	CN-14H	CN-14H-2
Conductor cross- section area	0.08 to 0.2 mm <sup>2</sup> (AWG28 to AWG24)	0.18 to 0.22 mm <sup>2</sup> (AWG25 to AWG24)
Wire diameter	Ø0.7 to Ø1.2 mm Ø0.028 to Ø0.047 in	ø1.2 to ø1.52 mm ø0.047 to ø0.060 in
Wire insulation material	Vinyl chloride or soft polyethylene	



#### Crimping method

①Strip the cable sheath 15 mm 0.591 in, or more, and insert the wires into the connector insertion holes till the wire tips reach the end.






②Crimp with the exclusive hook-up pliers CN-HP.

Notes: 1) When attaching or detaching the connector fitted with a cable, make sure to hold the connector firmly before proceeding. 2) After crimping, do not pull


on the cable.



Caution: Make sure to use the exclusive hook-up

pliers CN-HP. Commercially available pliers cannot be used.


 Prior to using the sensor, affix the cable in a way as to avoid direct stress on the crimped part.




## DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.


PM-K44 PM-K44P

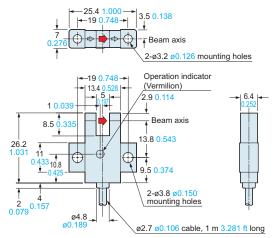


PM-T44 PM-T44P

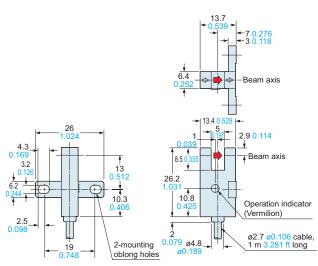

PM-L44 PM-L44P

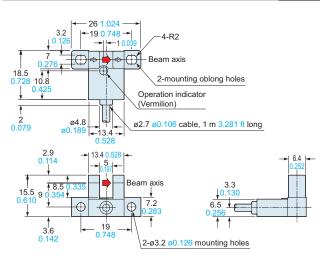


PM-Y44 PM-Y44P

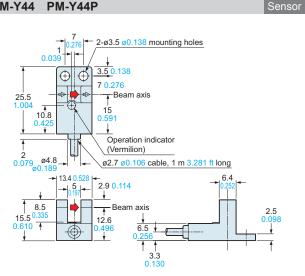



PM-F44 PM-F44P

Sensor

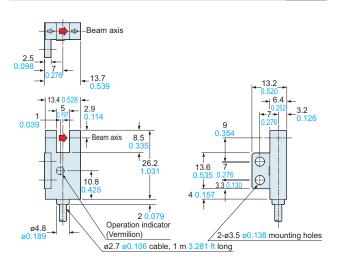

PM-R44 PM-R44P

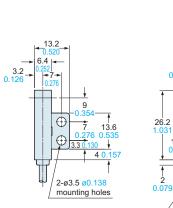

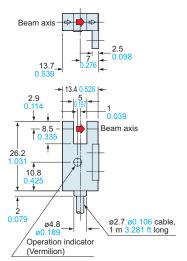

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

Selection Guide

Sensor

PM-64 PM-24

FIBER SENSORS

LASER SENSORS PHOTO-ELECTRIC SENSORS

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS PARTICULAR

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

SENSORS

MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

PLC HUMAN MACHINE INTERFACES

FA COMPONENTS MACHINE VISION SYSTEMS

CURING SYSTEMS


PM-64

PM-24


PM-44/ PM-54

DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.

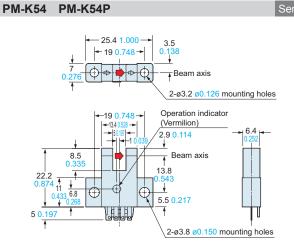



PM-T54 PM-T54P

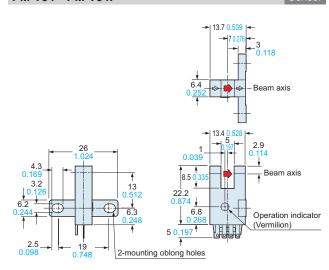

PM-L54 PM-L54P Sensor



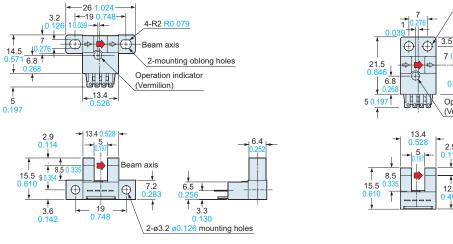


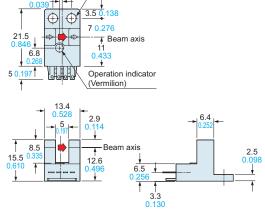


2-ø3.5 ø0.138 mounting holes

PM-F54 PM-F54P

PM-R54 PM-R54P

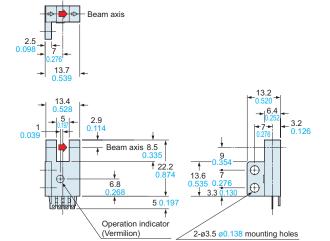


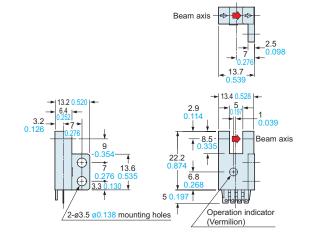


# DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.


### \*Terminal part (PM-=54, PM-=54P)

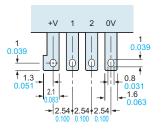




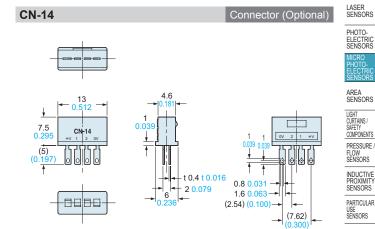



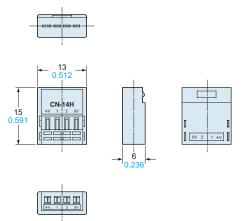

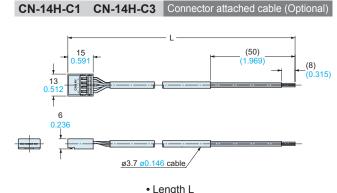

Longui	
Model No.	Length L
CN-14H-C1	1 m 3.281 ft
CN-14H-C3	3 m 9.843 ft

Selection Guide

SENSOR OPTIONS

MEASURE-MENT SENSORS

LASER MARKERS

FA COMPONENTS

MACHINE VISION SYSTEMS

PLC

Convergent Reflective

PM-64 PM-24