# mail

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



# Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832 Email & Skype: info@chipsmall.com Web: www.chipsmall.com Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China





# Gravity: HCHO Sensor SKU: SEN0231



#### Introduction

Our new Formaldehyde (HCHO) sensor module is Arduino and Raspberry Pi compatible and is an ideal solution for an indoor air quality monitor.

Usually HCHO is measured in air by reagent or colourimetric card, but these solutions are inefficient, can only be used once, and the end result is not always reliable.

The formaldehyde (HCHO) sensor module is compact and fully compatible with Arduino. Through it, you can measure the concentration of formaldehyde in air and measure the air quality. This sensor module is widely used in many air testing applications, such as indoor air quality applications or real time air quality monitoring stations. The HCHO sensor module can detect and measure HCHO with a high level of accuracy. It also has many advantages such as strong anti-jamming capabilities, high stability, ATC, high sensitivity (of up to 0.01ppm) and a long life guarantee (2 years in outdoor conditions). This module uses a 3 pin Gravity Interface for easy plug and play usage. With a wide input voltage range, and optional output signal, our module is compatible with a wide range of microcontrollers, including Arduino and Raspberry Pi. Use our pre-written sample codes to get your HCHO detector up and running very quickly. Used in an IoT application, it is possible to make an automatic air quality station which can measure HCHO in different sites.



When using the sensor module, avoid touching the white sensing film. Keep away from high concentration Hydrogen sulfide, hydrogen, methanol, ethanol and carbon monoxide. These gases will affect the precision and reduce the service life.

We recommend priming the module by powering it for 5 minutes on first use. Avoid organic solvents, coatings, medicines, oils and high concentration gases

Do not plug unplug the sensor on the module, and do not modify components on the PCB.

Avoid excessive impact or vibration.

Do not use the modules in systems that are related to human being's safety. Do not use the modules in strong convection environments.

Do not expose modules in high concentration organic gas for extended periods of time.

## **Specification**

- Input Voltage: 3.3~6V •
- Target Gas: HCHO (CH2O) •
- Interference Gas: Alcohol, CO & etc
- Detection Range: •
- Resolution: •
- Warm Up Time: ≤3 minutes
- Response Time: ≤60 seconds •
- Resume Time: ≤60 seconds •
- Interface Type: •

•

- Gravity PH2.0 3Pin Output Signal: Optional DAC(0.4~2V, for 0-5ppm) or UART(9600) •
- Operating Temp: 0~50°C •
  - Operating Hum: 15%RH-90%RH(No Condensation)


0~50°C

0~5ppm

0.01ppm

- Storage Temp: •
  - Working Life: 2 years(in air)

### **Board Overview**

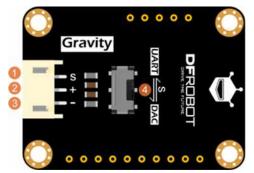

Num	Label	Description
1	S	Signal (DAC/UART)
2	+	VCC
3	-	GND
4	SW	Signal (UART or DAC) Output Switch

**HCHO Sensor** 

### Tutorial

This tutorial will show how to use this HCHO sensor.

The output signal can be UART mode or DAC mode.



We recommend to use UART mode for more accurate and stable result.

#### Requirements

- Hardware DFRduino UNO (or similar) x 1 HCHO Sensor Module x 1 Gravity 3P Cable x 1
- Software

Arduino IDE, Click to Download Arduino IDE from Arduino® https://www.arduino.cc/en/Main/Software%7C

#### UART Mode


Before using UART mode, please shift the switch to UART mode. In this mode, we'll use SoftwareSerial Port to read the data. Here is the data formula.

The default type for this module is active upload and it sends gas concentration every other one second. Commands as follow:

0	1	2	3	4	5	6	7	8
Start Byte	Gas Name CH2O	Unit ppb	No decimal byte	Concentration (High Byte)	Concentration (Low Byte)	Full Range (High Byte)	Full Range (Low Byte)	Checksum
OXFF	0X17	0x04	0x00	0x00	0x25	0x13	0x88	0x25

Gas concentration value=High byte of concentration \*256+ Low byte of concentration

#### **Connection Diagram**

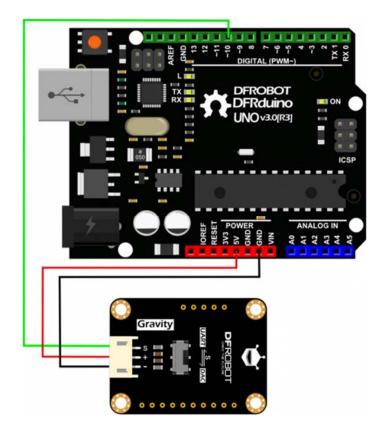

#### Sample Code

Please install DFRobotHCHOSensor Arduino Library first. https://raw.githubusercontent.com/DFRobot/DFRobotHCHOSensor/master/DFRobotHCHOSensor.zip How to install Libraries in Arduino IDE. https://www.arduino.cc/en/Guide/Libraries#.UxU8mdzF9H0%7C

```
By Jason <jason.ling@dfrobot.com@dfrobot.com>
GNU Lesser General Public License.
See <http://www.gnu.org/licenses/> for details.
All above must be included in any redistribution
 1. This code is tested on Arduino Uno with Arduino IDE 1.0.5 r2.
2. In order to protect the sensor, do not touch the white sensor film
on the sensor module,
and high concentration of Hydrogen sulfide, hydrogen, methanol, ethano
1, carbon monoxide should be avoided.
3. Please do not use the modules in systems which related to human bei
ng's safety.
 #include <DFRobotHCHOSensor.h>
#include <SoftwareSerial.h>
#define SensorSerialPin 10 //this pin read the uart signal from th
e HCHO sensor
SoftwareSerial sensorSerial(SensorSerialPin,SensorSerialPin);
DFRobotHCHOSensor hchoSensor(&sensorSerial);
void setup()
{
   sensorSerial.begin(9600); //the baudrate of HCHO is 9600
   sensorSerial.listen();
   Serial.begin(9600);
}
void loop()
```

```
if(hchoSensor.available()>0)
{
    Serial.print(hchoSensor.uartReadPPM());
    Serial.println("ppm");
}
```

#### **Expected Results**

1	Send
	Send
0.03ppm	

As indicated above, the value will be printed on the serial monitor every second.


#### DAC Mode

Before using DAC mode, please shift the switch to DAC mode. In this mode, we'll use Arduino Analog port to read the value.




In DAC mode, the measurement accuracy will be affected by the bits of the ADC and reference voltage. So the accurate power supply or reference voltage and 10-bit ADC are recommended.

The relation between voltage(V) and concentration(PPM) are linear. 0.4V -> 0ppm 2.0V -> 5ppm So the function diagram is shown as the following:

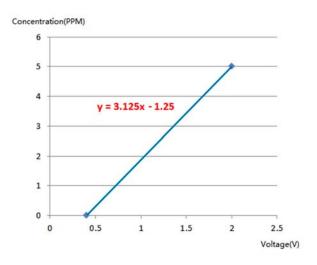

**Connection Diagram** 

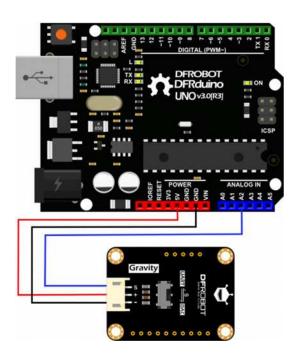

Sample Code Click here to download the sample code first. https://raw.githubusercontent.com/DFRobot/DFRobotHCHOSensor/master/HCHO\_Simple\_DAC\_Test.zip

```
DFRobot Gravity: HCHO Sensor
<https://www.dfrobot.com/wiki/index.php/Gravity:_HCHO_Sensor_SKU:_S
EN0231>
This example reads the concentration of HCHO in air by DAC mode.
Created 2016-12-15
By Jason <jason.ling@dfrobot.com@dfrobot.com>
GNU Lesser General Public License.
See <http://www.gnu.org/licenses/> for details.
All above must be included in any redistribution
1. This code is tested on Arduino Uno with Arduino IDE 1.0.5 r2.
2. In order to protect the sensor, do not touch the white sensor fi
lm on the sensor module,
and high concentration of Hydrogen sulfide, hydrogen, methanol, eth
anol, carbon monoxide should be avoided.
3. Please do not use the modules in systems which related to human
being's safety.
#define SensorAnalogPin A2 //this pin read the analog voltage from
the HCHO sensor
#define VREF 5.0
                     //voltage on AREF pin
void setup()
{
  Serial.begin(9600);
}
void loop()
```

```
{
    Serial.print(analogReadPPM());
    Serial.println("ppm");
    delay(1000);
}
float analogReadPPM()
{
    float analogVoltage = analogRead(SensorAnalogPin) / 1024.0 * VREF
;
    float ppm = 3.125 * analogVoltage - 1.25; //linear relatio
nship(0.4V for 0 ppm and 2V for 5ppm)
    if(ppm<0) ppm=0;
    else if(ppm>5) ppm = 5;
    return ppm;
}
```

```
Expected Results
```

	Send
D. 03ppm	Le contracte
0.03ppm	
0.03ppm	
0.03ppm	
0.03ppm	
). 03ppm	
). 03ppm	
0.03ppm	
). 03ppm	
). 03ppm	
). 03ppm	

As indicated above, the value will be printed on the serial monitor every second.

https://www.dfrobot.com/wiki/index.php/Gravity:\_HCHO\_Sensor\_SKU:\_SEN0231 5-3-17