

Chipsmall Limited consists of a professional team with an average of over 10 year of expertise in the distribution of electronic components. Based in Hongkong, we have already established firm and mutual-benefit business relationships with customers from, Europe, America and south Asia, supplying obsolete and hard-to-find components to meet their specific needs.

With the principle of "Quality Parts, Customers Priority, Honest Operation, and Considerate Service", our business mainly focus on the distribution of electronic components. Line cards we deal with include Microchip, ALPS, ROHM, Xilinx, Pulse, ON, Everlight and Freescale. Main products comprise IC, Modules, Potentiometer, IC Socket, Relay, Connector. Our parts cover such applications as commercial, industrial, and automotives areas.

We are looking forward to setting up business relationship with you and hope to provide you with the best service and solution. Let us make a better world for our industry!



Contact us

Tel: +86-755-8981 8866 Fax: +86-755-8427 6832

Email & Skype: info@chipsmall.com Web: www.chipsmall.com

Address: A1208, Overseas Decoration Building, #122 Zhenhua RD., Futian, Shenzhen, China









WaveAce™ 1000 and 2000 Oscilloscopes

40 MHz-300 MHz



- Sample rates up to 2 GS/s
- 1 Mpts/ch memory,
 2 Mpts interleaved
- 7" color display on all models
- 32 automatic measurements
- Multi-language user interface and context sensitive help
- Large internal waveform and setup storage
- USB connections for printers, memory sticks and PC remote control



A good oscilloscope should simplify how you work and shorten the time it takes to find and debug problems. The WaveAce™ combines long memory, a color display, extensive measurement capabilities, advanced triggering and excellent connectivity to improve troubleshooting and shorten debug time. With bandwidths from 40 MHz to 300 MHz, sample rates up to 2 GS/s and waveform memory up to 1 Mpts/Ch (2 Mpts interleaved) the WaveAce exceeds all expectations of a small affordable oscilloscope.


Measure and Debug Tools

With 32 automatic measurements standard, the WaveAce simplifies how measurements are made. The large 7" widescreen display can show up to five measurements without crowding the waveform display or show all 32 at once with the measurement dashboard. A wide range of advanced timing parameters provide insight to the relationship between signals on two different channels. WaveAce oscilloscopes provide five math functions for additional analysis including Add, Subtract, Multiply, Divide and FFT. The FFT can be viewed using four different windows and two different vertical scales for an insightful view of the frequency domain. Built-in Pass/Fail Mask testing allows for quick identification of problems and highlights when they have occurred.

Easy to Use for Faster Debug


The high performance and large feature set of the WaveAce is controlled by an intuitive user interface with 11 different languages and a streamlined front panel. All important controls and menus are accessed from the front panel with a single button press. All position and offsets can be reset by simply pressing the knob, pressing the V/Div knob will switch between fixed and variable gain and pressing the T/div knob will togale between zoom modes. Buttons on the front panel that open and close menus or switch modes, are backlit so that the mode of operation is easily visible to the user.

THE TOOLS AND FEATURES FOR ALL YOUR DEBUG NEEDS

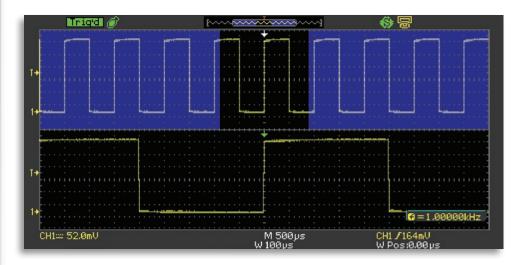


Long Capture and Zoom

Small, portable oscilloscopes often suffer from short capture time due to the small waveform memory. The WaveAce has up to 1 Mpts/ch of memory which is two to three times larger than competitive products. More memory results in longer capture times showing more waveform detail with each trigger. Activate the built-in zoom function to take a closer look at the details.

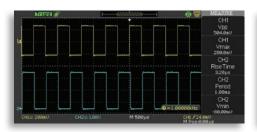

1 125.004z (5.000043.a/z) | Molte Pos = 34,40000 | 102 - 500a0 | M 500as | Hanning | Social Males

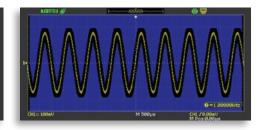

Automatic Measurements

The WaveAce provides two display modes for viewing any of the 32 automatic mesurements. Five measurements can be displayed at the same time without crowding the waveform, or all 32 measurements can be displayed using the dashboard.

Waveform Math

The WaveAce provides five math functions including Add, Subtract, Multiply, Divide and FFT. The FFT capability includes the choices of four windows and two different vertical scales.

Pass/Fail Test

With built-in Pass/Fail Mask testing the WaveAce can quickly identify problems and let you know when they occur. A history of the P/F results can be displayed on the screen.

Digital Filter

Digital filtering is available on each channel of the WaveAce. The Low-Pass, High-Pass, Band-Pass and Band-Stop filters allow you to isolate only the frequencies you want to see.

Waveform Sequence Recorder

Capture and replay a sequence of up to 2,500 waveforms to isolate that runt or glitch which is causing problems in your system.

Advanced Triggering

Edge triggering is not always the best choice for every signal. Beyond the basic edge trigger is a set of trigger capabilities which include Pulse Width, Video and Slope (Rise Time) triggers.

Connectivity

The WaveAce provides a USB host port on the front panel for saving screen images, waveforms and setups to a memory stick. A rear panel USB device port allows for connection to a PC or printer. Connecting and communicating with a PC is simplified with WaveStudio software providing full access to the oscilloscope's display, measurements, and waveform data.

Large Internal Storage

Saving and recalling waveforms and setups from internal memory can save a lot of time during test and debug. The WaveAce can save up to 20 waveforms, 20 setups and two reference waveforms to the internal memory.

Acquisition Modes

Different applications call for different acquisition modes. The WaveAce offers Real Time, Equivalent Time, Peak Detect and Averaging modes to ensure that any waveform can be captured and displayed.



WaveStation Integration

With 5 basic signal types, and over 40 built-in arbitrary waveforms Teledyne LeCroy's WaveStation is a versatile waveform generator. A variety of modulation schemes, intuitive waveform editing software and remote control capabilities, enable versatile waveform generation of waveforms up to 50 MHz. The 3.5" display and simple user interface make it easy to generate a wide range of waveforms. Additionally, connecting a WaveAce oscilloscope to the same PC enables transferring real world signals from the WaveAce to the WaveStation.



LogicStudio 16 Integration

The WaveAce can be paired with Teledyne LeCroy's LogicStudio 16 to turn your PC into a mixed signal oscilloscope with tools for capturing, viewing and measuring analog, digital and serial signals in one place. LogicStudio offers 16 channels, 100 MHz and up to 1 GS/s logic analysis with I²C, SPI and UART triggering and decoding which can all be displayed alongside the analog waveforms captured on WaveAce. When only digital debug is needed disconnect the WaveAce and use LogicStudio as a standalone logic analyzer.

SMART, SIMPLE, EFFICIENT

1. Fast Power Up

The WaveAce turns on and is ready for use in under 10 seconds.

2. Display

All WaveAce models have a 7" widescreen color display.

3. Connectivity

Saving waveforms, screenshots and setups is easy with the front panel USB port for use with a memory stick.

4. Portability

The small compact form factor is lightweight and only 5" deep.

5. Communication

Rear panel USB port enables direct remote control from a PC. The USB port also allows for connecting to a printer.




6. Intensity

Waveform intensity can be quickly adjusted by rotating this knob, a meter on the display will appear and show the current setting.

7. Individual Vertical Controls

Quickly change the vertical scale of any channel.

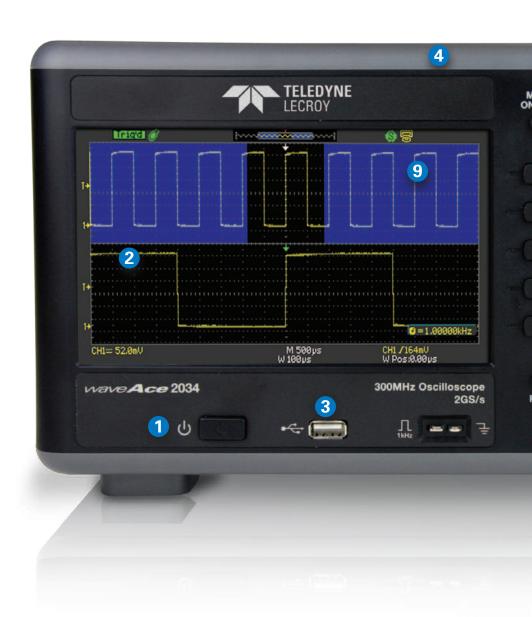



8. Push Knobs

All WaveAce knobs can be pushed for additional capabilities. Push the V/div knobs to toggle between fixed and variable gain. Push the T/div knob to enter zoom mode and push the position knobs to center the waveform on screen.

9. Local Language User Interface

The intuitive user interface is available in several different languages.

10. Front Panel Print Button

Saving or Printing screenshots requires only a single button press.

11. Backlit Menu Buttons

When using certain features like Cursors or Measurements the button remains lit for easy menu navigation.

12. Context Sensitive Help

Press any button or turn any knob while in help mode and a pop-up window displays the functionality of that control.

13. Auto Setup

Quickly configures the vertical, horizontal and trigger settings for the WaveAce. Choose to view the waveform as multi-cycle, singlecycle, rising or falling edge.

WAVEACE 1000 SPECIFICATIONS

	WaveAce 1001	WaveAce 1002	WaveAce 1012					
Vertical								
Bandwidth	40 MHz	60 MHz	100 MHz					
Rise Time	8.8 ns	5.8 ns	3.5 ns					
Input Channels	0.0 113	2	0.0 113					
Vertical Resolution		8-bits						
Vertical Sensitivity		2 mV/div – 10 V/div						
Bandwidth Limiting Filter		20 MHz						
Maximum Input Voltage		400 Vpk, CAT I						
Input Coupling		GND, DC 1 M Ω , AC 1 M Ω						
Input Impedance		1 MΩ 18 pF						
		1 Ινίζ2 10 μΓ						
Acquisition								
Sampling Rate (Single Shot)		1 GS/s (interleaved),						
		500 MS/s (all channels)						
Sampling Rate (Equivalent Time)	25 GS/s		GS/s					
Peak Detect Period		10 ns						
Memory Length		1 Mpts/Ch						
Maximum Memory		2 Mpts						
Timebase Range	10.0 ns/div - 50 s/div	5.0 ns/div - 50 s/div	2.5 ns/div - 50 s/div					
Probes								
Standard Probes	10:1, 1:1	Switchable Passive Probe (one per	channel)					
Triggering								
Triggers	Edge, Puls	se Width, Video, Slope (Rise Time),	Alternate					
Measure, Math and Wave R	ecorder							
Measure		Width Cyclic BMS + Duty Cycle -	Duty Cycle Fall Time Frequency					
Measure	May Mean Min Overshoot Peak-	Amplitude, Average, Base, Burst Width, Cyclic RMS, + Duty Cycle, - Duty Cycle, Fall Time, Frequency, Max, Mean, Min, Overshoot, Peak-Peak, Period, Phase, Preshoot, Rise Time, RMS, Top, + Width, - Width						
		parameters for edge to edge timing						
Math		de, FFT (up to 1 kpts with Rectangu						
Math	Add, Subtract, Multiply, Divi	Blackman windows)	ilai, von Hann, Hanning of					
Waveform Sequence Recorder	Record and a	playback a sequence of up to 2,500	waveforms					
•	necord and p	biayback a sequence of up to 2,000	Waveloning					
Input/Output Interfaces								
USB	USB host port for flash	drives, USB device port for connec	ting to PC and printers					
Physical								
Dimensions (HWD)	163 mm x 313 mm x 115.8 mm; 6.42" x 12.32" x 4.6"							
Weight	2.78 kg; 6.10 lbs.							
Power Requirements								
-	100 - 240 V (± 10%) at 50 / 60 / 400 Hz (± 5%).							
	Automatic AC v	oltage selection. Max power consu	umption: 50 W					
Compliance								
		CE Compliant, UL and cUL listed.						
	Conforms to EN 61326-1 EN 6	1010-1, UL 61010-1 2nd edition, ar	nd CSA C22 2 No. 61010-1-04					

WAVEACE 2000 SPECIFICATIONS

	WaveAce 2002	WaveAce 2004	WaveAce 2012	WaveAce 2014	WaveAce 2022	WaveAce 2024	WaveAce 2032	WaveAce 2034
Vertical								
Bandwidth	70 MHz	70 MHz	100 MHz	100 MHz	200 MHz	200 MHz	300 MHz	300 MHz
Rise Time	5.0 ns	5.0 ns	3.5 ns	3.5 ns	1.75 ns	1.75 ns	1.2 ns	1.2 ns
Input Channels	2	4	2	4	2	4	2	4
Vertical Resolution				8-t				
Vertical Sensitivity				2 mV/div				
Bandwidth Limiting Filter								
Maximum Input Voltage		20 MHz 400 Vpk, CAT I 400 Vpk, CAT I (1 MΩ), 5 V _{rms} (50 Ω)				50 O)		
Input Coupling			Ω , AC 1 M Ω			ND , DC 1 $M\Omega$,		
Input Impedance			18 pF	,	- Gi	$1 \text{ M}\Omega \parallel 18$		22
		1 17122	μ το ρι			1 10122 10	σρι, σο 32	
Acquisition								
Sampling Rate (Single Shot)				2 GS/s (in	terleaved)			
				1 GS/s (all	channels)			
Sampling Rate (Equivalent Time)				50 (GS/s			
Peak Detect Period				2.5	ns			
Memory Length				12 kp	ts/Ch			
Maximum Memory					<pts< td=""><td></td><td></td><td></td></pts<>			
Timebase Range	5.0 ns/div	- 50 s/div			- 50 s/div		1.0 ns -	50 s/div
Probes								
Standard Probes			10·1 1·1 Sw	ritchable Passi	ve Probe (one	ner channel)		
			10.1, 1.1 0	110110010 1 0001	1000 (0110	por charmon		
Triggering								
Triarara	Edge, Pulse Width, Video, Slope (Rise Time), Alternate							
inggers			Edge, Pulse \	Width, Video,	Slope (Rise Tir	ne), Alternate		
	Recorder		Edge, Pulse \	Width, Video,	Slope (Rise Tir	ne), Alternate		
Measure, Math and Wave		a Average Ro					a Fall Tima Fr	reguency
Measure, Math and Wave	Amplitud		ase, Burst Wic	Ith, Cyclic RM	S, + Duty Cyc	e, - Duty Cycle		
Measure, Math and Wave	Amplitud	n, Min, Oversh	ase, Burst Wic	Ith, Cyclic RM k, Period, Pha	S, + Duty Cyc se, Preshoot,	le, - Duty Cycle Rise Time, RM	1S, Top, + Wid	
Measure, Math and Wave Measure	Amplitud Max, Mear	n, Min, Oversh Plus 9	ase, Burst Wic loot, Peak-Pea ladvanced par	Ith, Cyclic RM k, Period, Pha ameters for e	S, + Duty Cyc se, Preshoot, dge to edge ti	le, - Duty Cycle Rise Time, RM ming measure	1S, Top, + Wid ments	lth, - Width.
Measure, Math and Wave Measure	Amplitud Max, Mear	n, Min, Oversh Plus 9	ase, Burst Wic	Ith, Cyclic RM k, Period, Pha ameters for ed FFT (up to 1 k	S, + Duty Cyc se, Preshoot, dge to edge ti cpts with Rect	le, - Duty Cycle Rise Time, RM ming measure	1S, Top, + Wid ments	lth, - Width.
Measure, Math and Wave Measure Math	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M	ase, Burst Wic loot, Peak-Pea advanced par ultiply, Divide,	Ith, Cyclic RM k, Period, Pha ameters for ea FFT (up to 1 k Blackman	S, + Duty Cyc se, Preshoot, dge to edge ti tots with Rect windows	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H	1S, Top, + Wid ments ann, Hammin	lth, - Width.
Measure, Math and Wave Measure Math	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M	ase, Burst Wic loot, Peak-Pea ladvanced par	Ith, Cyclic RM k, Period, Pha ameters for ea FFT (up to 1 k Blackman	S, + Duty Cyc se, Preshoot, dge to edge ti tots with Rect windows	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H	1S, Top, + Wid ments ann, Hammin	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M	ase, Burst Wic loot, Peak-Pea advanced par ultiply, Divide,	Ith, Cyclic RM k, Period, Pha ameters for ea FFT (up to 1 k Blackman	S, + Duty Cyc se, Preshoot, dge to edge ti tots with Rect windows	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H	1S, Top, + Wid ments ann, Hammin	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R	ase, Burst Wic loot, Peak-Pea ladvanced par ultiply, Divide, ecord and play	ith, Cyclic RM k, Period, Pha ameters for e FFT (up to 1 k Blackman /back a seque	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn	1S, Top, + Wid ments ann, Hammin ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea l advanced par ultiply, Divide, ecord and play	ith, Cyclic RM k, Period, Pha ameters for e FFT (up to 1 k Blackman /back a sequel ves, USB devi	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H 500 waveforn	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea ladvanced par ultiply, Divide, ecord and play	ith, Cyclic RM k, Period, Pha ameters for e FFT (up to 1 k Blackman /back a sequel ves, USB devi	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H 500 waveforn	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea l advanced par ultiply, Divide, ecord and play	ith, Cyclic RM k, Period, Pha ameters for e FFT (up to 1 k Blackman /back a sequel ves, USB devi	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2	le, - Duty Cycle Rise Time, RIV ming measure angular, Von H 500 waveforn	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea ladvanced par ultiply, Divide, ecord and play ort for flash dri AN port for co	Ith, Cyclic RM k, Period, Pha ameters for er FFT (up to 1 k Blackman /back a seque ves, USB devi	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn nnecting to PC Studio softwar	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD)	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea ladvanced par ultiply, Divide, ecord and play ort for flash dri AN port for co	ith, Cyclic RM k, Period, Pha ameters for e FFT (up to 1 k Blackman /back a sequel ves, USB devi	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows noce of up to 2 ce port for cor C using Wave:	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn nnecting to PC Studio softwar	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea ladvanced par ultiply, Divide, ecord and play ort for flash dri AN port for co	Ith, Cyclic RM k, Period, Pha ameters for er FFT (up to 1 k Blackman /back a sequer ves, USB devi innection to Po	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows noce of up to 2 ce port for cor C using Wave:	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn nnecting to PC Studio softwar	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Triggers Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight Power Requirements	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wichoot, Peak-Peak advanced parkultiply, Divide, ecord and playort for flash drivan AN port for co	Ith, Cyclic RM k, Period, Pha ameters for ea FFT (up to 1 k Blackman /back a seque ves, USB devi innection to Po 60 mm x 124.1 3.33 kg;	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave mm; 6.42" x 7.40 lbs.	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveform meeting to PC Studio softwar	1S, Top, + Wid ments ann, Hamming ns	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wichoot, Peak-Pea advanced par ultiply, Divide, ecord and play ort for flash dri AN port for co	Ith, Cyclic RM k, Period, Pha ameters for ex FFT (up to 1 k Blackman /back a seque ves, USB devi nnection to Pr 3.33 kg; V (± 10%) at	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave: mm; 6.42" x 7.40 lbs.	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveform necting to PC Studio softwar 14.17" x 4.89"	1S, Top, + Wid ments lann, Hamming ns and printers	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight Power Requirements	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wichoot, Peak-Peak advanced parkultiply, Divide, ecord and playort for flash drivan AN port for co	Ith, Cyclic RM k, Period, Pha ameters for ex FFT (up to 1 k Blackman /back a seque ves, USB devi nnection to Pr 3.33 kg; V (± 10%) at	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave: mm; 6.42" x 7.40 lbs.	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveform necting to PC Studio softwar 14.17" x 4.89"	1S, Top, + Wid ments lann, Hamming ns and printers	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea l advanced par ultiply, Divide, ecord and play ort for flash dri AN port for co 163 mm x 36 100 - 240 omatic AC volt	ith, Cyclic RM k, Period, Pha ameters for er FFT (up to 1 k Blackman rback a sequer ves, USB devi connection to Pr 3.33 kg; V (± 10%) at rage selection.	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave mm; 6.42" x 7.40 lbs.	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn necting to PC Studio softwar 14.17" x 4.89" Hz (± 5%). onsumption: 5	1S, Top, + Wid ments lann, Hamming ns and printers	lth, - Width.
Measure, Math and Wave Measure Math Waveform Sequence Recorder Input/Output Interfaces USB LAN Physical Dimensions (HWD) Weight Power Requirements	Amplitud Max, Mear	n, Min, Oversh Plus 9 d, Subtract, M R USB host po	ase, Burst Wic loot, Peak-Pea l advanced par ultiply, Divide, ecord and play ort for flash dri AN port for co 163 mm x 36 100 - 240 omatic AC volt	Ith, Cyclic RM k, Period, Pha ameters for ex FFT (up to 1 k Blackman /back a seque ves, USB devi nnection to Pr 3.33 kg; V (± 10%) at	S, + Duty Cyc se, Preshoot, dge to edge ti pts with Rect windows nce of up to 2 ce port for cor C using Wave mm; 6.42" x 7.40 lbs.	le, - Duty Cycle Rise Time, RM ming measure angular, Von H 500 waveforn necting to PC Studio softwar 14.17" x 4.89" Hz (± 5%). onsumption: 5	1S, Top, + Wid ments lann, Hamming ns and printers	lth, - Width.

ORDERING INFORMATION

Ordering Information

Product Description	Product Code
40 MHz, 500 MS/s, 2 Ch, 1 Mpts/Ch with 7" Color Display. 1 GS/s Interleaved, 1 M Ω Input	WaveAce 1001
60 MHz, 500 MS/s, 2 Ch, 1 Mpts/Ch with 7" Color Display. 1 GS/s Interleaved, 1 M Ω Input	WaveAce 1002
100 MHz, 500 MS/s, 2 Ch, 1 Mpts/Ch with 7" Color Display. 1 GS/s Interleaved, 1 M Ω Input	WaveAce 1012
70 MHz, 1 GS/s, 2 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 1 M Ω Input	WaveAce 2002
70 MHz, 1 GS/s, 4 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 1 M Ω Input	WaveAce 2004
100 MHz, 1 GS/s, 2 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 1 M Ω Input	WaveAce 2012
100 MHz, 1 GS/s, 4 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 1 M Ω Input	WaveAce 2014
200 MHz, 1 GS/s, 2 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 50/1 M Ω Input	WaveAce 2022
200 MHz, 1 GS/s, 4 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 50/1 M Ω Input	WaveAce 2024
300 MHz, 1 GS/s, 2 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 50/1 M Ω Input	WaveAce 2032
300 MHz, 1 GS/s, 4 Ch, 12 kpts/Ch with 7" Color Display. 24 kpts, 2 GS/s Interleaved, 50/1 M Ω Input	WaveAce 2034

Product Code

Included with Standard Configuration

One Passive Probe per Channel	
Multi-language User-interface and Help (English, French,	
German, Italian, Japanese, Korean, Russian, Simplified	
Chinese, Spanish, Traditional Chinese)	
USB Cable for use with WaveStudio	
Getting Started Manual	
CE and Performance Certificate	
3-year Warranty	

Accessories

Soft Carrying Case for WaveAce Oscilloscopes WA-SOFTCASE

Customer Service

Teledyne LeCroy oscilloscopes and probes are designed, built, and tested to ensure high reliability. In the unlikely event you experience difficulties, our digital oscilloscopes are fully warranted for three years and our probes are warranted for one year.

This warranty includes:

- No charge for return shipping
- Long-term 7-year support
- Upgrade to latest software at no charge

For more information, please contact:





1-800-5-LeCroy teledynelecroy.com

Local sales offices are located throughout the world. Visit our website to find the most convenient location.